CITY OF DYERSBURG, TENNESSEE PUBLIC WORKS DEPARTMENT

RECEIVED

November 17, 2021

TENNESSEE DEPARTMENT OF ENVIRONMENT & CONSERVATION STATE REVOLVING FUND LOAN PROGRAM

CG7 2020-439
WPN 22.0026
APPROVED FOR CONSTRUCTION
THE DOCUMENT BEARING THIS STAMP HAS BEEN RECEIVED AND REVIEWED BY THE
TENNESSEE DEPTARTMENT OF ENVIRONMENT & CONSERVATION
DIVISION OF WATER RESOURCES, SRF LOAN PROGRAM
AND IS HEREBY APPROVED FOR CONSTRUCTION BY THE COMMISSIONER

Not Without

JUNE 2, 2022

THIS APPROVAL SHALL NOT BE CONSTRUED AS CREATING A PRESUMPTION
OF CORRECT OPERATION OR AS WARRANTING BY THE COMMISSIONER THAT
THE APPROVED FACILITIES WILL REACH THE DESIGNED GOALS.

APPROVAL EXPIRES ONE YEAR FROM ABOVE DATE

MANHOLE REHABILITATION SANITARY SEWER REHABILITATION BASINS A, B, K, J, W, M, B7, B8, B9, & N

MAYOR AND BOARD OF ALDERMEN

MAYOR JOHN HOLDEN ALDERMAN AT LARGE **EDWARD BURKS** ALDERMAN AT LARGE MEGHAN GILBERT ALDERMAN AT LARGE VANEDDA WEBB **ALDERMAN WARD 1** WILLIE COLE **ALDERMAN WARD 2** JAMES BALTIMORE **ALDERMAN WARD 3** RICKY HAMMOND **ALDERMAN WARD 4 DENNIS MOODY ALDERMAN WARD 5** MARY CLAIRE HOPPER


SEPTEMBER 2021

TABLE OF CONTENTS				
G0.00	COVER SHEET			
G0.01	GENERAL NOTES			
G0.02	VICINITY MAP			
G0.03 - G0.04	TABULATION OF WORK			
C2.01 - C2.28	MANHOLE REHABILITATION MAP			
C9.01 - C9.02	MANHOLE REHABILITATION DETAILS			

DESIGN CONSULTANT :



Civil Contact: Akeem Turner, PE Phone: (615) 770-8170 Email: akeem.turner@greshamsmith.com

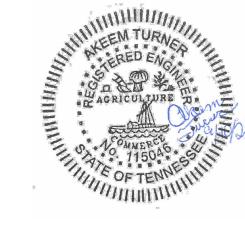

DATE ISSUED FOR REVIEW:	
DATE ISSUED FOR BID:	
DATE ISSUED FOR CONSTRUCTION:	

JOB NUMBER: 43303.01

SET NUMBER:

GENERAL NOTES

- 1. THE CONTRACTOR SHALL RESTORE ALL CULVERTS, FENCES, WALLS, SMALL ORNAMENTAL TREES, POWER POLES, STREET MARKERS, MAIL BOXES, WATER AND GAS LINES, WATER AND GAS METERS AND BOXES INCLUDING SHUT-OFFS, AND LAWNS DISTURBED BY CONSTRUCTION OPERATIONS TO THEIR ORIGINAL CONDITIONS. THE COST OF THIS WORK SHALL BE INCLUDED IN THE UNIT PRICES AND CONTRACT BID PRICE FOR THE PROPOSED SEWER WORK.
- 2. WHERE IN EASEMENTS, THE CONTRACTOR SHALL PROTECT AND RESTORE SAID PROPERTY TO CONDITION SIMILAR OR EQUAL TO THAT EXISTING AT THE COMMENCEMENT OF CONSTRUCTION, EXCEPT AS NOTED.
- 3. THE LOCATION AND DEPTHS OF EXISTING UNDERGROUND SANITARY SEWERS AND OTHER UTILITIES ARE SHOWN IN AN APPROXIMATE MANNER ONLY. THE CONTRACTOR SHALL DETERMINE THE EXACT LOCATION OF ALL EXISTING UTILITIES BEFORE COMMENCING WORK IN EACH AREA. HE AGREES TO BE FULLY RESPONSIBLE FOR ANY AND ALL DAMAGES WHICH ARE RESULTING FROM HIS FAILURE TO EXACTLY LOCATE AND PRESERVE ANY AND ALL UNDERGROUND UTILITIES.
- 4. SUFFICIENT PRECAUTIONS SHALL BE TAKEN DURING CONSTRUCTION TO MINIMIZE THE RUN-OFF OF POLLUTING SUBSTANCES, SUCH AS SILT, CLAY, FUELS, OILS, BITUMENS, CALCIUM CHLORIDE, OR OTHER POLLUTING MATERIALS HARMFUL TO HUMANS, FISH OR OTHER LIFE, INTO THE SUPPLIES AND SURFACE WATERS OF THE STATE. CONTROL MEASURES MUST BE ADEQUATE TO ASSURE THAT TURBIDITY IN THE RECEIVING WATER WILL NOT BE INCREASED MORE THAN 10 NEPHELOMETRIC TURBIDY UNITS, (NTU), OR AS OTHERWISE REQUIRED BY THE STATE OR OTHER CONTROLLING BODY. SPECIAL PRECAUTIONS SHALL BE TAKEN IN THE USE OF CONSTRUCTION EQUIPMENT TO PREVENT OPERATIONS WHICH PROMOTE EROSION.
- 5. UTILITY CONSTRUCTION SIGNS IN COMPLIANCE WITH THE REQUIREMENTS IN THE "MANUAL ON UNIFORM TRAFFIC CONTROL DEVICES" SHALL BE ERECTED WHERE CONSTRUCTION IS IN CLOSE PROXIMITY OF ROADWAYS. THE CONTRACTOR SHALL COMPLY WITH ALL REQUIREMENTS OF THE CITY OF DYERSBURG AND THE TENNESSEE DEPARTMENT OF TRANSPORTATION WITH REGARD TO UTILITY CONSTRUCTION WITHIN THEIR RIGHTS-OF-WAY.
- 6. FOR EXISTING UTILITY LOCATIONS, THE CONTRACTOR SHALL CONTACT TENNESSEE "ONE-CALL" AT 811 AS WELL AS ALL UTILITY OWNERS NOT MEMBERS OF THE TENNESSEE "ONE-CALL" SYSTEM, AT LEAST 72 BUSINESS HOURS IN ADVANCE OF BEGINNING EXCAVATION. THE CONTRACTOR SHALL COMPLY WITH THE REQUIREMENT OF TENNESSEE CODE ANNOTATED (TCA) 65-31-101 CONCERNING THE RESPONSIBILITIES ASSOCIATED WITH EXCAVATION PROCEDURES TO PREVENT DAMAGE TO UNDERGROUND UTILITIES.
- A. UTILITY COORDINATION AND COSTS SHALL BE INCLUDED IN THE PROJECT SCHEDULE. IT IS THE EXPLICIT RESPONSIBILITY OF THE CONTRACTOR TO ASSURE THAT THE PROJECT SCHEDULE INCLUDES THE NECESSARY RELOCATION. THE CONTRACTOR WILL NOT BE PAID ADDITIONALLY FOR THIS COORDINATION.
- 7. THE CONTRACTOR SHALL BE SOLELY RESPONSIBLE FOR THE DISPOSAL OF WASTE MATERIALS GENERATED DURING CONSTRUCTION. MATERIALS EXCAVATED WITHIN THE RIGHTS-OF-WAY OF STREETS AND ROADWAYS SHALL BE LOADED DIRECTLY INTO TRUCKS AND HAULED TO AN OWNER APPROVED DISPOSAL SITE AND SHALL NOT BE STOCKPILED IN THE STREET OR ROADWAY RIGHT-OF-WAY.
- 8. IN THE EVENT THAT DISCREPANCIES OR ERRORS IN THE PLANS ARE DISCOVERED OR IF PROBLEMS ARE ENCOUNTERED DURING CONSTRUCTION, THE CONTRACTOR SHALL CONSULT THE ENGINEER AND OWNER BEFORE PROCEEDING WITH THE AFFECTED WORK.

GENERAL NOTES (CONTINUED)

- 9. THE CONTRACTOR SHALL TAKE CARE TO PROTECT PUBLIC AND PRIVATE PROPERTY ADJACENT TO AND IN THE VICINITY OF THE PROJECT SITE. DAMAGE TO PUBLIC AND / OR PRIVATE PROPERTY, INCLUDING ROADWAYS, UTILITIES AND OTHER FACILITIES SHALL BE REPAIRED BY THE CONTRACTOR AT HIS EXPENSE TO THE SATISFACTION OF THE CITY OF DYERSBURG PUBLIC WORKS DEPARTMENT.
- A. EXISTING FENCES DISTURBED BY CONSTRUCTION SHALL BE REPLACED WITH NEW MATERIALS OF EQUAL OR BETTER SIZE, STRENGTH, ETC. REGARDLESS OF FUNCTIONALITY OF EXISTING FENCE. REPLACEMENT FENCE SHALL BE CONSTRUCTED IN ACCORDANCE WITH INDUSTRY STANDARDS.
- B. TRENCHES IN THE VICINITY OF BUILDINGS AND RAILROADS SHALL BE SHORED AND BRACED AS REQUIRED TO PROTECT AND PREVENT DAMAGE TO SUCH BUILDINGS AND RAILROADS. CONTRACTOR SHALL BE RESPONSIBLE FOR CORRECTING DAMAGE TO BUILDINGS AND RAILROADS RESULTING FROM EXCAVATION ACTIVITIES.
- C. EXISTING RETAINING WALLS DISTURBED BY CONSTRUCTION SHALL BE REPLACED TO A CONDITION EQUAL TO OR BETTER THAN CURRENT CONDITION.
- 10. THE CONTRACTOR IS RESPONSIBLE FOR SITE LAYOUT, ESTABLISHING LINES AND GRADES, INCLUDING FIELD STAKING AS NECESSARY FOR SITE LAYOUT AND GRADING.
- 11. ALL EXISTING UTILITIES ARE TO REMAIN IN SERVICE WHILE THE PROPOSED LINE IS BEING INSTALLED AND PLACED INTO SERVICE.
- A. SEWER CONNECTIONS SHALL BE DONE IN SUCH A MANNER AS TO MAINTAIN LIVE FLOW AT ALL TIMES. THE CONTRACTOR SHALL PROVIDE TEMPORARY BYPASS PUMPING AS REQUIRED TO MAINTAIN THE FLOW. NO SEWAGE SHALL BE ALLOWED TO FLOW ONTO GROUND OR INTO EXISTING DRAINAGE WAYS.
- 12. THE CONTRACTOR SHALL BE SOLELY AND COMPLETELY RESPONSIBLE FOR THE JOB SITE CONDITIONS DURING WORKING AND NON-WORKING HOURS FOR THE CONSTRUCTION PERIOD. INCLUDING SAFETY.
- 13. THE CONTRACTOR SHALL OBTAIN ALL REQUIRED PERMITS AND APPROVALS, PAY ALL FEES AND PROVIDE ALL NOTIFICATIONS NECESSARY TO COMPLETE THE WORK SHOWN ON THE PLANS PRIOR TO COMMENCING CONSTRUCTION AND SHALL COMPLY WITH ALL FEDERAL, STATE AND LOCAL LAWS, ORDINANCES AND REGULATIONS APPLICABLE TO THE PROJECT.
- A. ALL FEES, LICENSES, AND PERMITS NECESSARY FOR THIS CONSTRUCTION ARE TO BE OBTAINED PRIOR TO INITIATION OF CONSTRUCTION AND THE COST OF SAME TO BE BORN BY THE CONTRACTOR.
- B. THE CONTRACTOR SHALL OBTAIN ALL PERMITS FROM STATE AND OR COUNTY HIGHWAY DEPARTMENT TO CROSS ALL HIGHWAYS AND STREETS AND/OR ENCROACH ON RIGHT-OF-WAYS.
- 14. THE CONTRACTOR SHALL PROTECT AND PRESERVE PROPERTY MARKERS, MONUMENTS, SURVEY MARKS, AND BENCHMARKS. ALL PROPERTY MARKERS AND MONUMENTS RELOCATED DURING CONSTRUCTION SHALL BE REESTABLISHED BY A REGISTERED LAND SURVEYOR AT THE CONTRACTOR'S EXPENSE.
- 15. THE CONTRACTOR SHALL VERIFY ALL EXISTING SEWER INVERTS AT CONNECTION LOCATIONS PRIOR TO BEGINNING CONSTRUCTION.

GENERAL NOTES (CONTINUED)

- 16. DEVIATION FROM THESE PLANS AND NOTES WITHOUT THE PRIOR CONSENT OF THE OWNER'S REPRESENTATIVE MAY BE CAUSE FOR THE WORK TO BE UNACCEPTABLE.
- 17. ALL WORK AND MATERIALS SHALL COMPLY WITH THE CITY OF DYERSBURG REGULATIONS AND CODES OF O.S.H.A. STANDARDS.
- THE CONTRACTOR SHALL NOT DISPOSE OF ANY CONSTRUCTION MATERIAL OR DEBRIS BY OPEN BURNING.
- 19. ALL AREAS NOT OTHERWISE SURFACED ARE TO BE SEEDED, LANDSCAPED, MULCHED, WATERED, AND MAINTAINED UNTIL AN ADEQUATE STAND OF GRASS IS OBTAINED.
- 20. UNLESS OTHERWISE SPECIFIED, ALL SLOPES ARE TO BE COVERED WITH A MINIMUM OF 4" OF TOPSOIL.
- 21. THE CONTRACTOR SHALL VERIFY ALL DIMENSIONS PRIOR TO BEGINNING CONSTRUCTION.

PAVING SCHEDULE				
DETAIL REFERENCE	ROADWAY NAME			
	N. SAMPSON AVENUE			
	PARR AVENUE			
	PENNELL LANE			
	PHILLIPS STREET			
HEAVY DUTY ASPHALT -	SR 104 (FORREST STREET AND MCGAUGHEY STREET)			
	SR 78 (LAKE ROAD)			
DETAIL 8, C9.02	TN 211 (US 51 BUSINESS / SR 3 BUSINESS)			
	TROY AVENUE			
	TUCKER STREET			
	UPPER FINLEY ROAD			
	US 51 (ST. JOHN AVENUE)			
	US 51 BYPASS / SR 3			
LIGHT DUTY ASPHALT -	ALL OTHER ASPHALT REPAIR			
DETAIL 4, C9.02	ALL OTTILN ASPHALT NEPAIN			



GreshamSmith.com

1661 International Drive Suite 400 Memphis, TN 38120

901.753.5590

OLE REHABILITATION OF DYERSBURG C WORKS



PUBL


	Revision				
No.	Date	Description			

GENERAL NOTES

G0.02

43303.01 SEPTEMBER 2021

Wastewater 22.0026

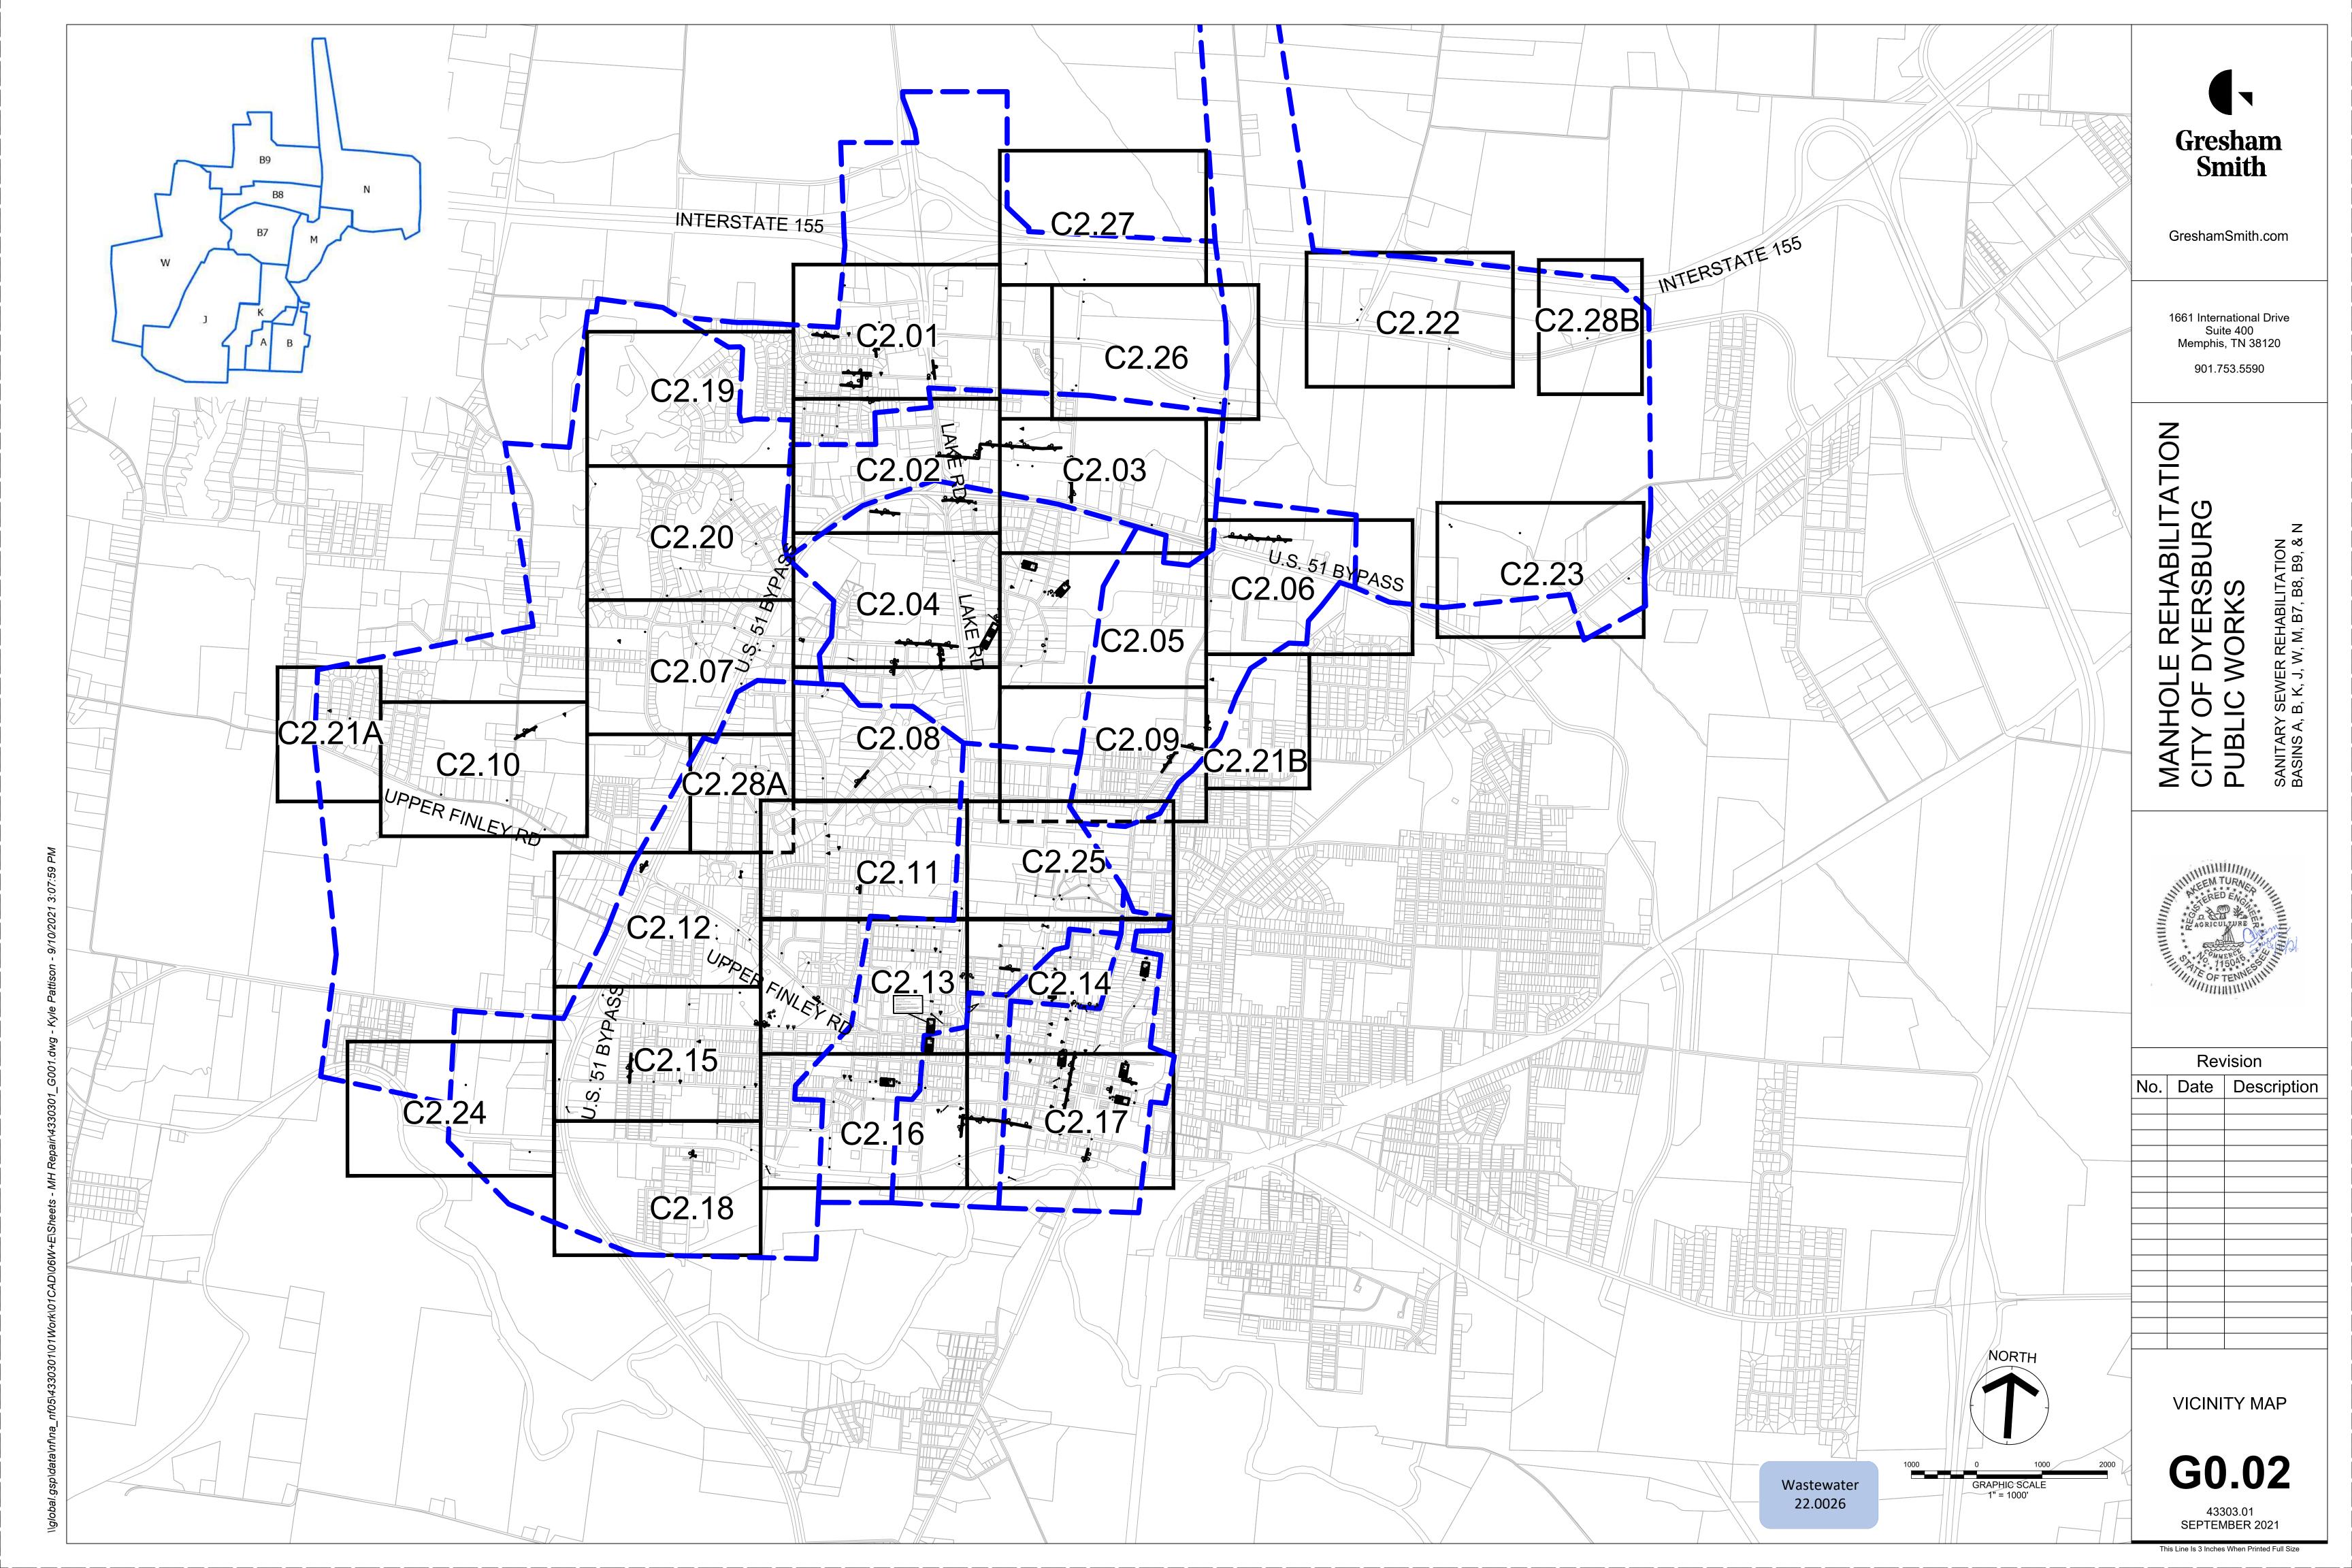

MANHOLE TABULATION OF WORK						
Item Number	Manhole Number	Sheet Reference	Address	Location Details	Rim-to-Invert, ft	Rehabilation Comments
2	A-2 A-4	C2.14 C2.14	134 Watkins St 547 Sugg Pl	In the intersection of Vaughn and Watkins In the intersection at Sugg and Doyle	8.0 9.7	Cementitious Coating Cementitious Coating
3	A-24	C2.16	140 Connell Ave	In the street at intersection near address	6.0	Cementitious Coating, Replace Bench and Channel
4 5	A-32 A-38	C2.13 C2.13	200 Connell Ave 106 Connell Ave	In intersection In roadway	19.2 18.3	Cementitious Coating Cementitious Coating
6	B-9	C2.14	505 Elm Ave	In the grass across the street from address.	10.2	Cementitious Coating Cementitious Coating
7	B-13	C2.17	203 E McGaughey St	In the street at address	13.1	Cementitious Coating, Replace Bench and Channel
8	B-16	C2.17	216 Court St	At the bottom of the hill in the field near steps at address.	11.7	Cementitious Coating
9 10	B-20 B-21KM	C2.17 C2.17	304 Main Ave 315 Main Ave	On the edge of the road in front of address.	18.2 10.2	Cementitious Coating Cementitious Coating
11	B-21KIVI	C2.17	106 Market St	In the entrance to alley.	5.5	Cementitious Coating Cementitious Coating
12	B-64	C2.14	417 Church Ave	In the street in front of empty lot	7.9	Cementitious Coating
13	B7-14	C2.04	815 Wade Hampton Rd	On other side of street from address	9.1	Cementitious Coating
14 15	B7-18 B7-26	C2.04 C2.04	1815 Lake Rd 2120 Lake Rd	Off Wade Hampton Rd In sidewalk in front of address	12.6 11.4	Cementitious Coating Cementitious Coating
16	B7-26	C2.05	1802 Glen Oaks Ln	Across Country Club Rd	6.9	Cementitious Coating Cementitious Coating, Replace Bench and Channel, Install Inside Drop
17	B7-57	C2.05	510 Okeena Dr	In backyard	9.1	Cementitious Coating
18	B7-60	C2.05	411 Starlight Dr	In backyard	3.7	Cementitious Coating, Replace Bench and Channel
19 20	B7-103 B8-17	C2.04 C2.02	600 Country Club Rd 111 Volunteer Blvd	In backyard In the road at the bend in front of address.	7.8 4.9	Cementitious Coating, Replace Bench and Channel Cementitious Coating
21	B8-22	C2.02	2300 Lake Rd	In grass near sidewalk	15.5	Cementitious Coating Cementitious Coating
22	B8-24	C2.02	2300 Lake Rd	At the edge of drainage ditch.	12.0	Cementitious Coating
23	B8-25	C2.02	2450 Lake Rd	At the end of the driveway in the southeast side of parking lot.	9.7	Cementitious Coating, Replace Bench and Channel
24 25	B8-26 B8-27	C2.02 C2.03	2450 Lake Rd 2359 Federal Dr	In drainage ditch behind building. In the road in front of the tennis court area.	14.2 8.4	Cementitious Coating Cementitious Coating
25	B8-27 B8-28	C2.03	564 US 51 BYP	In the road in front of the tennis court area. In the parking lot.	12.3	Cementitious Coating Cementitious Coating, Replace Bench and Channel
27	B8-30	C2.03	564 US 51 BYP	In parking lot.	3.6	Cementitious Coating, Replace Bench and Channel
28	B8-33	C2.03	2335 Federal Dr	In the grass, next to sidewalk by the apartments.	8.0	Cementitious Coating
29	B8-34	C2.03	2335 Federal Dr	In the middle of the road at address.	6.0	Cementitious Coating
30 31	B8-35 B8-36	C2.03 C2.03	420 US 51 BYP 420 US 51 BYP	In the grass. Front yard at street.	14.3 19.9	Cementitious Coating Cementitious Coating
32	B9-1	C2.01	898 Northview Cove	In cul-de-sac	6.6	Cementitious Coating, Replace Bench and Channel
33	B9-16	C2.01	800 Southview Dr	In cul-de-sac	5.7	Cementitious Coating
34	B9-40	C2.02	1114 Janice Ln	In street in front of address	5.0	Cementitious Coating, Replace Bench and Channel
35 36	B9-42 B9-43	C2.02 C2.02	2115 Beverly Dr 2082 Ellen Dr	In street in front of address In street in front of address	4.9 6.4	Cementitious Coating, Replace Bench and Channel Cementitious Coating, Replace Bench and Channel
37	B9-44	C2.02	2134 Ellen Dr	In street in front of address	5.4	Cementitious Coating, Replace Bench and Channel
38	B9-46	C2.01	2153 Beverly Drive	In street in front of address	8.4	Cementitious Coating, Replace Bench and Channel
39	B9-47	C2.01	2150 Ellen Dr	In street in front of address	7.3	Cementitious Coating
40 41	B9-53 B9-56	C2.01 C2.01	2660 Lake Rd 2730 Lake Rd	In front of address near sidewalk. In the entrance to Taco Bell.	9.5 6.5	Cementitious Coating Cementitious Coating, Replace Bench and Channel
42	B9-78	C2.26	555 Mall Blvd	Behind address at tree line.	16.0	Cementitious Coating
43	B9-78A	C2.26	551 Mall Blvd	Behind address follow tree line. Has sign.	13.8	Cementitious Coating
44	B9-88	C2.01	824 Reelfoot Dr	In the field across the street from the given address.	8.6	Cementitious Coating
45 46	B9-94 B9-103	C2.01 C2.27	824 Reelfoot Dr 2750 Mall Loop Rd	Across the street from address and near easement. In the grass near shipping container at the given address.	8.4 6.6	Cementitious Coating, Replace Bench and Channel Cementitious Coating
47	I-2A	C2.26	476 Mall Blvd	In the grass at the entrance to address.	18.3	Cementitious Coating
48	I-2C	C2.26	566 Mall Blvd	Down access road of water treatment. In yard at gate.	10.0	Cementitious Coating
49	I-2D	C2.26	476 Mall Blvd	In the grass alongside road to entrance.	16.0	Cementitious Coating
50 51	I-7 I-8	C2.26 C2.26	345 Mall Blvd 2395 Parr Ave	In the field at address. At the intersection of Parr and Mall Blvd near street sign.	14.2 14.3	Cementitious Coating Cementitious Coating
52	I-9	C2.26	2470 Parr Ave	At intersection.	13.3	Cementitious Coating
53	I-27	C2.23	2100 Pioneer Rd	Behind address and behind concrete bins.	15.6	Cementitious Coating
54	I-28	C2.23	2100 Pioneer Rd	Behind address and gravel bins.	14.8	Cementitious Coating
55 56	I-32 I-39	C2.23 C2.23	1979 St. John Ave 1990 St. John Ave	Behind address across field at tree line. Has sign. Across the street from address at creek edge.	13.6 12.7	Cementitious Coating Cementitious Coating
57	I-226	C2.03	396 US 51 BYP	In the ditch 100ft from parking lot of address.	12.2	Cementitious Coating
58	I-232	C2.06	625 US 51 BYP	Behind building	8.3	Cementitious Coating
59 60	I-272	C2.16	150 Connell Ave	By the loading dock of address.	8.3	Cementitious Coating, Replace Bench and Channel
60 61	I-273 I-274	C2.16 C2.16	150 Connell Ave 150 Connell Ave	By the loading dock of factory. In between the railroad tracks behind factory.	8.4	Cementitious Coating Cementitious Coating
62	I-275	C2.16	150 Connell Ave	In the grass by the dumpsters behind the factory.	10.9	Cementitious Coating
63	I-304	C2.10	29 Jenkinsville-Jamestown Rd	In the field at address.	10.3	Cementitious Coating
64	I-305	C2.10	149 Jenkinsville-Jamestown Rd	In the field at address.	8.4	Cementitious Coating
65 66	I-305A I-306	C2.10 C2.10	149 Jenksville-Jamestown Rd 205 Jenkinsville-Jamestown Rd	In the field at address. In the parking lot in front of address	9.9	Cementitious Coating Cementitious Coating
67	I-314	C2.07	1545 Club House Dr	At the edge of the woods behind address.	8.4	Cementitious Coating
68	J-14	C2.08	1561 Westlake Ave	In the front yard of address	7.0	Cementitious Coating
69	J-18	C2.08	1010 Thorntree Dr	In the street in front of address.	13.0	Cementitious Coating
70 71	J-19 J-54	C2.08 C2.15	1732 Thorntree Dr 159 Bowen St	In the street at the end of the driveway at address. In the intersection near address	10.0 12.6	Cementitious Coating Cementitious Coating, Replace Bench and Channel
72	J-61	C2.15	158 Pease St	In the intersection near address	11.7	Cementitious Coating
73	J-73	C2.15	1715 Forrest St	In the front yard of address.	5.6	Cementitious Coating
74 75	J-80	C2.18	1353 Meeks St	In the street at the entrance to apartments	4.6	Cementitious Coating
75 76	J-84 J-89	C2.15 C2.13	1320 Hornbrook St 1115 Gail Cir	In the street in front of address In the street in front of address	11.8 5.0	Cementitious Coating Cementitious Coating, Replace Bench and Channel
77	J-90	C2.13	1114 Upper Finley St	In the street in front of address	4.1	Cementitious Coating Cementitious Coating
78	J-95	C2.13	536 Hart St	In the grass across the street from address	7.5	Cementitious Coating
79	J-109	C2.11	1105 Foxridge Run	In the street in front of address	7.5	Cementitious Coating
80 81	J-114 J-115	C2.13 C2.13	1036 Upper Finley Rd 1020 Upper Finley Rd	In the street in front of address In intersection	9.7 8.4	Cementitious Coating, Replace Bench and Channel Cementitious Coating, Replace Bench and Channel
82	J-115 J-121	C2.13	1010 Lipford Cir	In the sidewalk in front of address	6.4	Cementitious Coating, Replace Bench and Channel Cementitious Coating
83	J-122	C2.13	1011 Lipford Cir	In the road near entrance to parking lot	4.7	Cementitious Coating, Replace Bench and Channel
84	J-123	C2.13	1062 Lipford Cir	In the grass near the ditch	5.1	Cementitious Coating, Replace Bench and Channel
85	J-124	C2.13	1211 Forrest St	Across street over ditch	5.7	Cementitious Coating, Replace Bench and Channel




GreshamSmith.com

1661 International Drive Suite 400 Memphis, TN 38120

901.753.5590

MANHOLE REHABILITATION CITY OF DYERSBURG PUBLIC WORKS

SANITARY SEWER REHABILITATION BASINS A, B, K, J, W, M, B7, B8, B9, & N

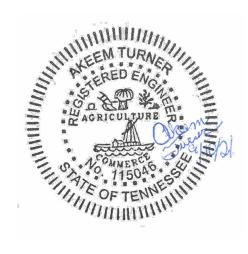

Revision				
No.	Date	Description		

MANHOLE TABULATION OF WORK

G0.03

43303.01 SEPTEMBER 2021

Wastewater

22.0026

This Line Is 3 Inches When Printed Full Size

				MANHOLE TABULATION OF WORK		
tem Number	Manhole Number	Sheet Reference	Address	Location Details	Rim-to-Invert, ft	Rehabilation Comments
86	J-130	C2.15	1122 Park Thurman Cir	In the grass in front of address	3.9	Cementitious Coating
87 88	J-132 J-138	C2.12 C2.12	304 Sellars Dr 325 Sellars Dr	Behind the building, before the ditch In the grass in front of address	3.6 4.8	Cementitious Coating Cementitious Coating, Replace Bench and Channel
89	J-139	C2.12	1500 Maxey	In parking lot in front of address	3.4	Cementitious Coating
90	J-144	C2.12	342 Salenfriend Cove	In the parking lot in front of address	4.6	Cementitious Coating
91	J-145	C2.12	364 Salenfriend Cove	In front of the front door of address	5.6	Cementitious Coating
92	J-147	C2.12	1395 Upper Finley St	In the street in front of address	6.2	Cementitious Coating, Replace Bench and Channel
93	J-157	C2.24	175 Pressler Rd	In the street in front of address near no parking sign	5.8	Cementitious Coating
94	J-161	C2.24	2027 Forrest St	Behind address through gate at electrical tower.	5.2	Cementitious Coating
95	J-162A	C2.15	212 Pressler Rd	End of road in creek.	8.0	Cementitious Coating
96	J-192	C2.15	1890 Forrest St	In the yard near gray portable building.	7.5	Cementitious Coating, Replace Bench and Channel
97	J-201	C2.12	1385 Upper Finley St	At the edge of the front yard of address	4.6	Cementitious Coating, Replace Bench and Channel
98	J-208	C2.13	448 Jay Ave	Backyard by creek. Has sign.	9.3	Cementitious Coating, Replace Bench and Channel
99	J-213	C2.11, C2.13	625 Wendell Ave	In the street in front of address	4.6	Cementitious Coating
100	J-216	C2.11	1001 Flicker Dr	At intersection	23.8	Cementitious Coating
101	J-233	C2.08	706 Scotsman Trce	Front yard in bushes.	13.8	Cementitious Coating
102	J-244A	C2.28	1041 Dianne Dr	In the backyard of address.	4.2	Cementitious Coating, Replace Bench and Channel
103	J-247	C2.28	1315 Melissa Ln	In the street in front of address	14.9	Cementitious Coating
104	J-249	C2.28	1035 Melissa Ln	In the street in front of address	7.1	Cementitious Coating
105	J-254	C2.11, C2.28	1030 Valley Rd	In the street in front of address	5.6	Cementitious Coating
106	J-279	C2.28	1304 Timothy Dr	In the street in front of address	12.1	Cementitious Coating
107	J-303	C2.15	270 US 51 BYP	In the street outside of the fence beside address.	8.2	Cementitious Coating, Replace Bench and Channel
108	J-310	C2.18	471 Fairbanks Ave	In the street in front of address	8.7	Cementitious Coating
109	J-312	C2.18	404 Anchorage Ave	At the edge of the road near ditch	5.1	Cementitious Coating
110	J-315	C2.24	435 US 51 BYP	In the grass at the edge of the parking lot.	8.0	Cementitious Coating
111	J-317	C2.16	1220 Meeks St	In the street in front of address behind right field fence	10.6	Cementitious Coating
112	J-319	C2.18	227 Klondike St	Across railroad tracks from pump house.	13.1	Cementitious Coating
113	J-323	C2.12	1701 Whitney Young Dr	In the backyard of address	4.6	Cementitious Coating
114	J-324	C2.15	136 Chandler Dr	In the grass near pole in front of address	1.4	Cementitious Coating, Replace Bench and Channel
115	K-5	C2.13	409 N Connell Ave	In grass near street	4.4	Cementitious Coating
116	K-6	C2.13	409 N Connell Ave	In street in front of address	6.2	Cementitious Coating
117	K-15	C2.11, C2.13	837 McArthur St		11.7	Cementitious Coating
118	K-16	C2.11, C2.13	817 McArthur St		7.1	Cementitious Coating
119	K-17	C2.11, C2.13	719 McArthur St		7.5	Cementitious Coating
120	K-18	C2.13	805 Hull St	In street in front of address	4.8	Cementitious Coating, Replace Bench and Channel
121	K-19	C2.13	805 Hull St	In street in front of address	4.9	Cementitious Coating, Replace Bench and Channel
122	K-21	C2.13	627 Ferguson Ave	In intersection	11.7	Cementitious Coating, Replace Bench and Channel
123	K-42	C2.16	800 N Fumbanks Ave	In intersection	0.0	Cementitious Coating, Replace Bench and Channel
124	K-44	C2.16	1003 Scott St	In intersection	6.7	Cementitious Coating
125	K-45	C2.16	700 Scott St		5.5	Cementitious Coating, Replace Bench and Channel
126	K-47A	C2.16	904 Scott St	In the street in front of address	8.7	Cementitious Coating
127	K-53	C2.16	364 Wabash Ave	In intersection	8.7	Cementitious Coating
128	K-59A	C2.16	1093 Wabash Circle	In treebreak behind property	12.1	Cementitious Coating
129	K-59B	C2.16	1093 Wabash Circle	In treebreak behind property	10.5	Cementitious Coating
130	K-59C	C2.16	1093 Wabash Circle	In treebreak behind property	11.2	Cementitious Coating
131	K-65A	C2.16	107 Jackson St	In street in front of address	11.1	Cementitious Coating
132	K-82	C2.14	418 N Fowlkes Ave	In street in front of address	3.5	Cementitious Coating
133	K-94	C2.14	250 Watkins St		9.7	Cementitious Coating, Replace Bench and Channel
134	K-101	C2.25	322 S Lattawoods Dr	In street	4.5	Cementitious Coating
135	K-102	C2.25	335 S Lattawoods Dr	In street	4.6	Cementitious Coating
136	K-103	C2.25	332 N Lattawoods Dr	In intersection	7.6	Cementitious Coating
137	K-105	C2.25	823 Granger Cir	In intersection	7.9	Cementitious Coating
138	K-106	C2.25	425 S Latta Dr		4.8	Cementitious Coating
139	K-108	C2.25	411 S Lattawoods Dr		5.7	Cementitious Coating
140	K-130	C2.11	705 Lake Rd	In sidewalk in front of address	11.3	Cementitious Coating
141	K-131	C2.13	621 McArthur St	In gutter next to sidewalk	10.5	Cementitious Coating
142	M-14	C2.21	400 E Tickle St	In parking lot	7.9	Cementitious Coating
143	M-26	C2.06	2240 Parr Ave	In grass near road	8.3	Cementitious Coating
144	M-36	C2.06	600 US 51 BYP	Near apartments	6.9	Cementitious Coating
145	N-4	C2.22	500 Community Park Rd	At the corner of yard.	7.6	Cementitious Coating
146	N-5	C2.22	609 Community Park Rd	Off the drive to the baseball fields.	3.6	Cementitious Coating
147	N-12	C2.28	820 Community Park Rd	In the yard at address.	9.6	Cementitious Coating
148	N-14	C2.22	35 Hurricane Hill Rd	In the grass near the corner at address	10.3	Cementitious Coating, Replace Bench and Channel
149	N-17	C2.22	400 Community Park Rd	In the driveway to entrance at address	8.6	Cementitious Coating
150	N-19	C2.28	1200 Community Park Rd	In the parking lot of address.	5.9	Cementitious Coating
151	W-45	C2.10	2107 Upper Finley Rd	Just off the road in field at the address	12.1	Cementitious Coating
152	W-64	C2.07	1099 Cooper Dr	In bushes by mailbox.	17.6	Cementitious Coating Replace Repsh and Channel
153	W-65	C2.07	1091 Cooper Dr	Behind the fenced backyard of address.	11.7	Cementitious Coating, Replace Bench and Channel
154	W-65B	C2.07	1684 US Hwy 51 Byp Way	In ditch.	16.7	Cementitious Coating
155	W-74	C2.07	1355 Flowering Dogwood Ln	In roadway. In the intersection of Flowering Degreed In and Cornelian Dr	23.3	Cementitious Coating
156	W-79	C2.07	1421 Flowering Dogwood Ln	In the intersection of Flowering Dogwood Ln and Cornelian Dr.	7.6	Cementitious Coating
157	W-85	C2.20	1466 Yellow Twig Ln	In the street in front of address.	8.0	Cementitious Coating
158	W-87	C2.20	1852 Fairway Dr	In the grass across the street from address. In between the stop sign and drainage ditch.	10.2	Cementitious Coating Replace Repsh and Channel
159	W-89	C2.20	1924 Fairway Dr	Backyard at creek.	9.0	Cementitious Coating, Replace Bench and Channel
160	W-100	C2.20	2141 Apache Cove	In the grass near storm drain in front of address	4.8	Cementitious Coating Replace Repel and Channel
161	W-106	C2.20	2217 Indian Trce	In the street in front of address.	6.3	Cementitious Coating, Replace Bench and Channel
162	W-120	C2.20	2026 Fairway Dr	In the street in front of address.	11.1	Cementitious Coating
163	W-129	C2.20	1685 Wedgewood Cove	In the intersection to cul-de-sac	10.2	Cementitious Coating
164	W-137	C2.20	Club House Dr	On golf course near the lake	11.8	Cementitious Coating
165	W-140	C2.19	2139 Saint Andrews Cove	In the woods behind pond on golf course.	8.0	Cementitious Coating
166	W-145	C2.10	2344 Upper Finley Rd	In the field at address	10.8	Cementitious Coating
167	W-158	C2.21	844 Wesley Dr	In the front yard of address.	7.0	Cementitious Coating
168	W-204	C2.07	1747 Putter Ln	In the street in front of address.	7.0	Cementitious Coating
169	W-234	C2.19	2392 Augusta Dr	In the wooded area of golf course.	6.5	Cementitious Coating



GreshamSmith.com

1661 International Drive Suite 400 Memphis, TN 38120

901.753.5590

MANHOLE REHABILITATION CITY OF DYERSBURG PUBLIC WORKS

SANITARY SEWER REHABILITATION BASINS A, B, K, J, W, M, B7, B8, B9, & N



	Revision			
No.	Date	Description		
-				


MANHOLE TABULATION OF WORK


G0.04


43303.01 SEPTEMBER 2021


Wastewater 22.0026


This Line Is 3 Inches When Printed Full Size

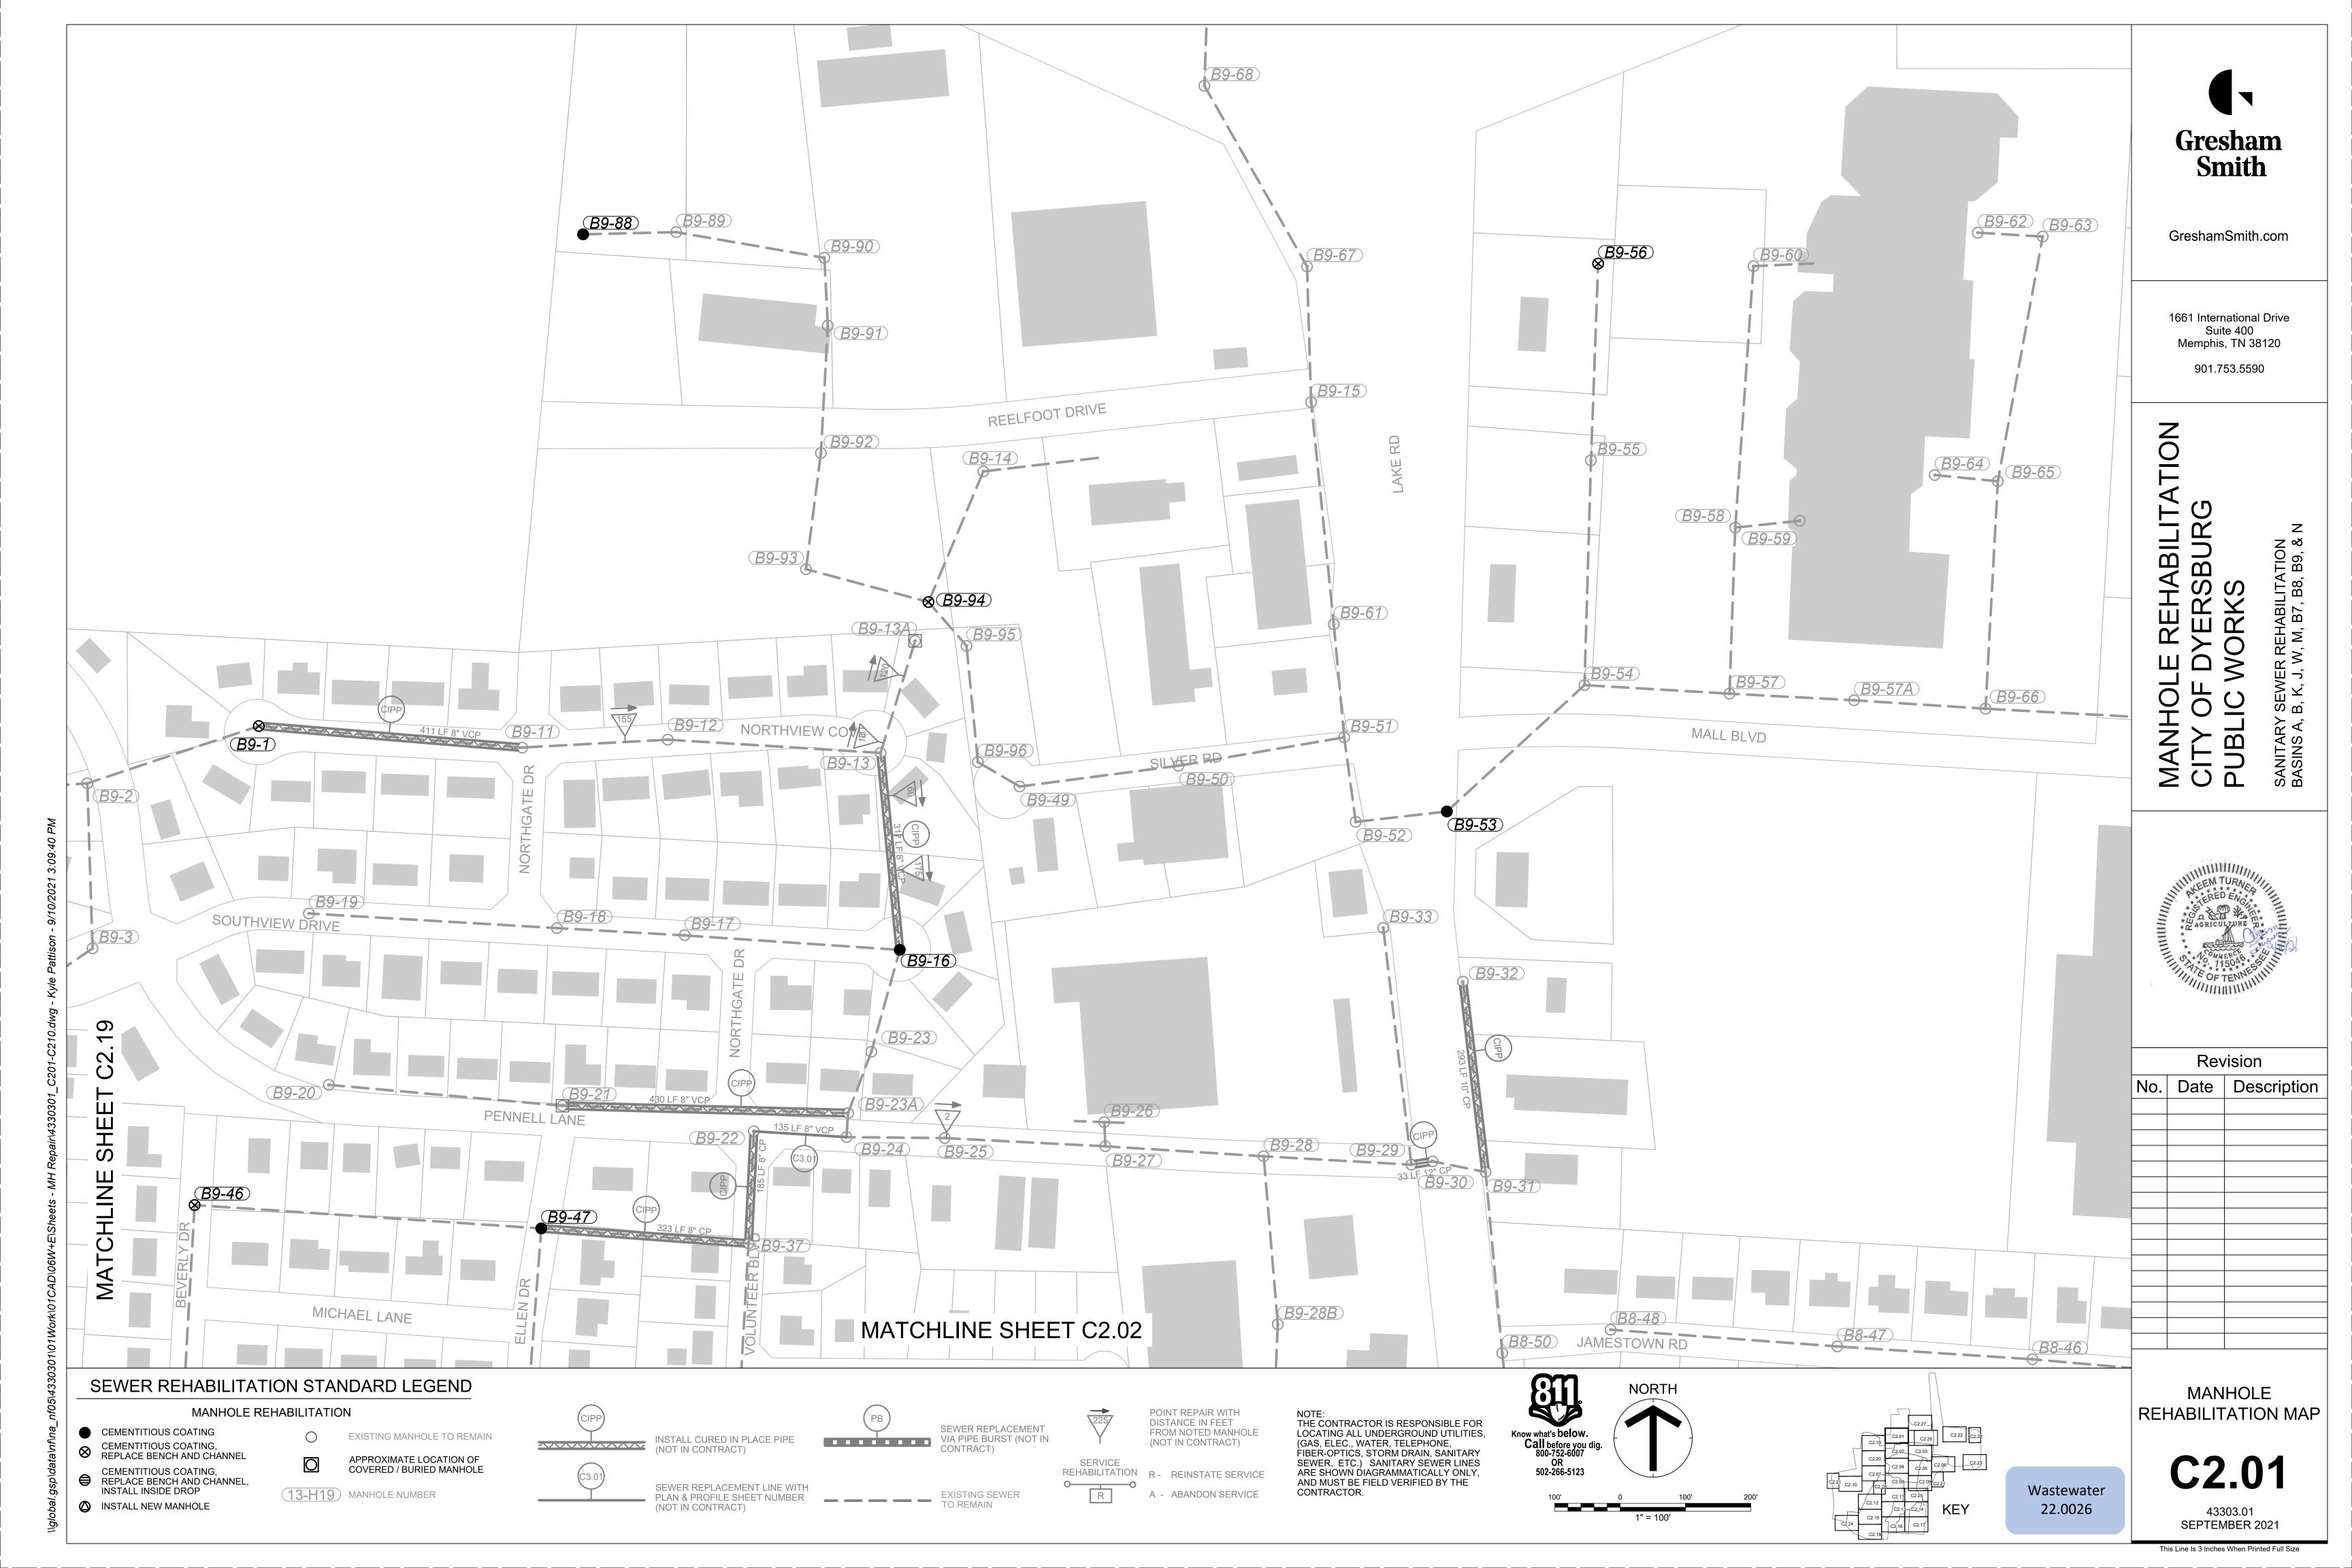

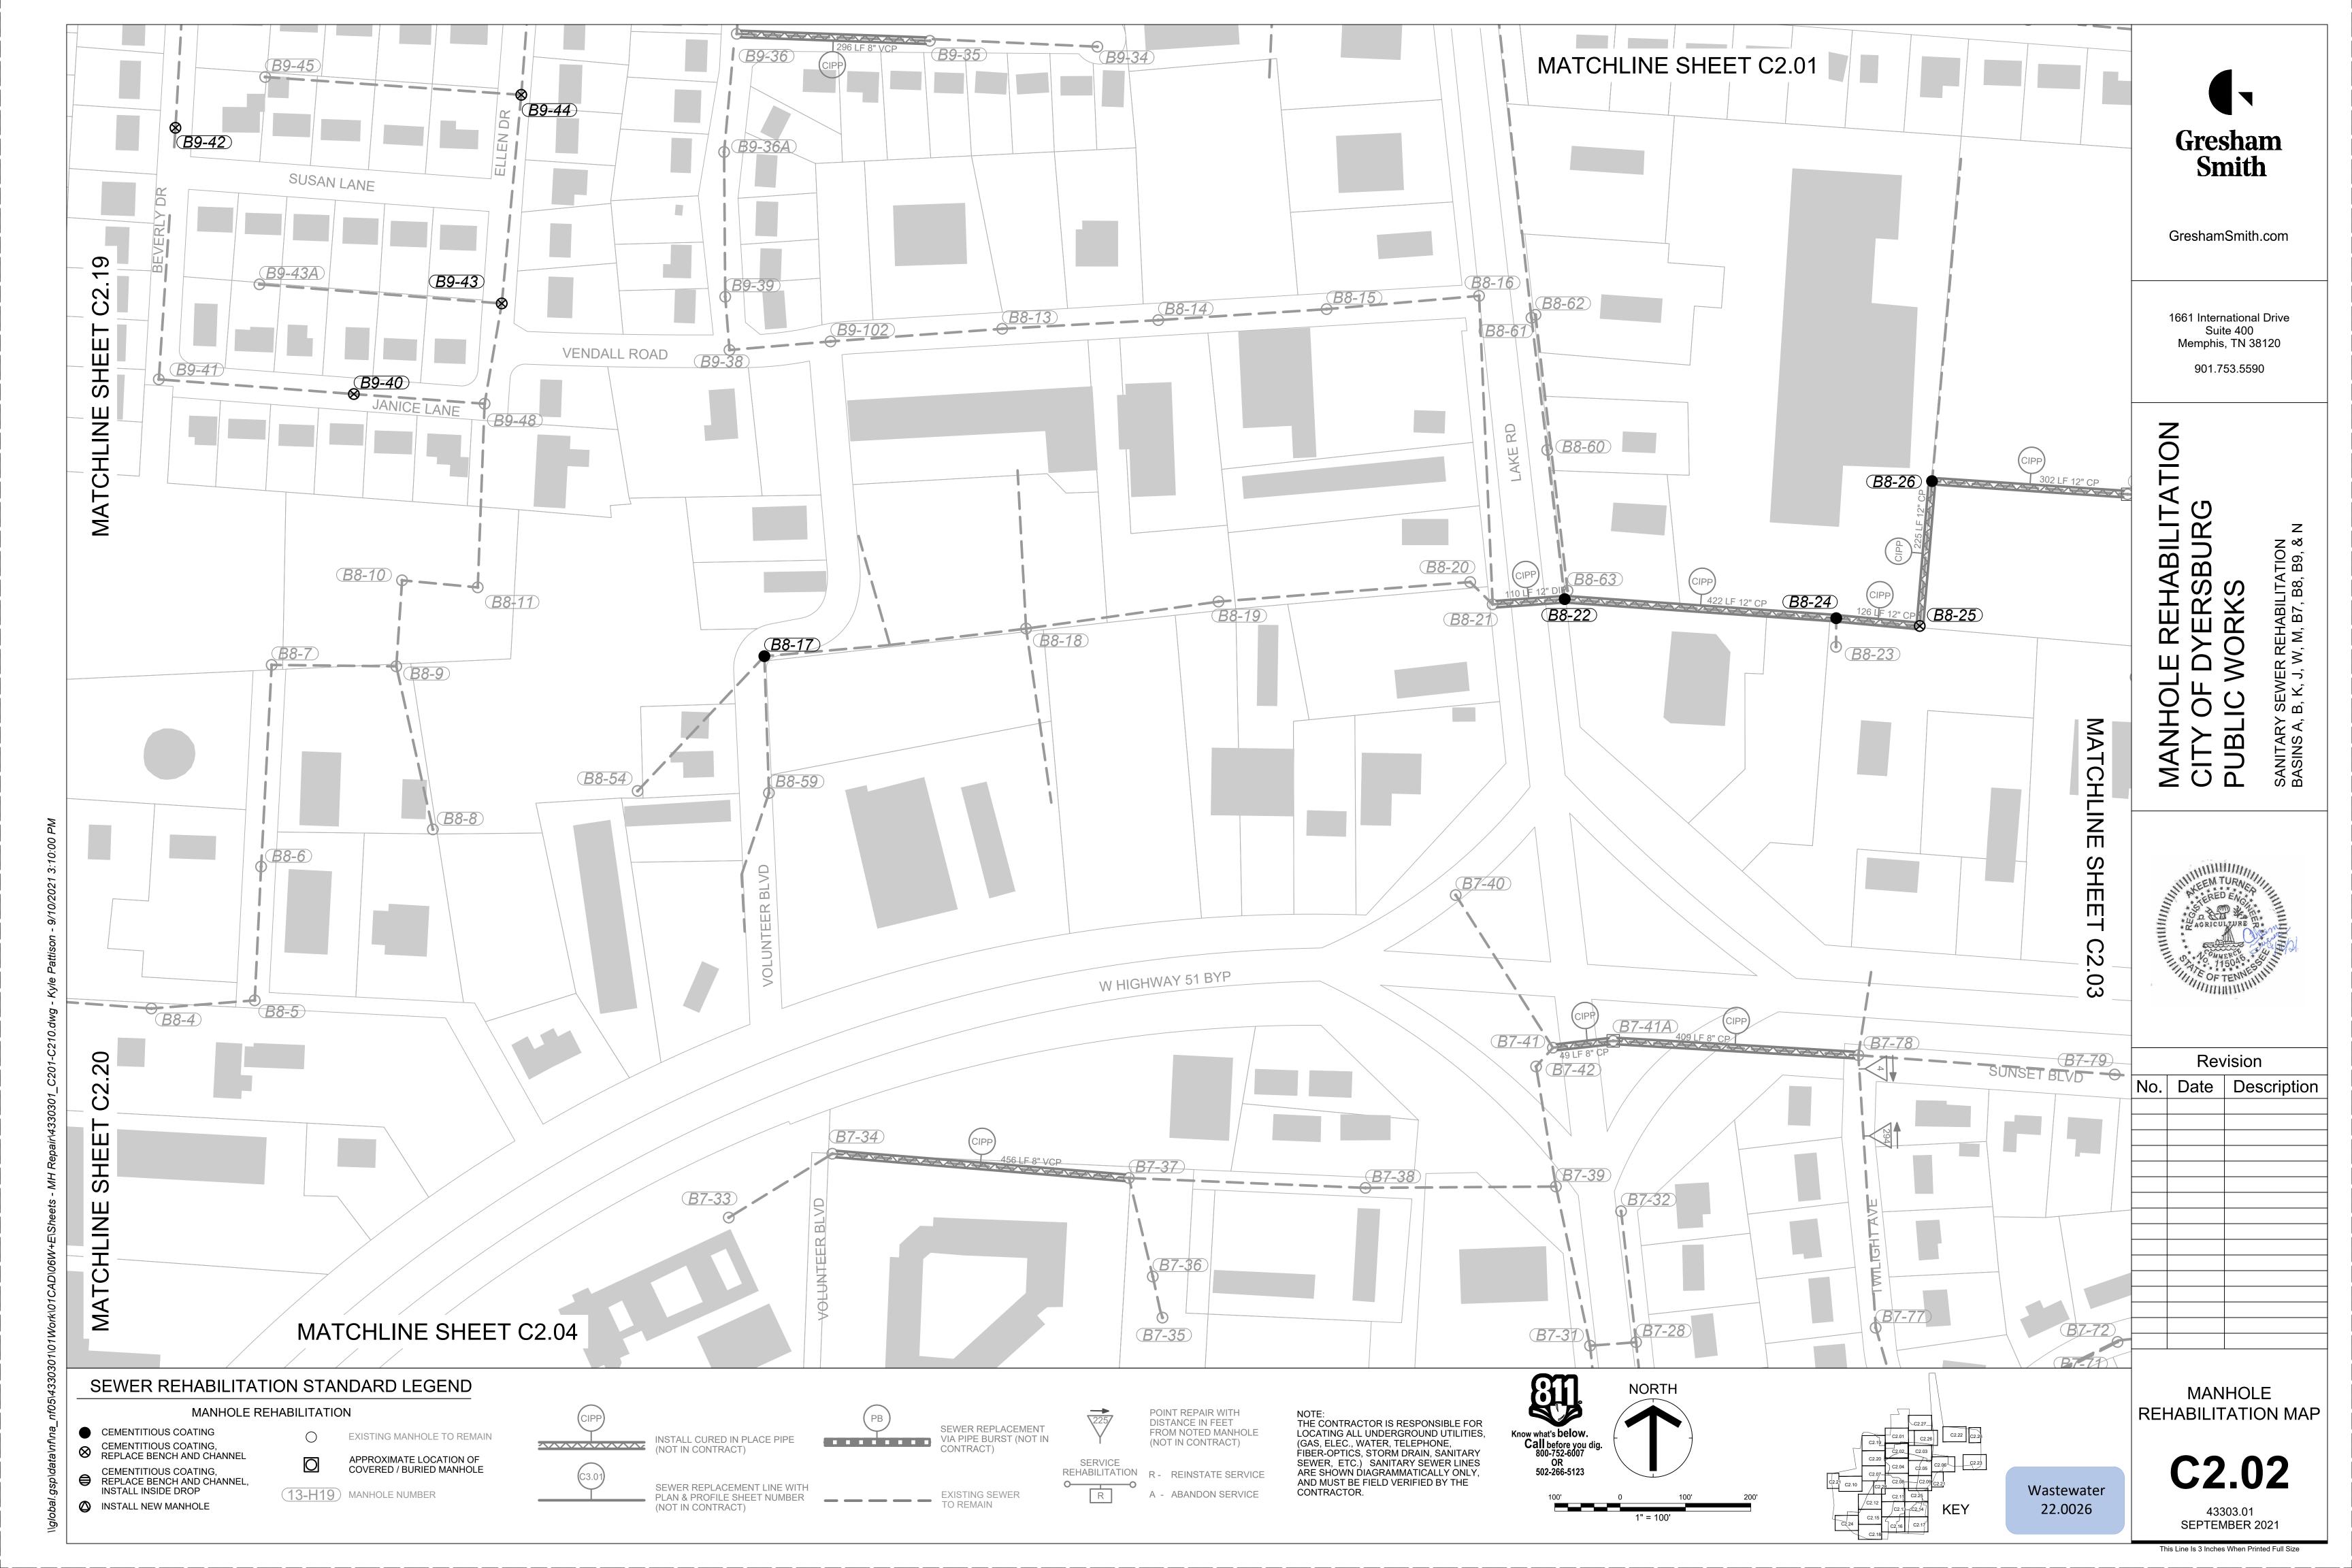


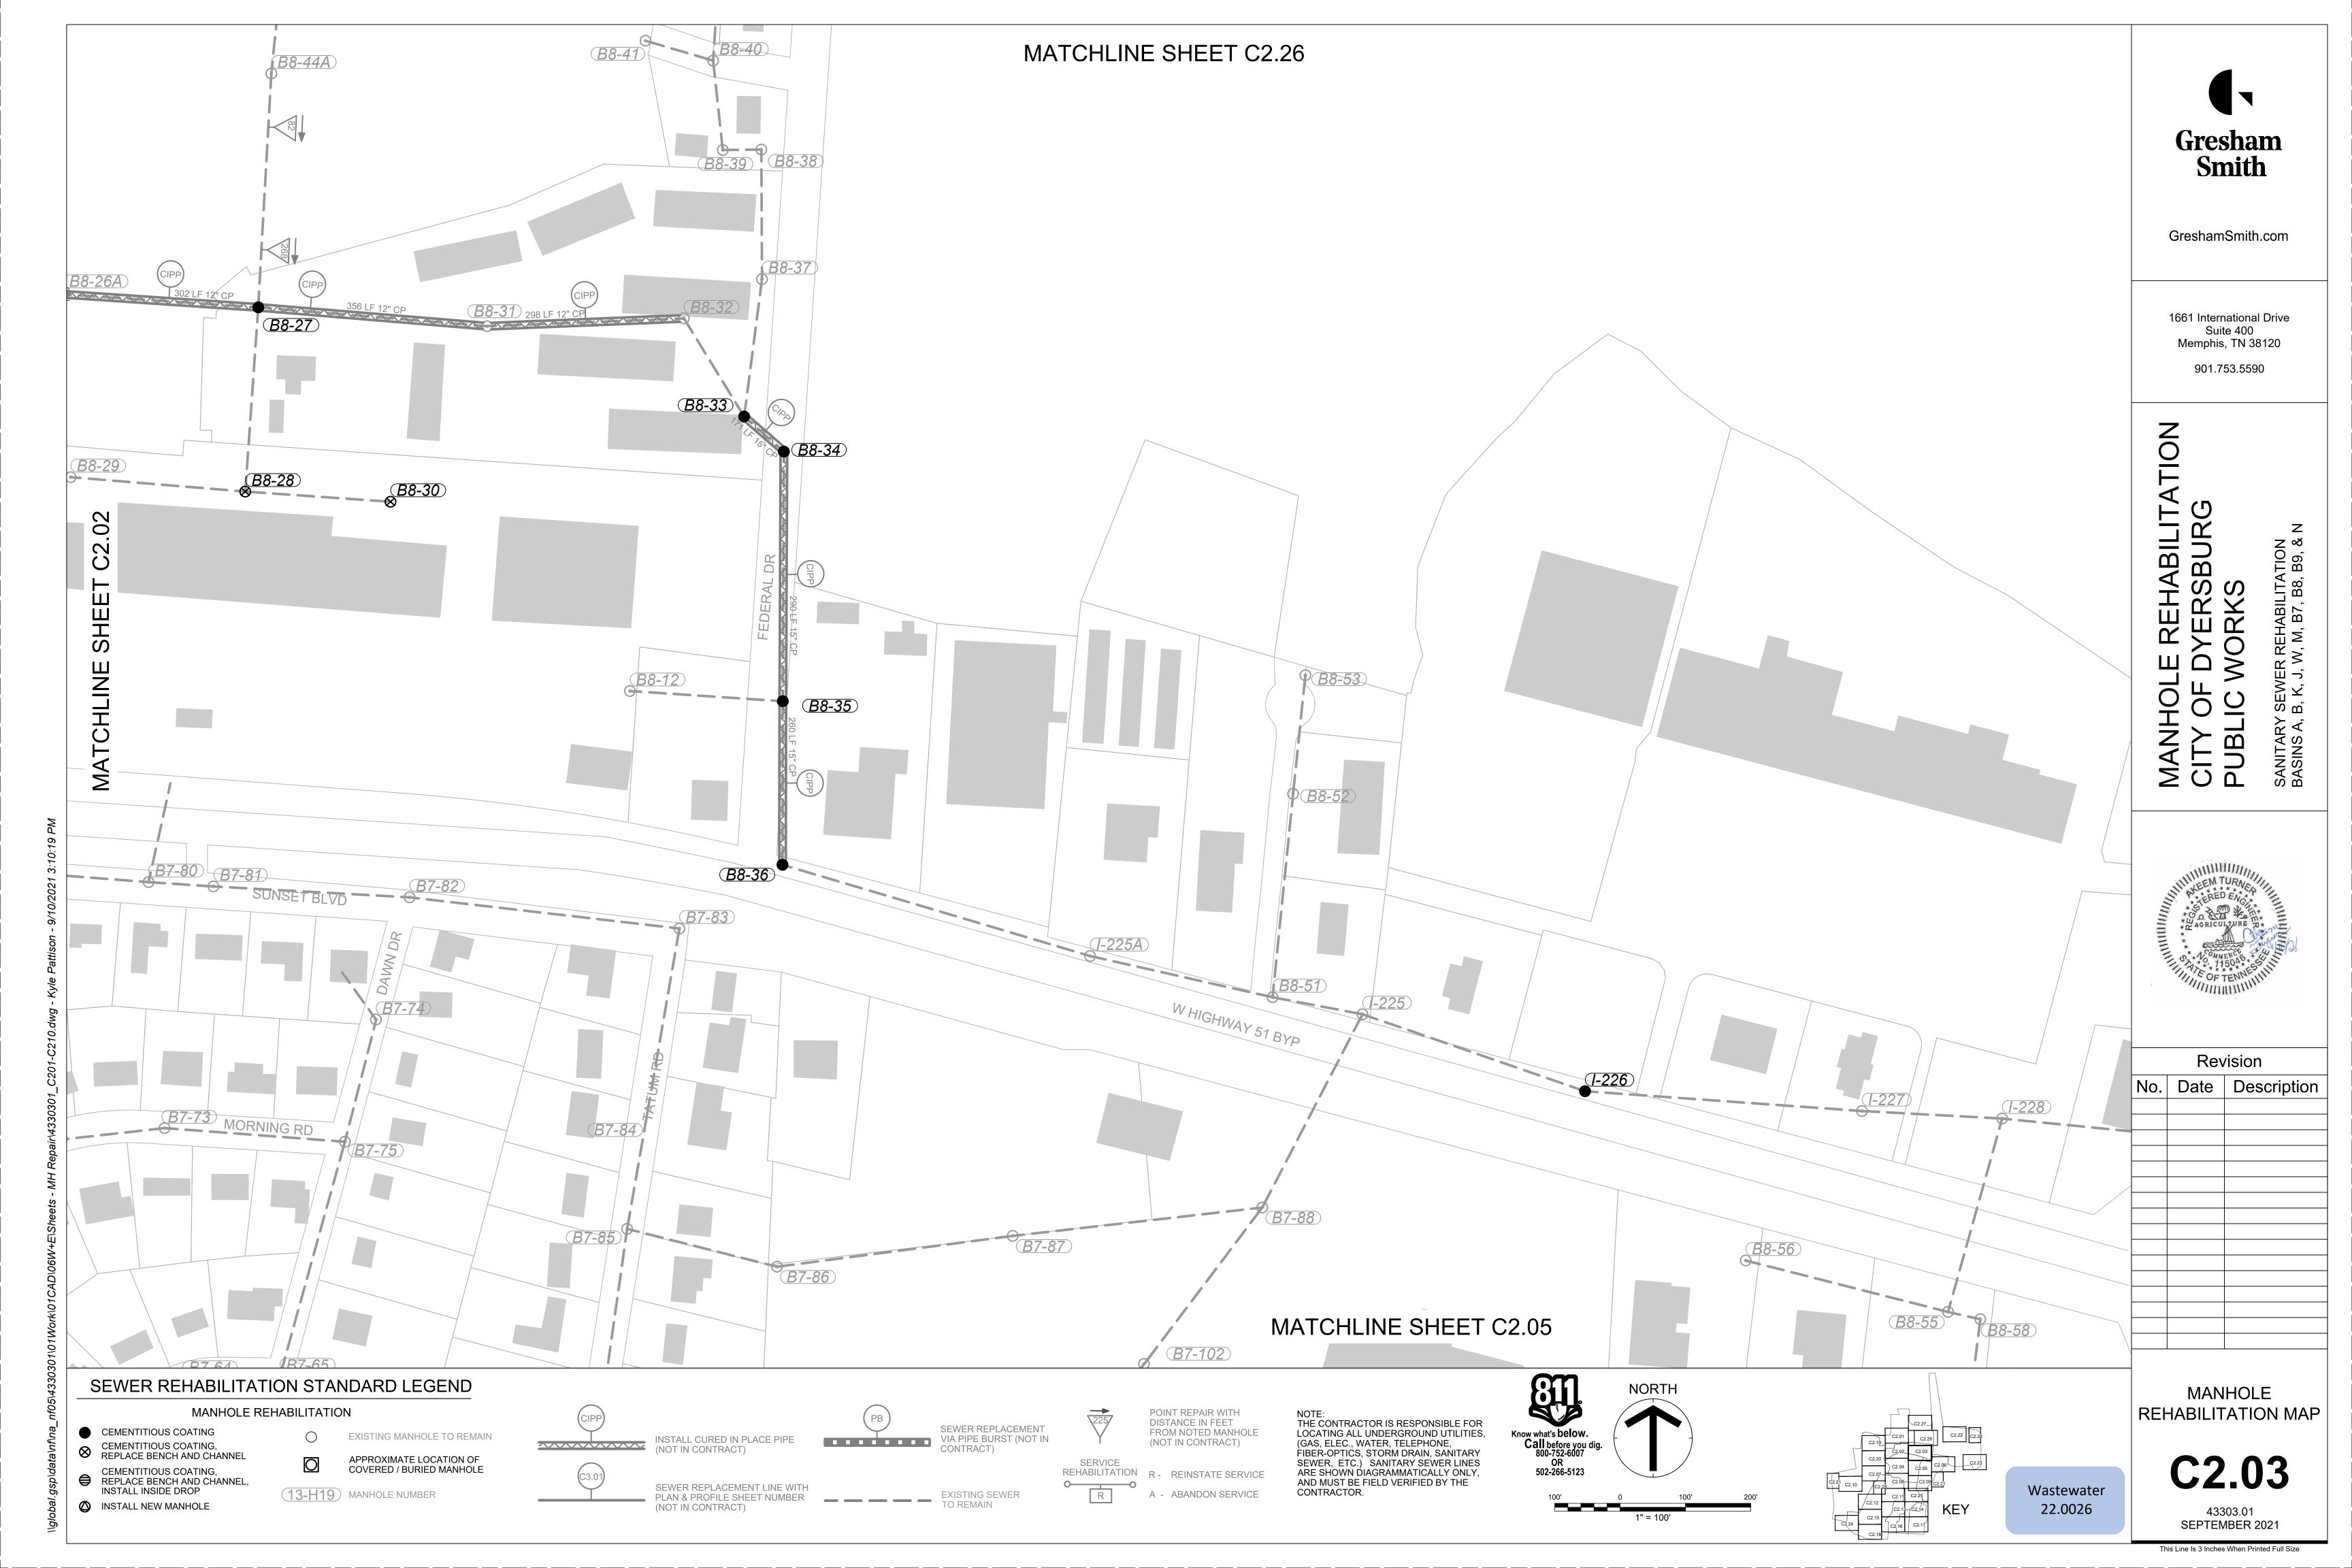


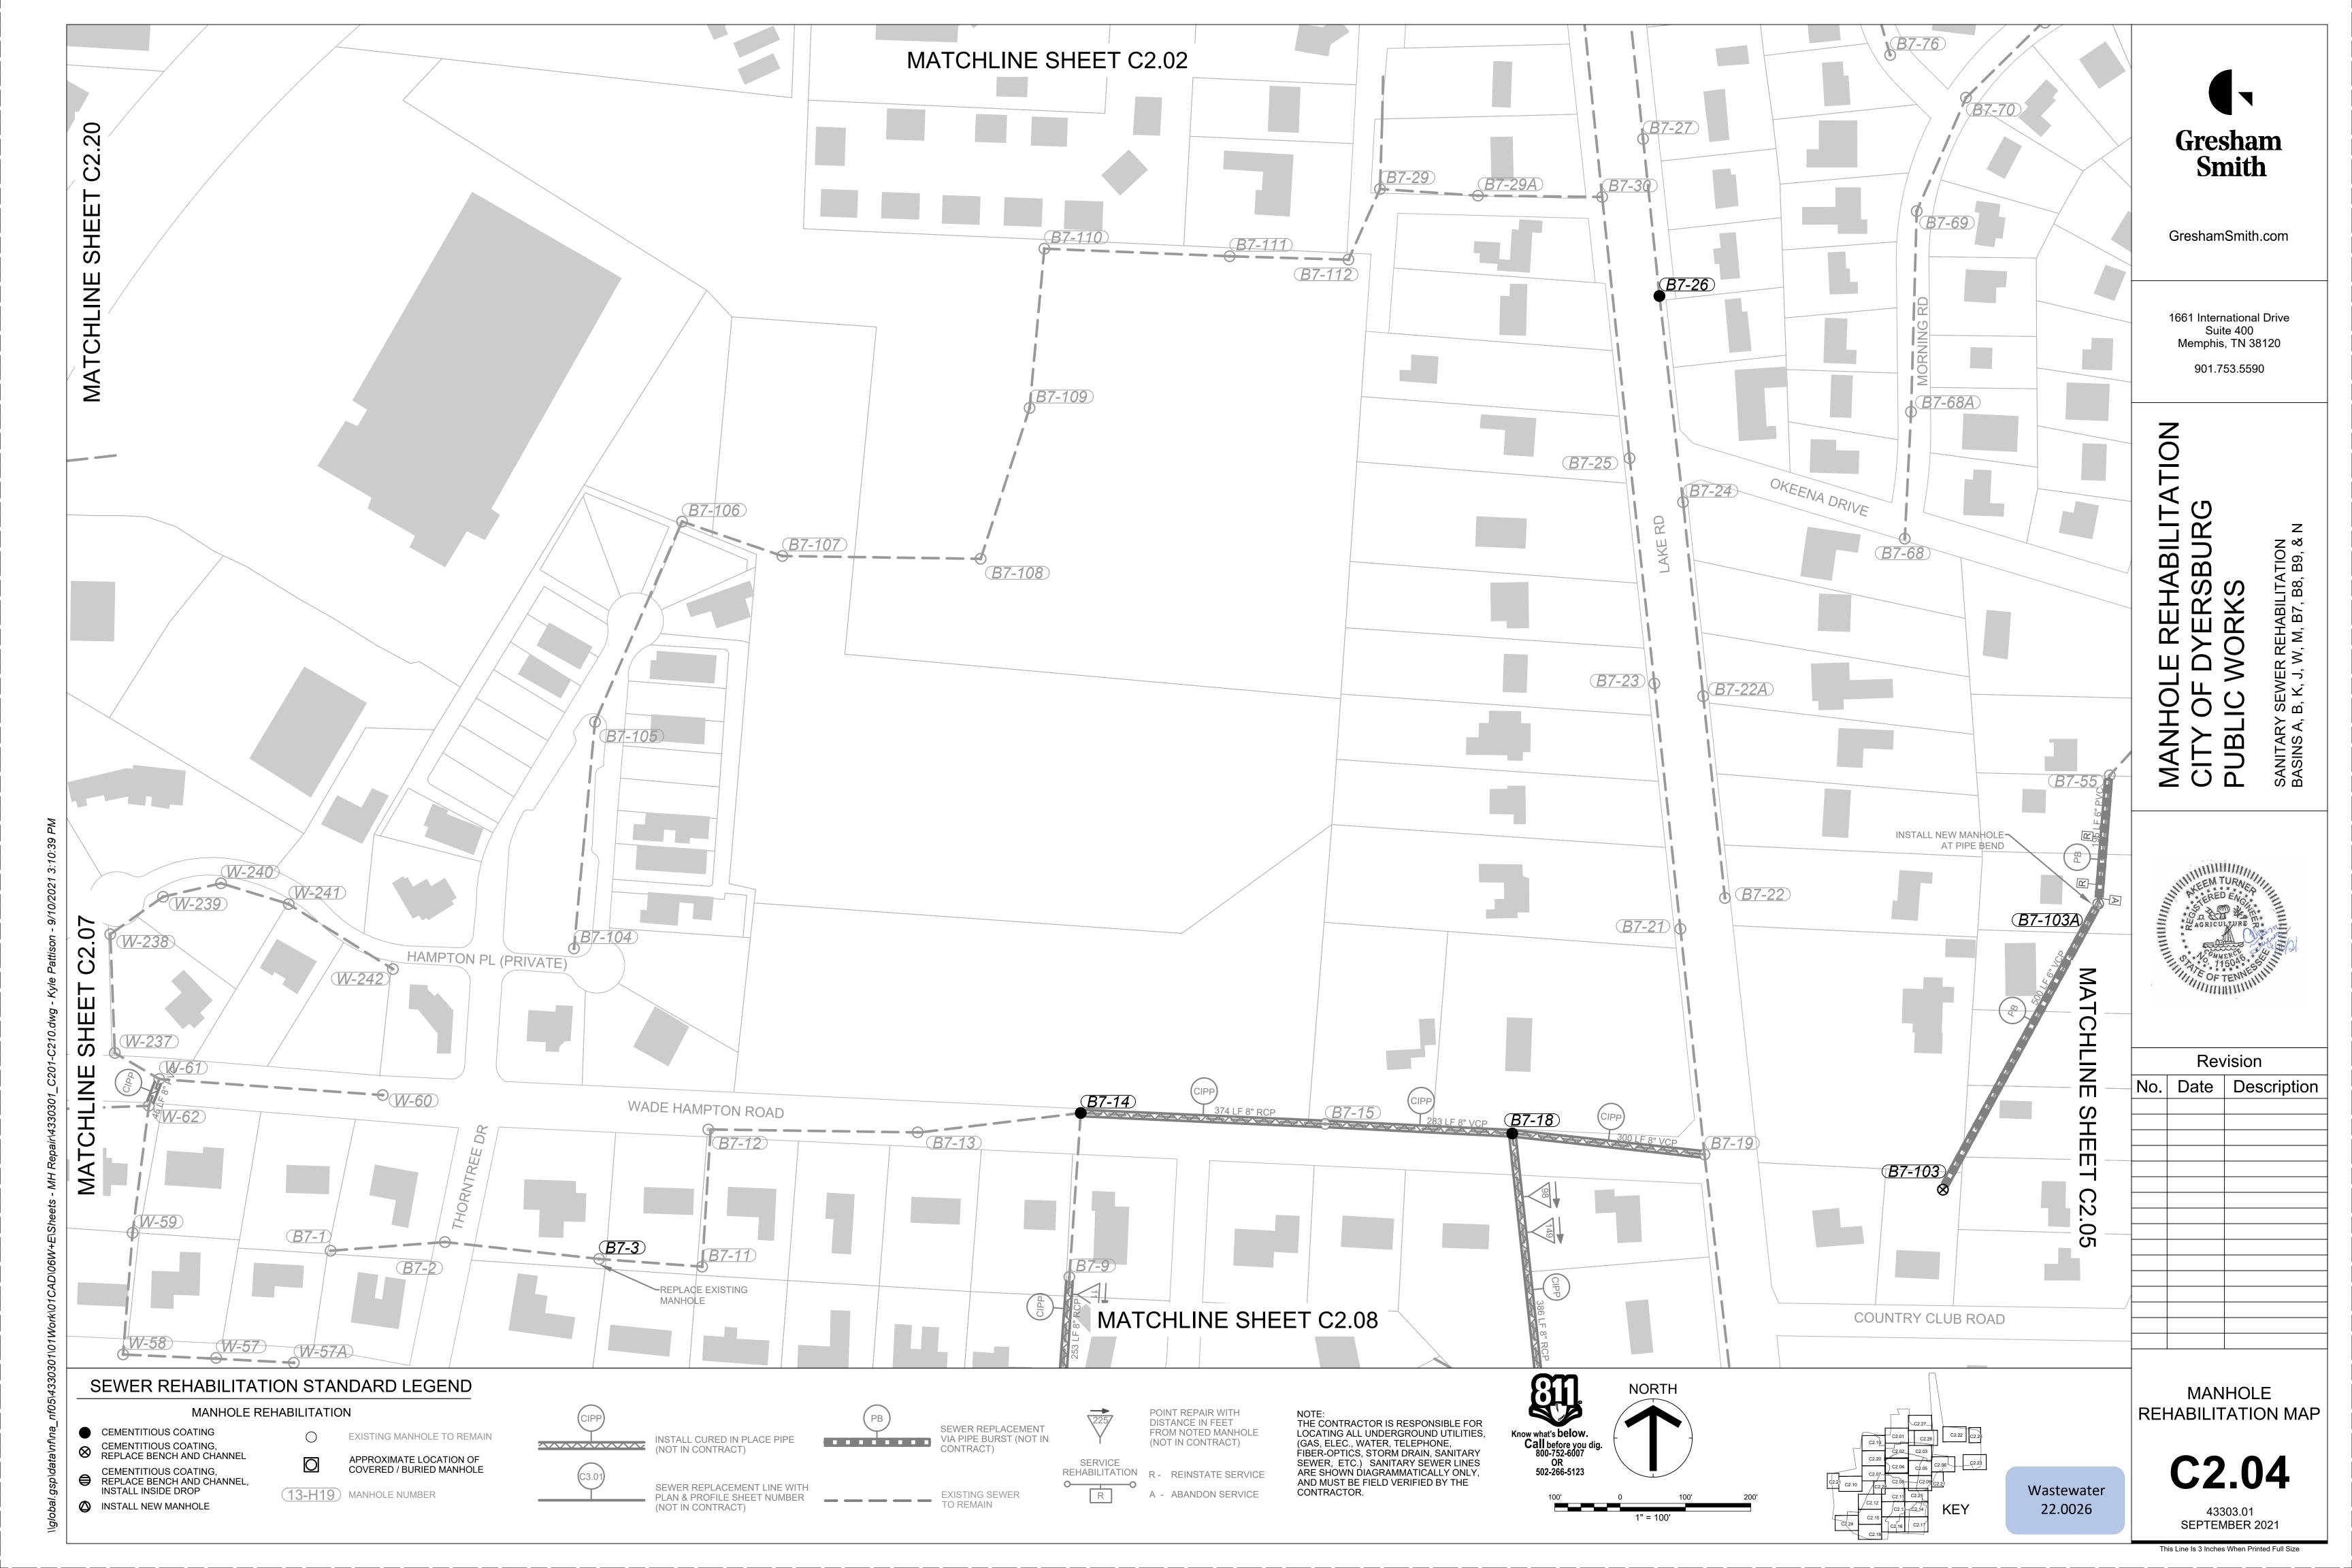


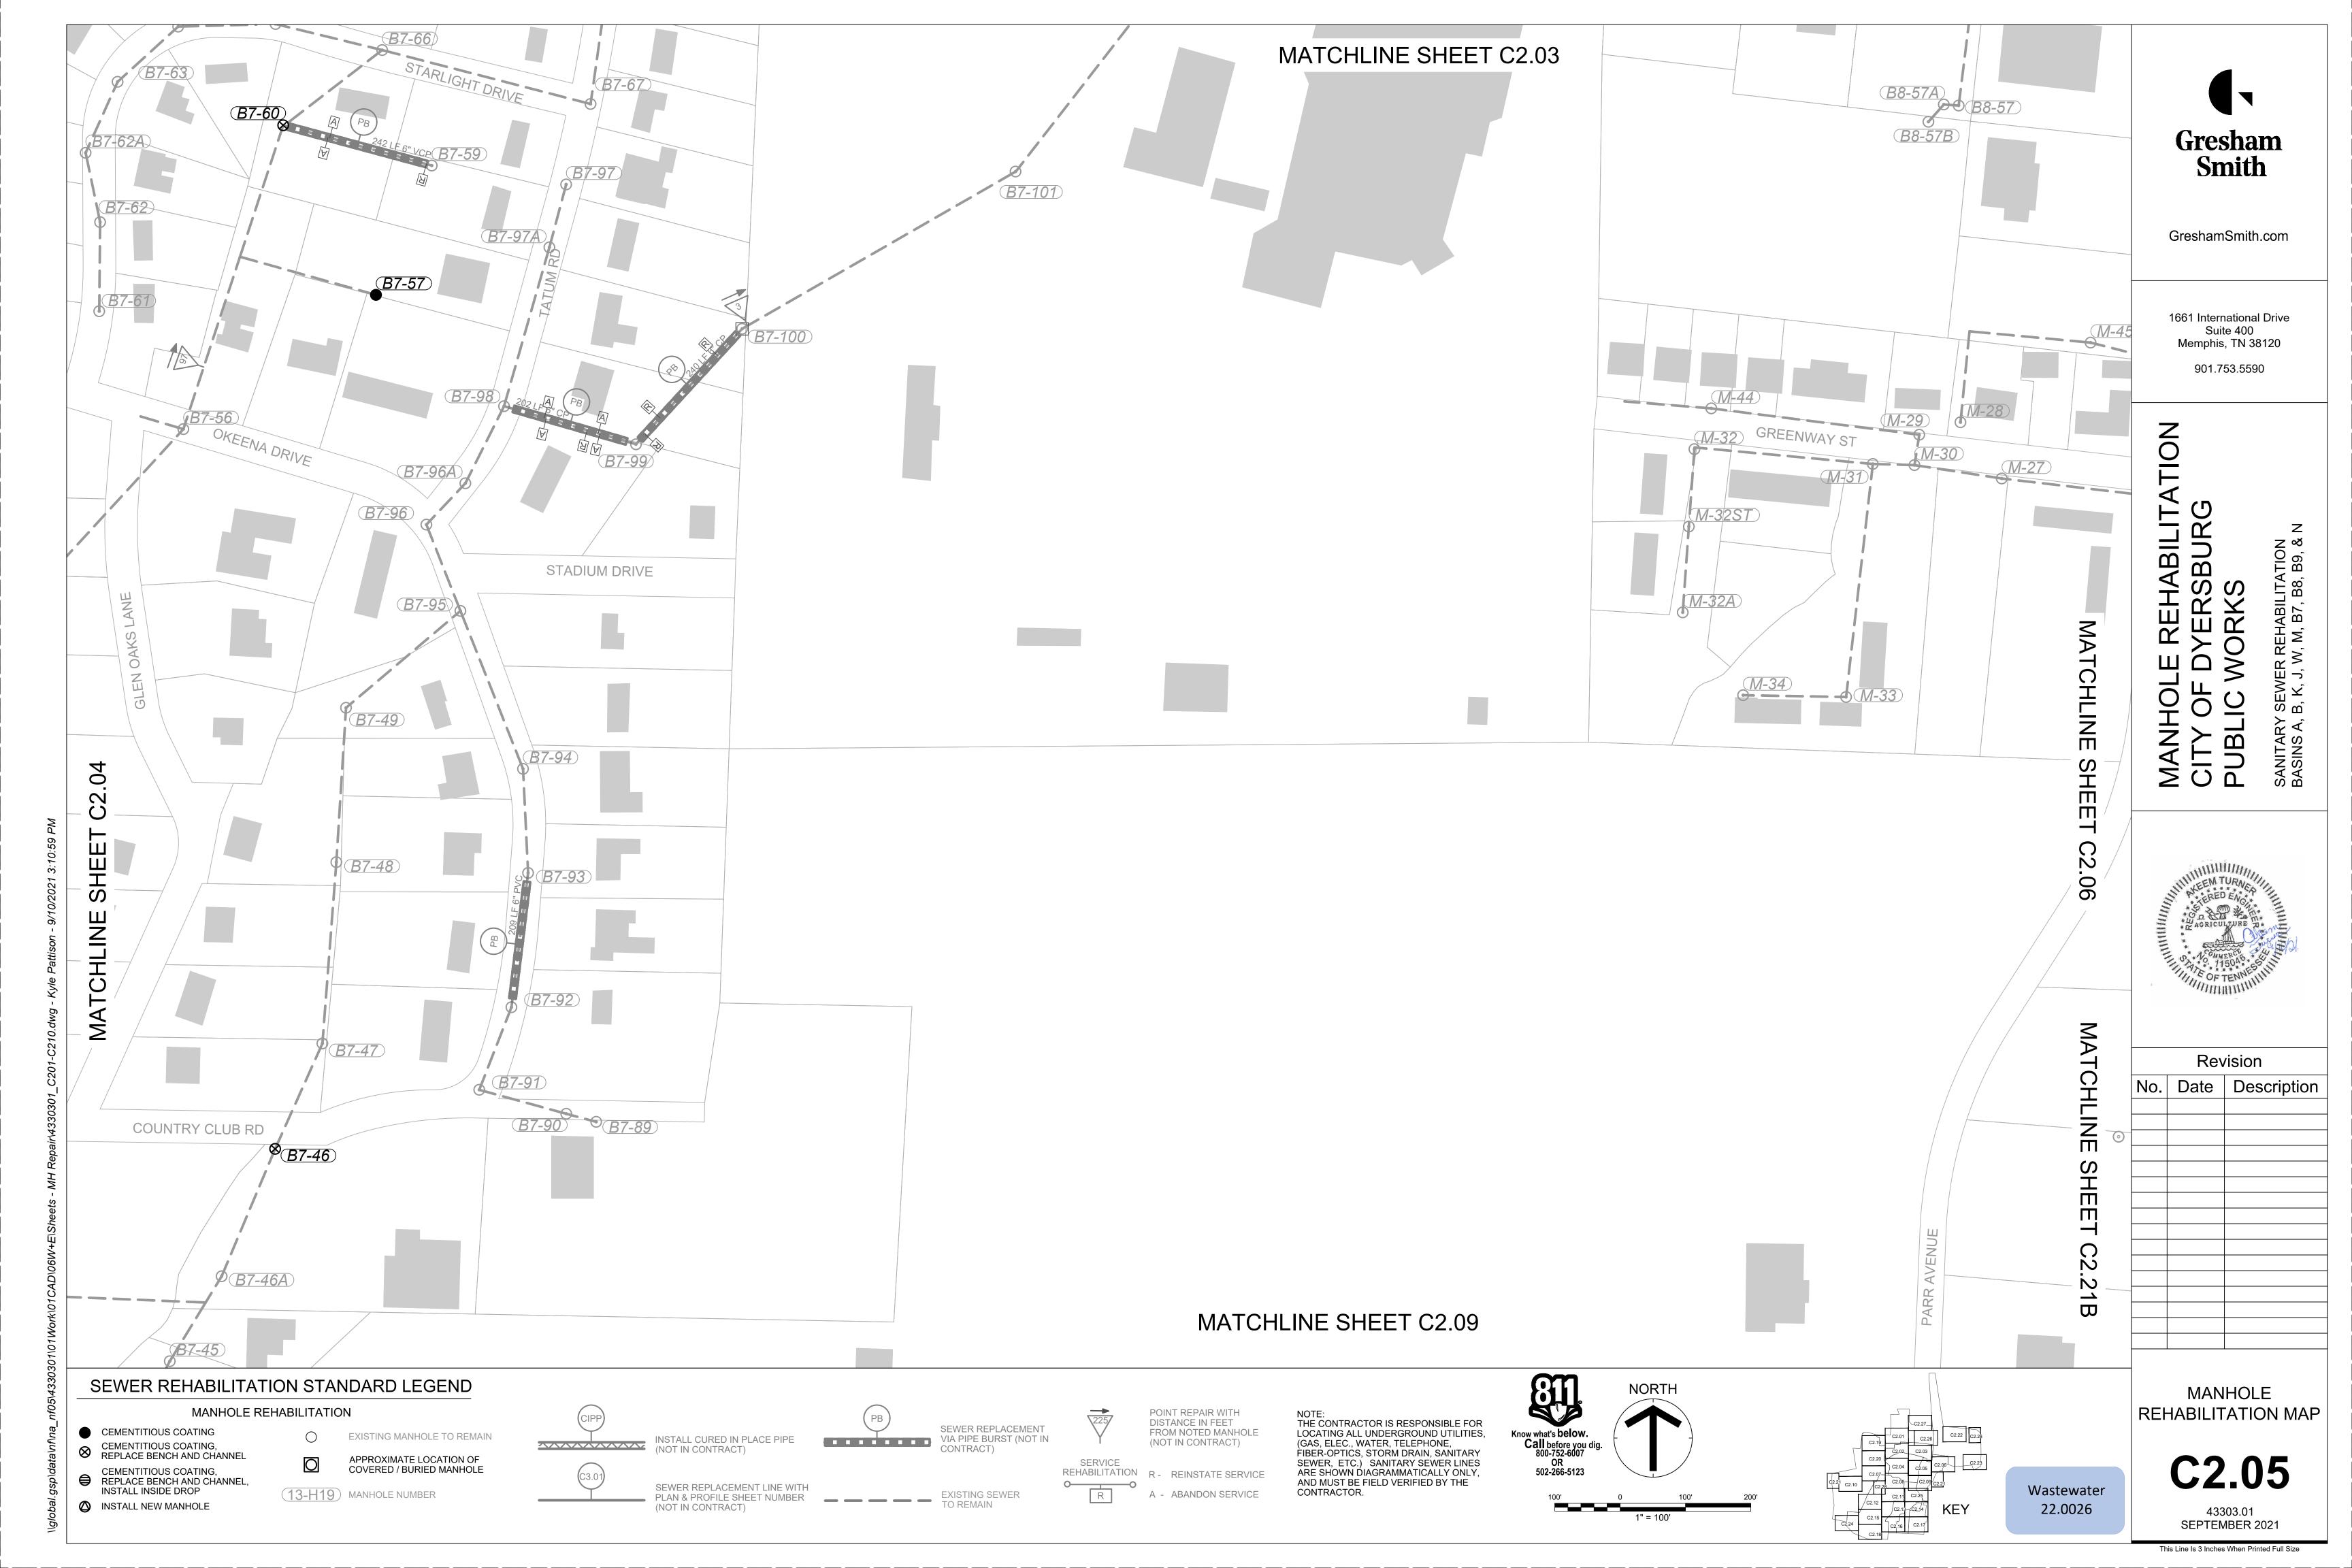




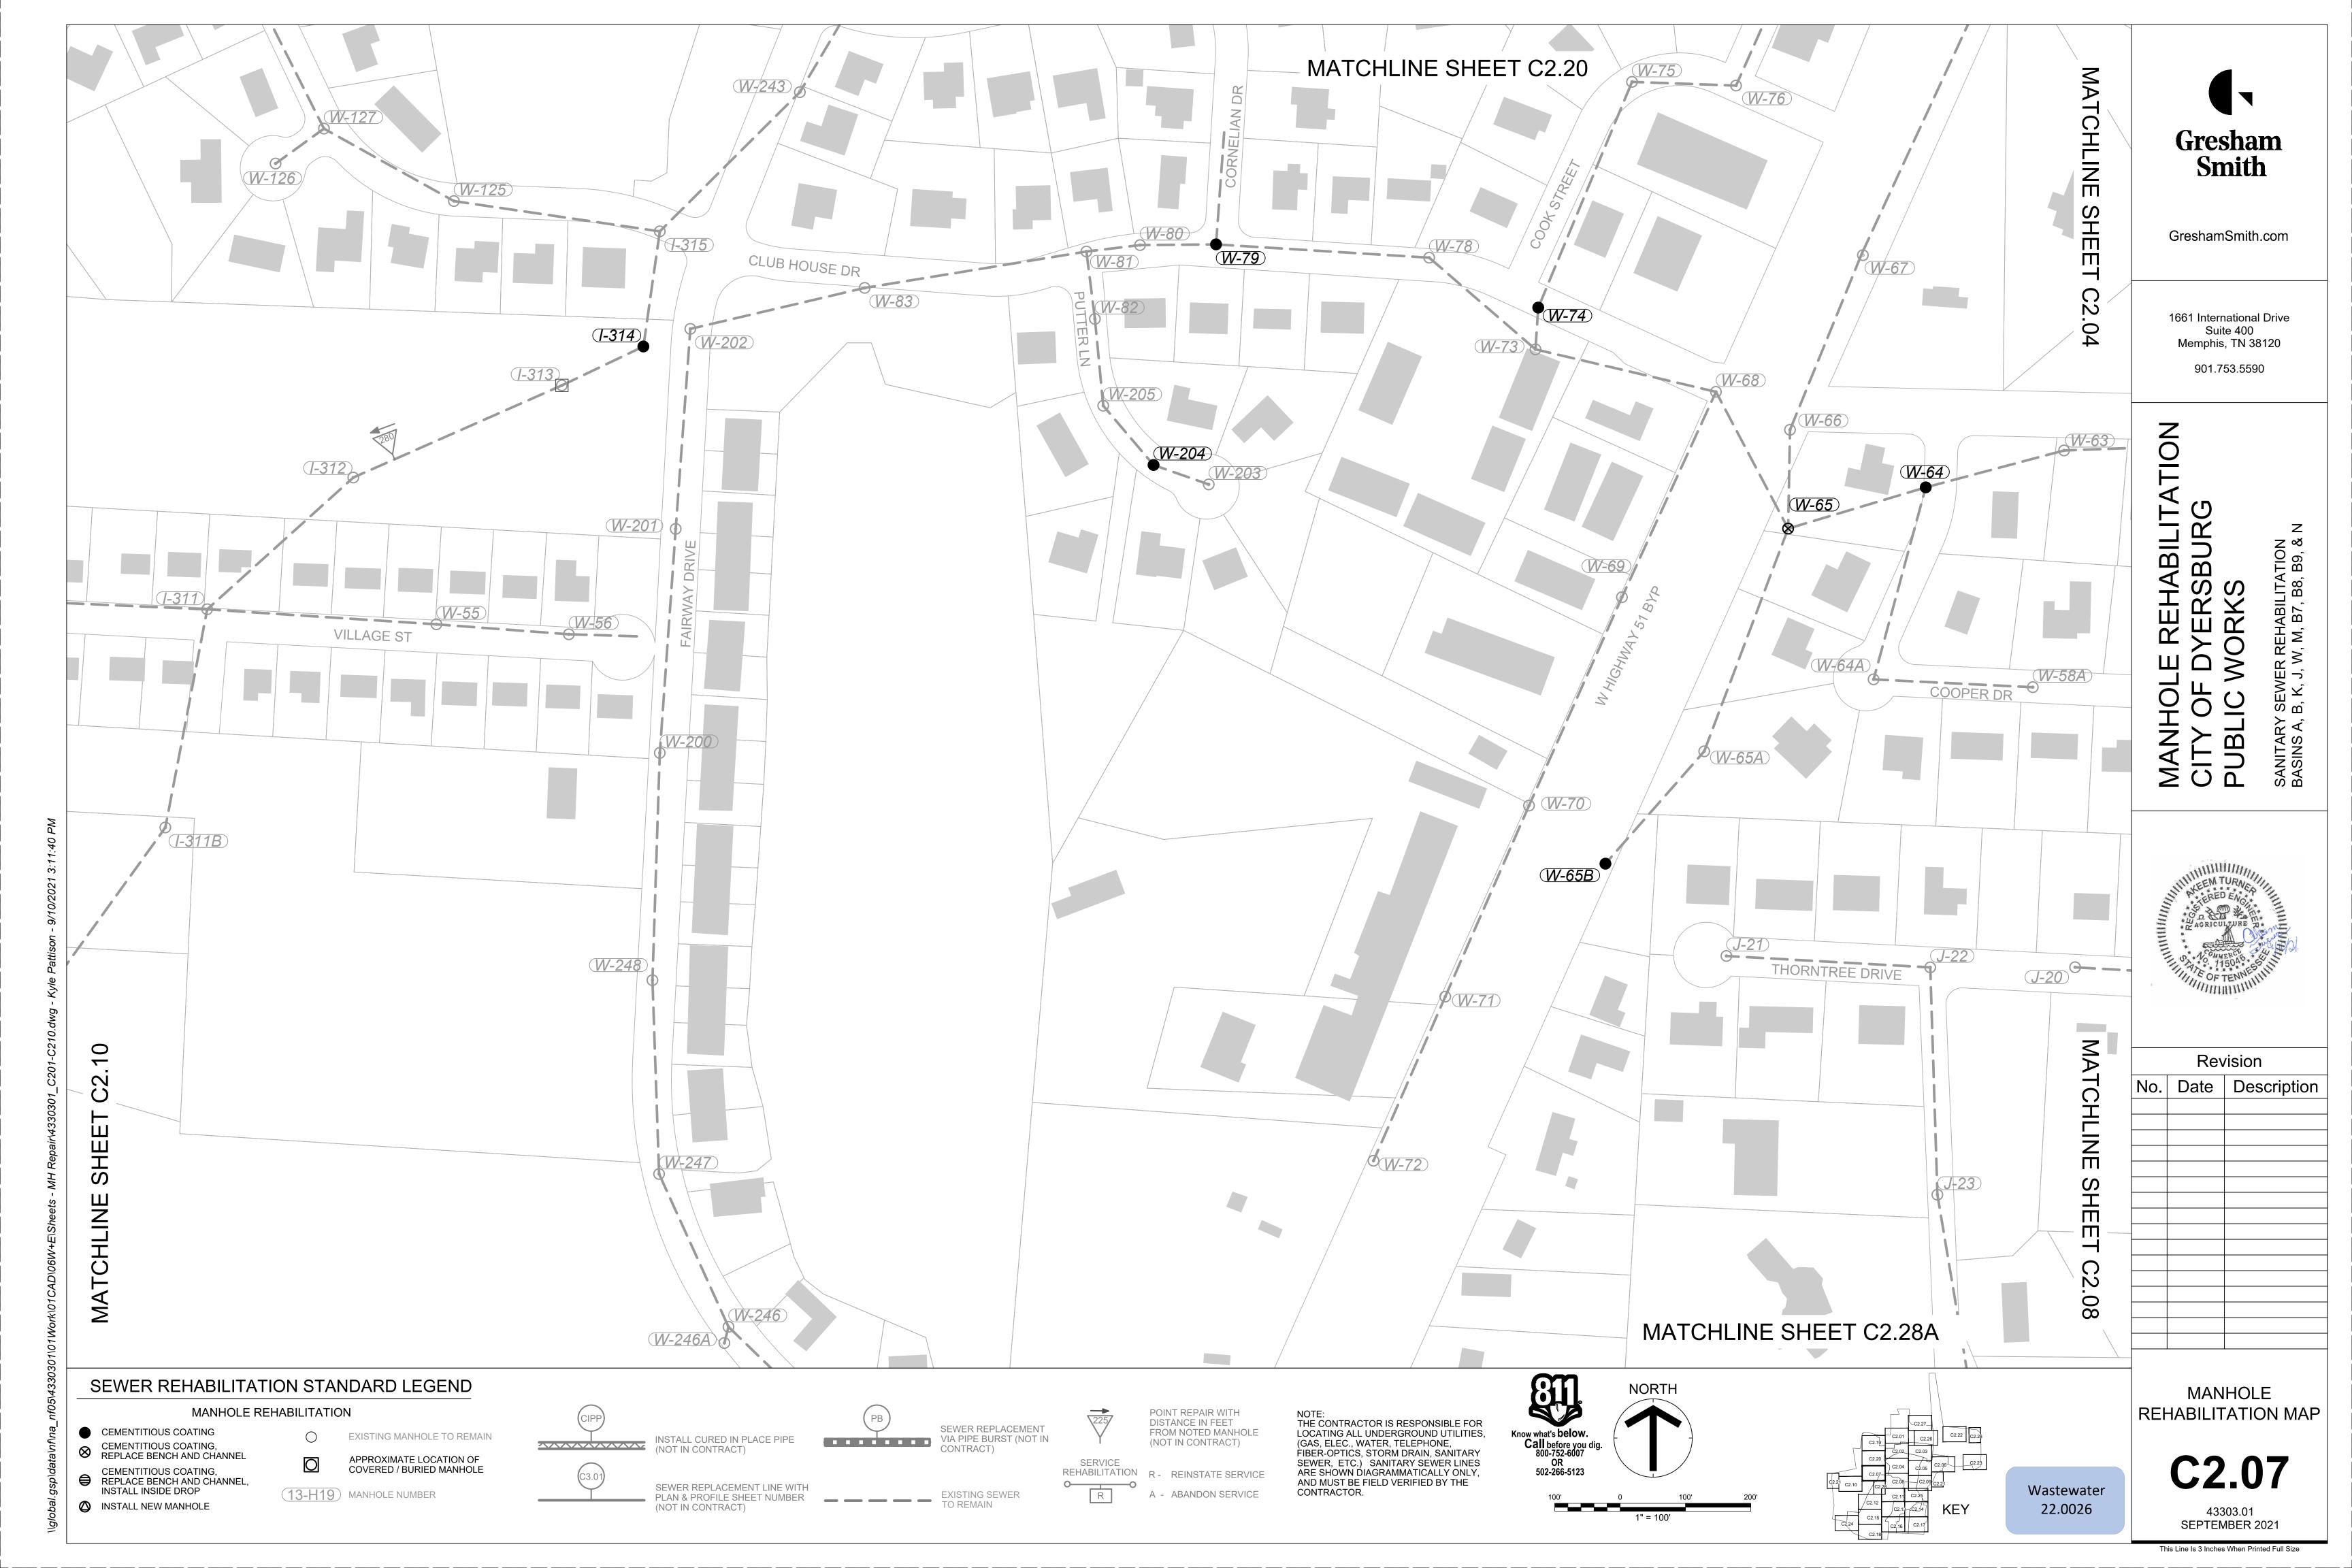

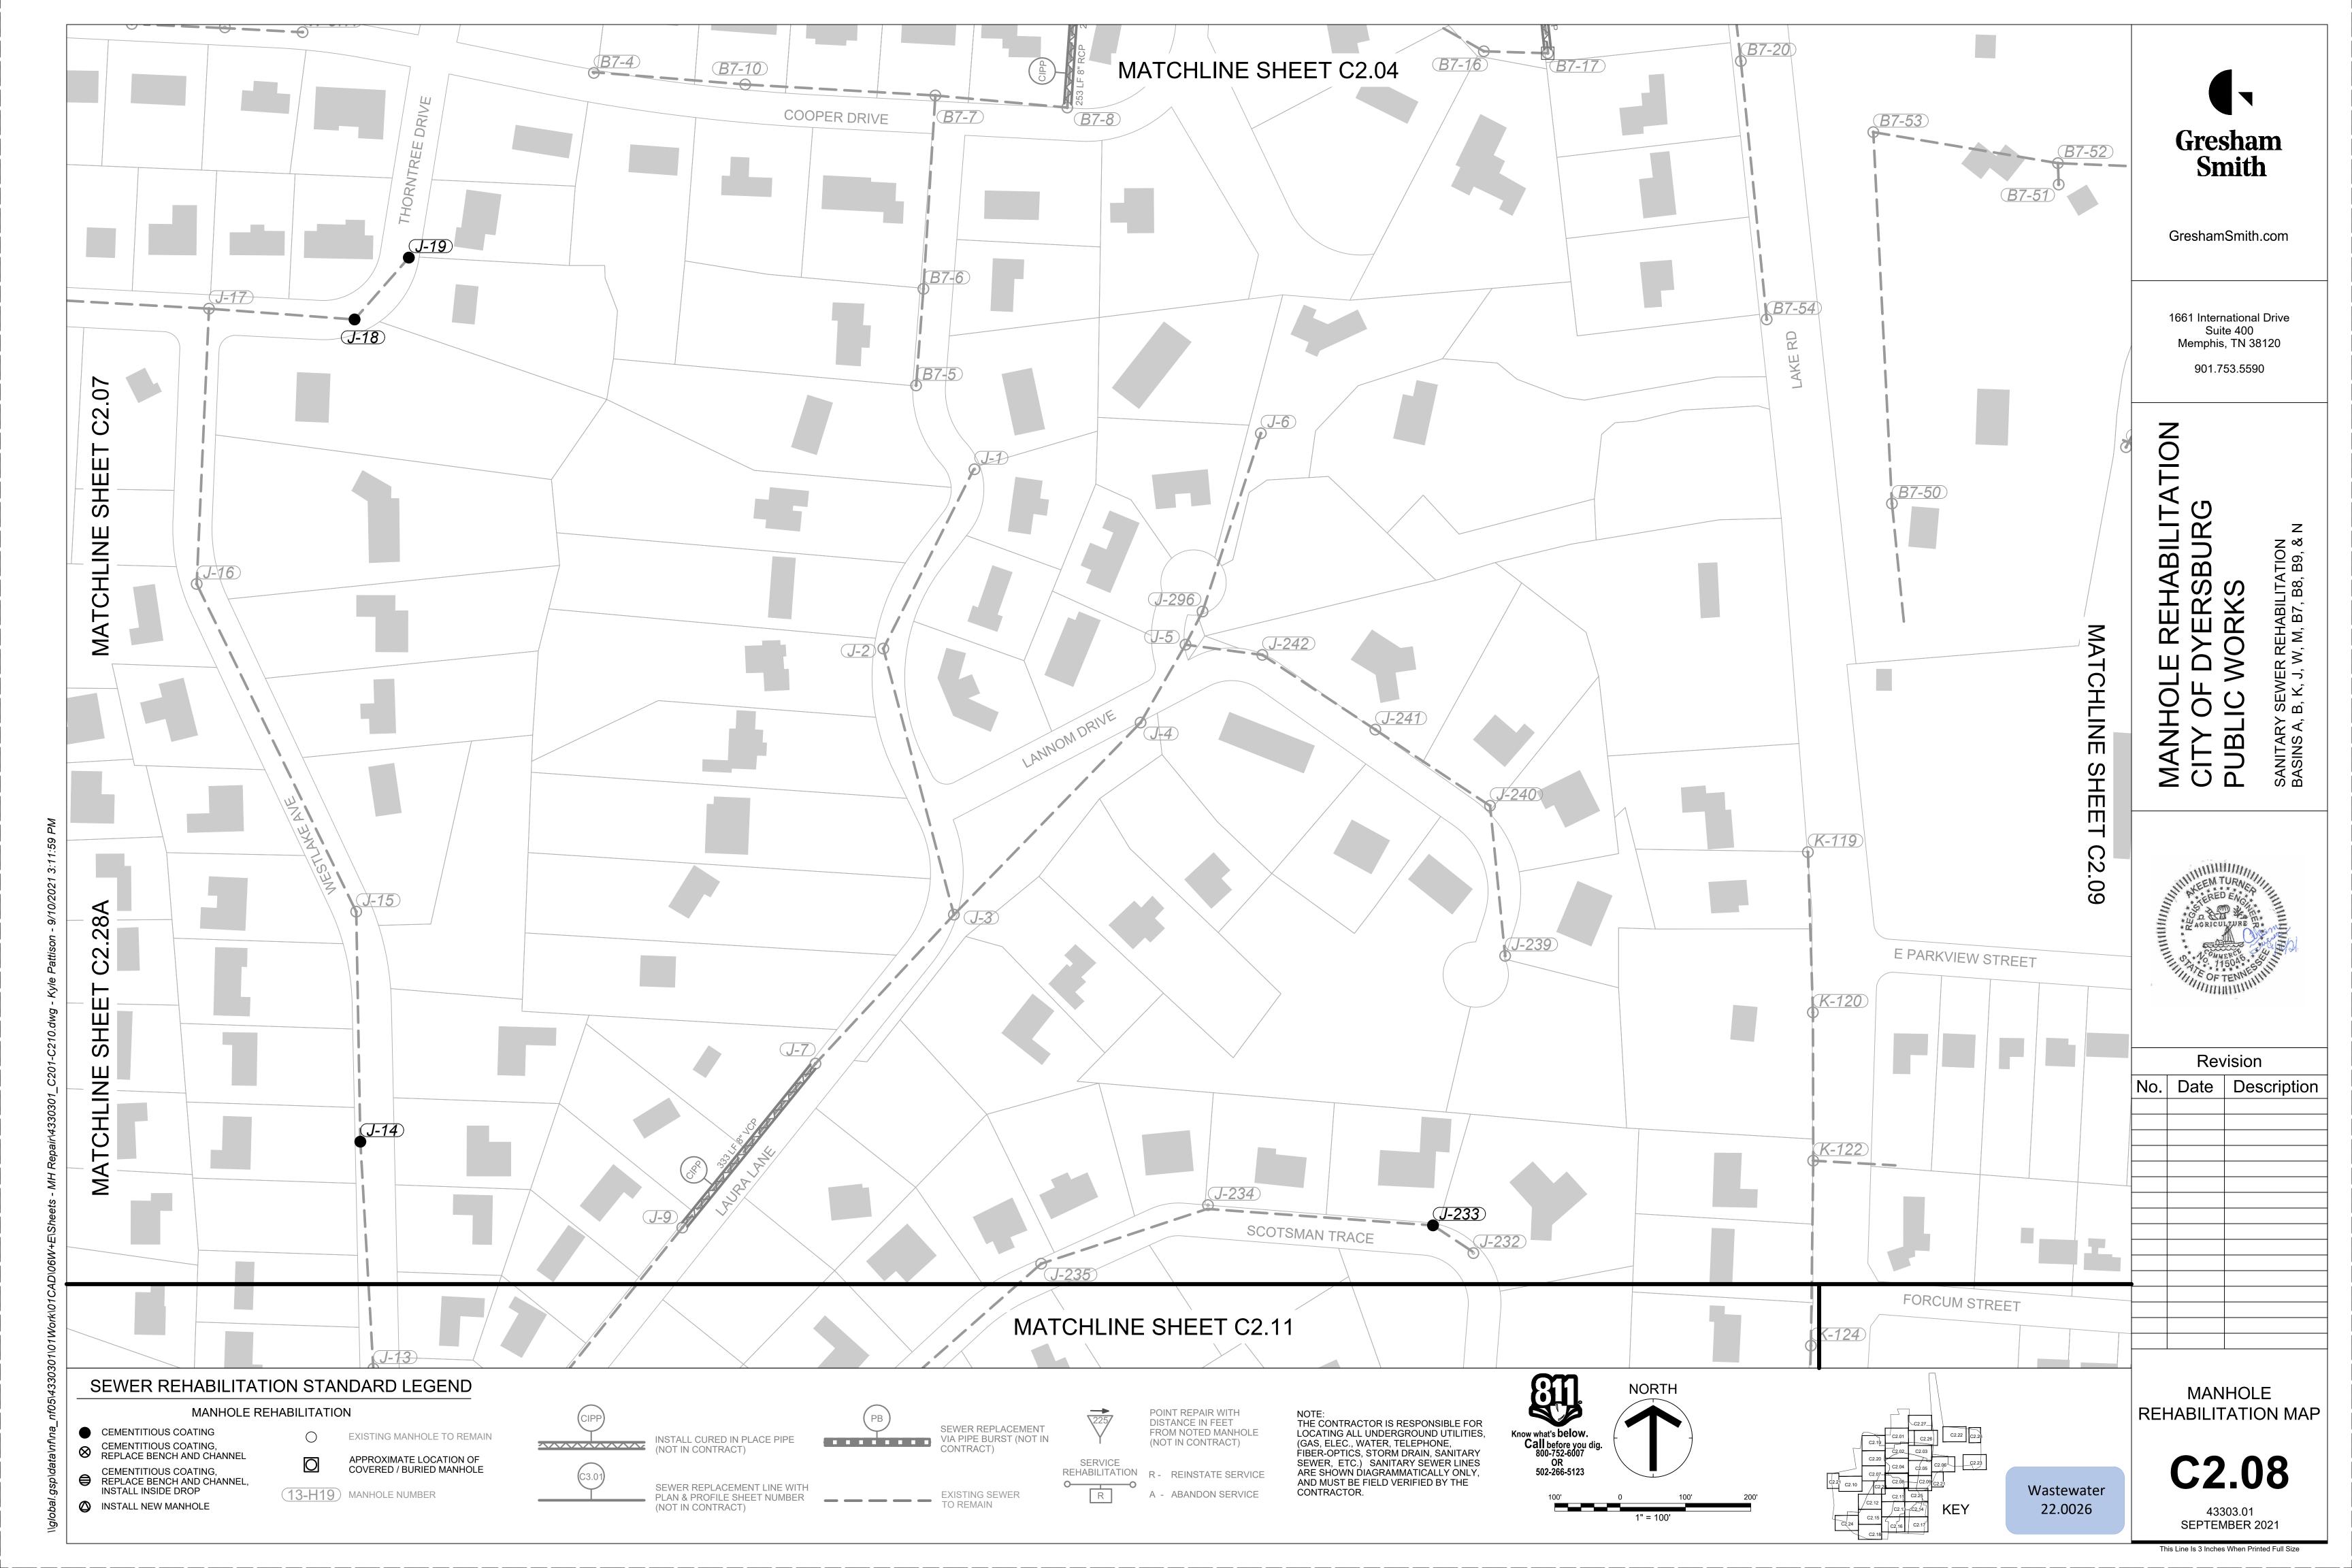

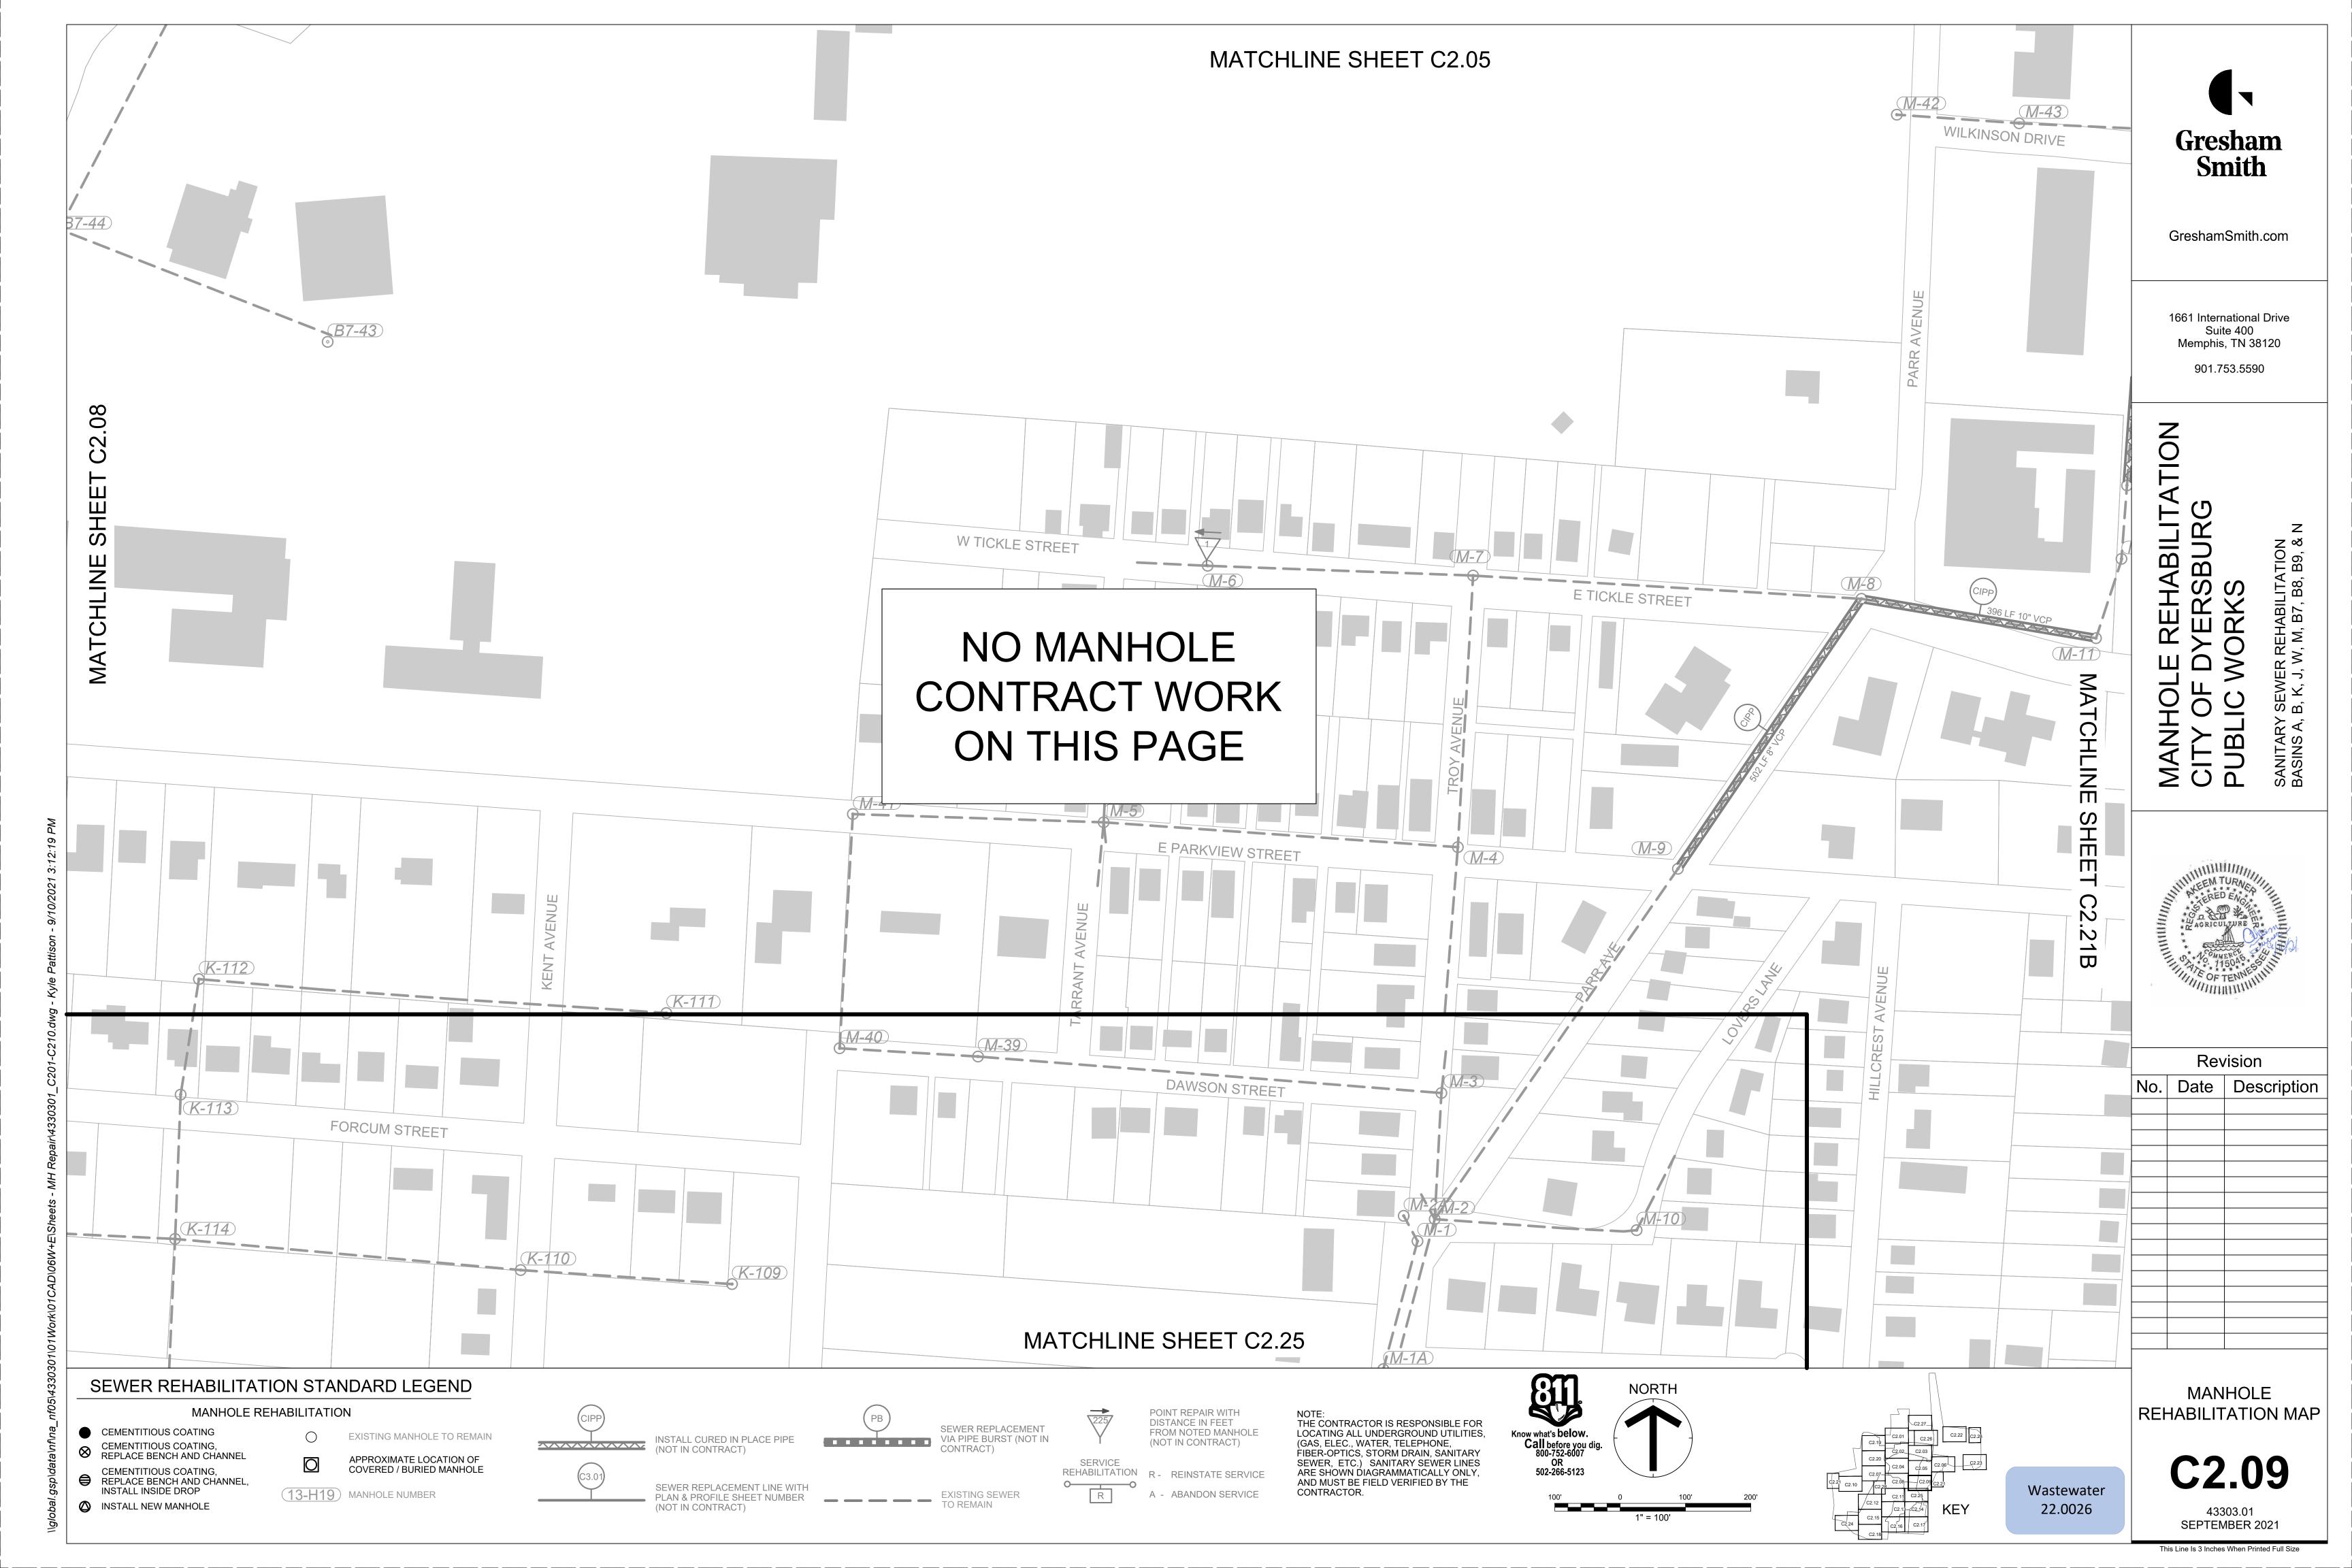

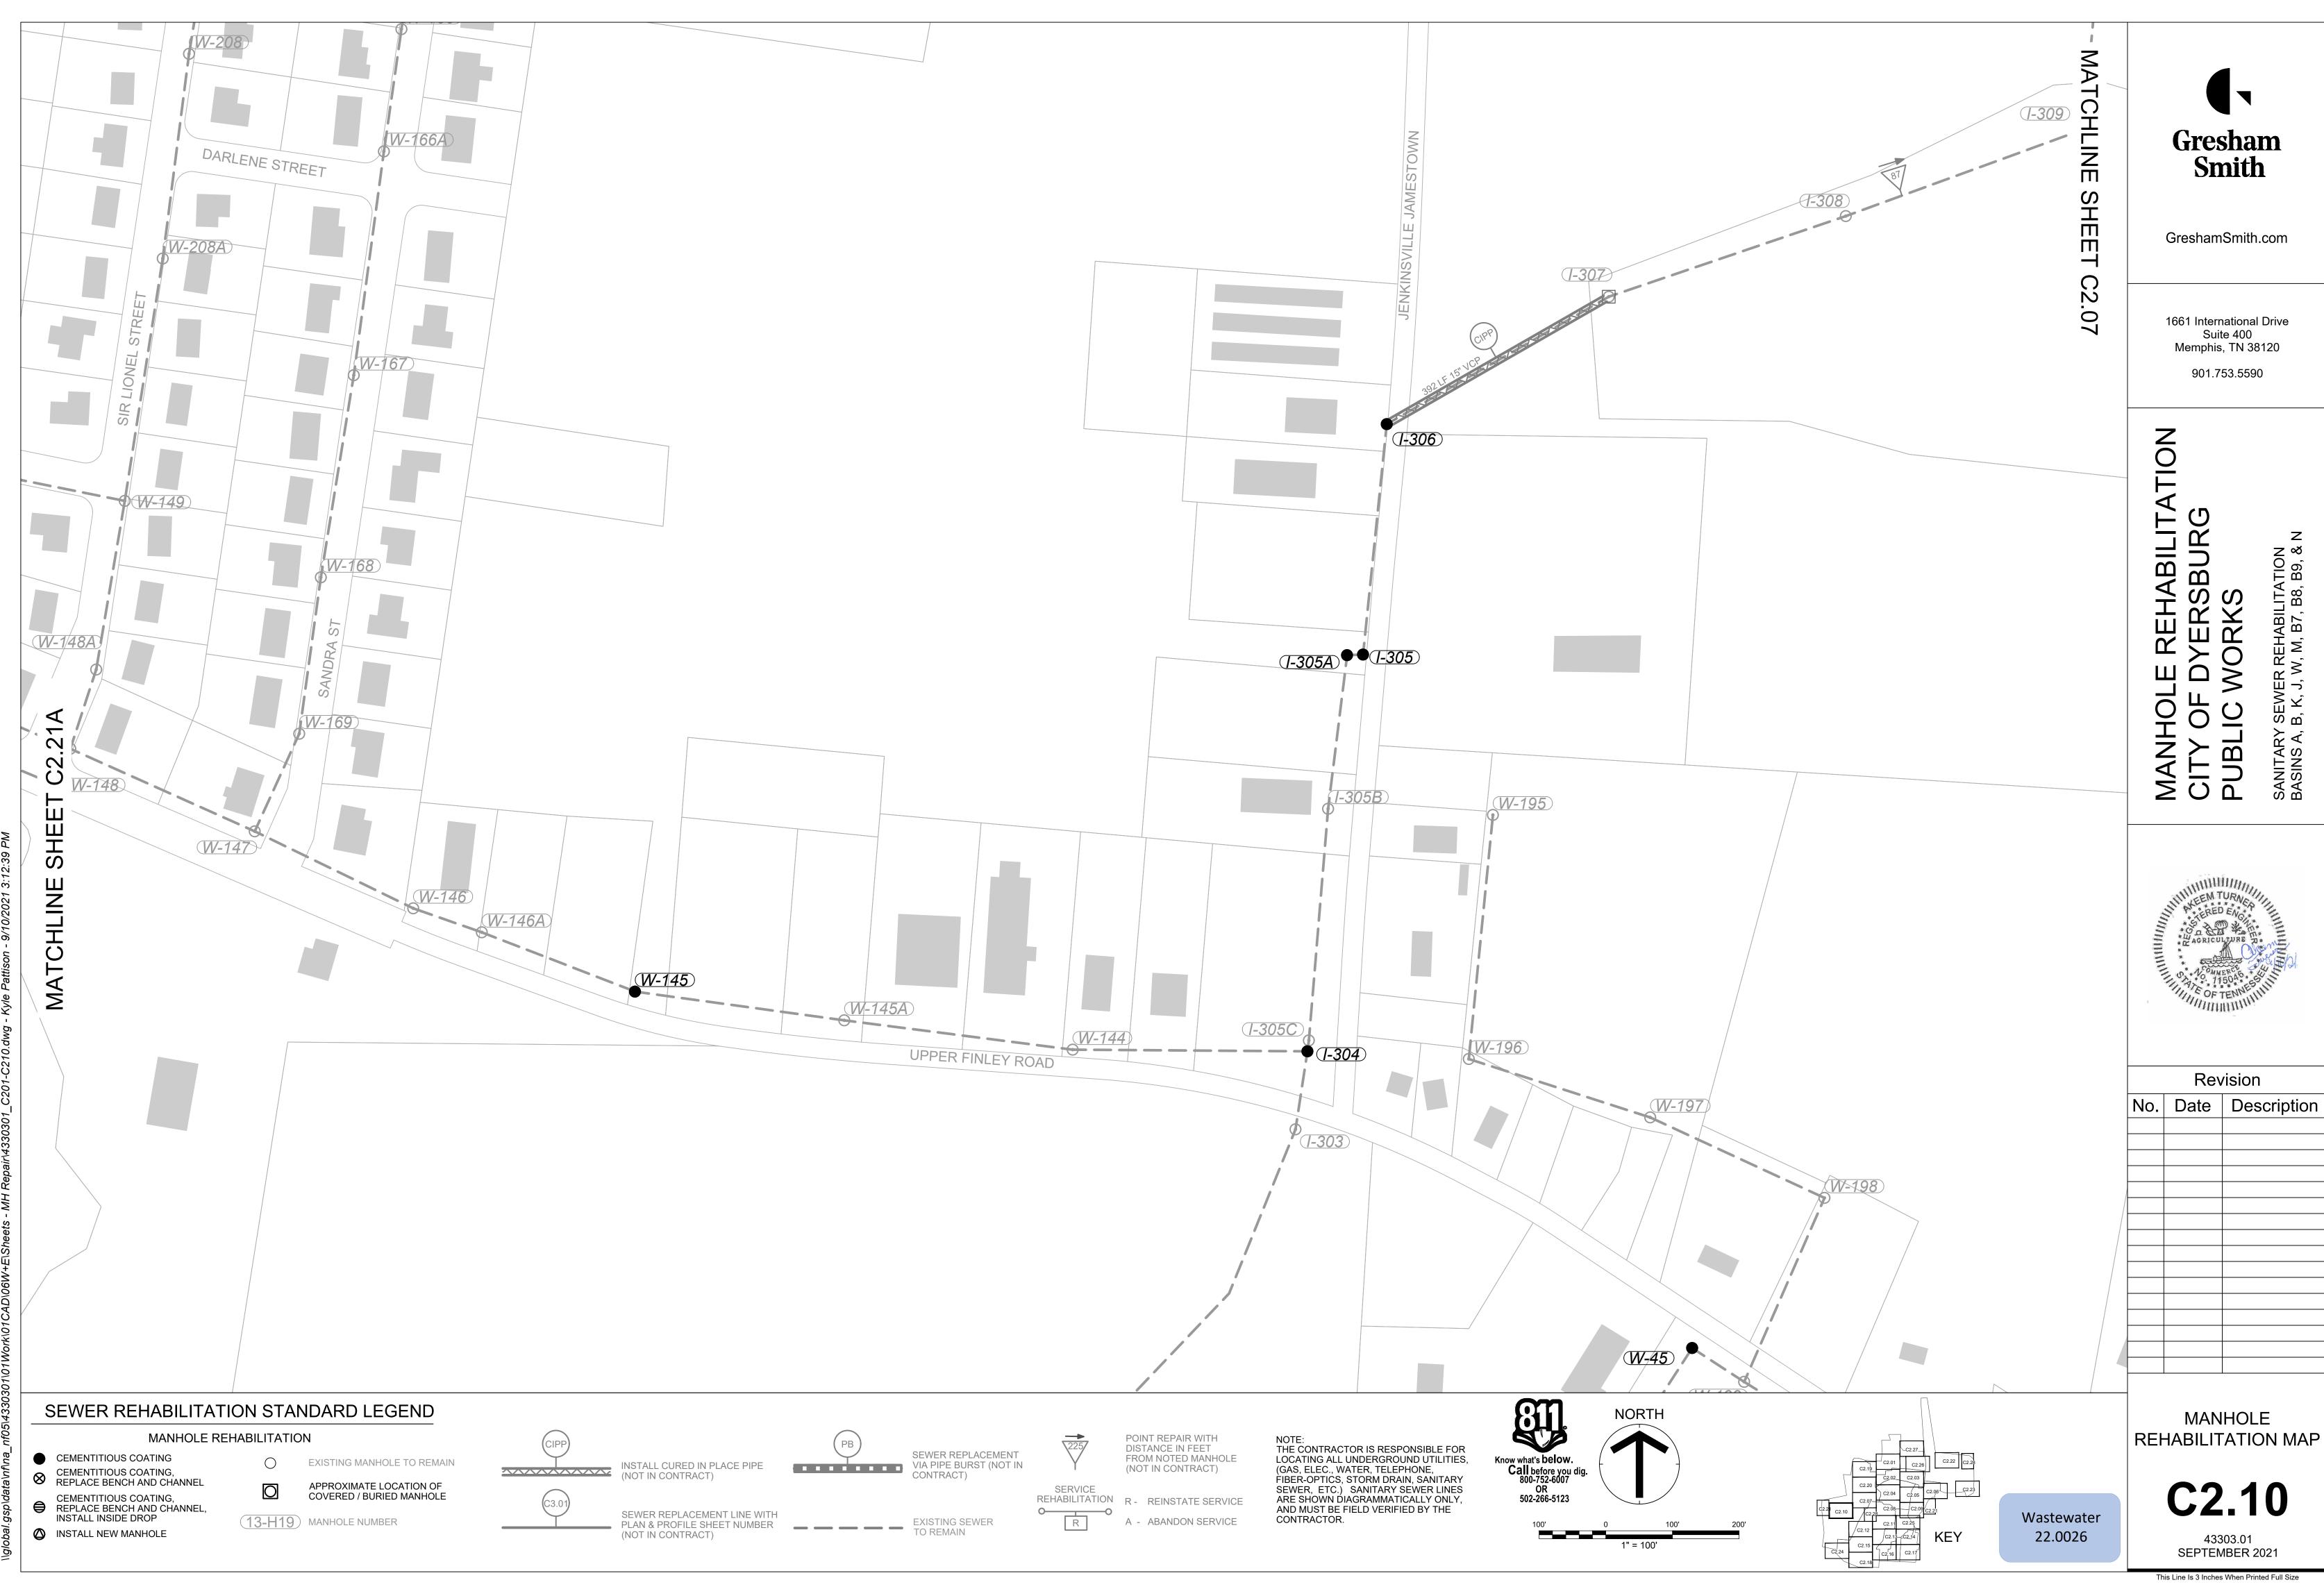

'ER REHABILITATION J, W, M, B7, B8, B9, & N





No. Date Description


MANHOLE


C2.10

SEPTEMBER 2021

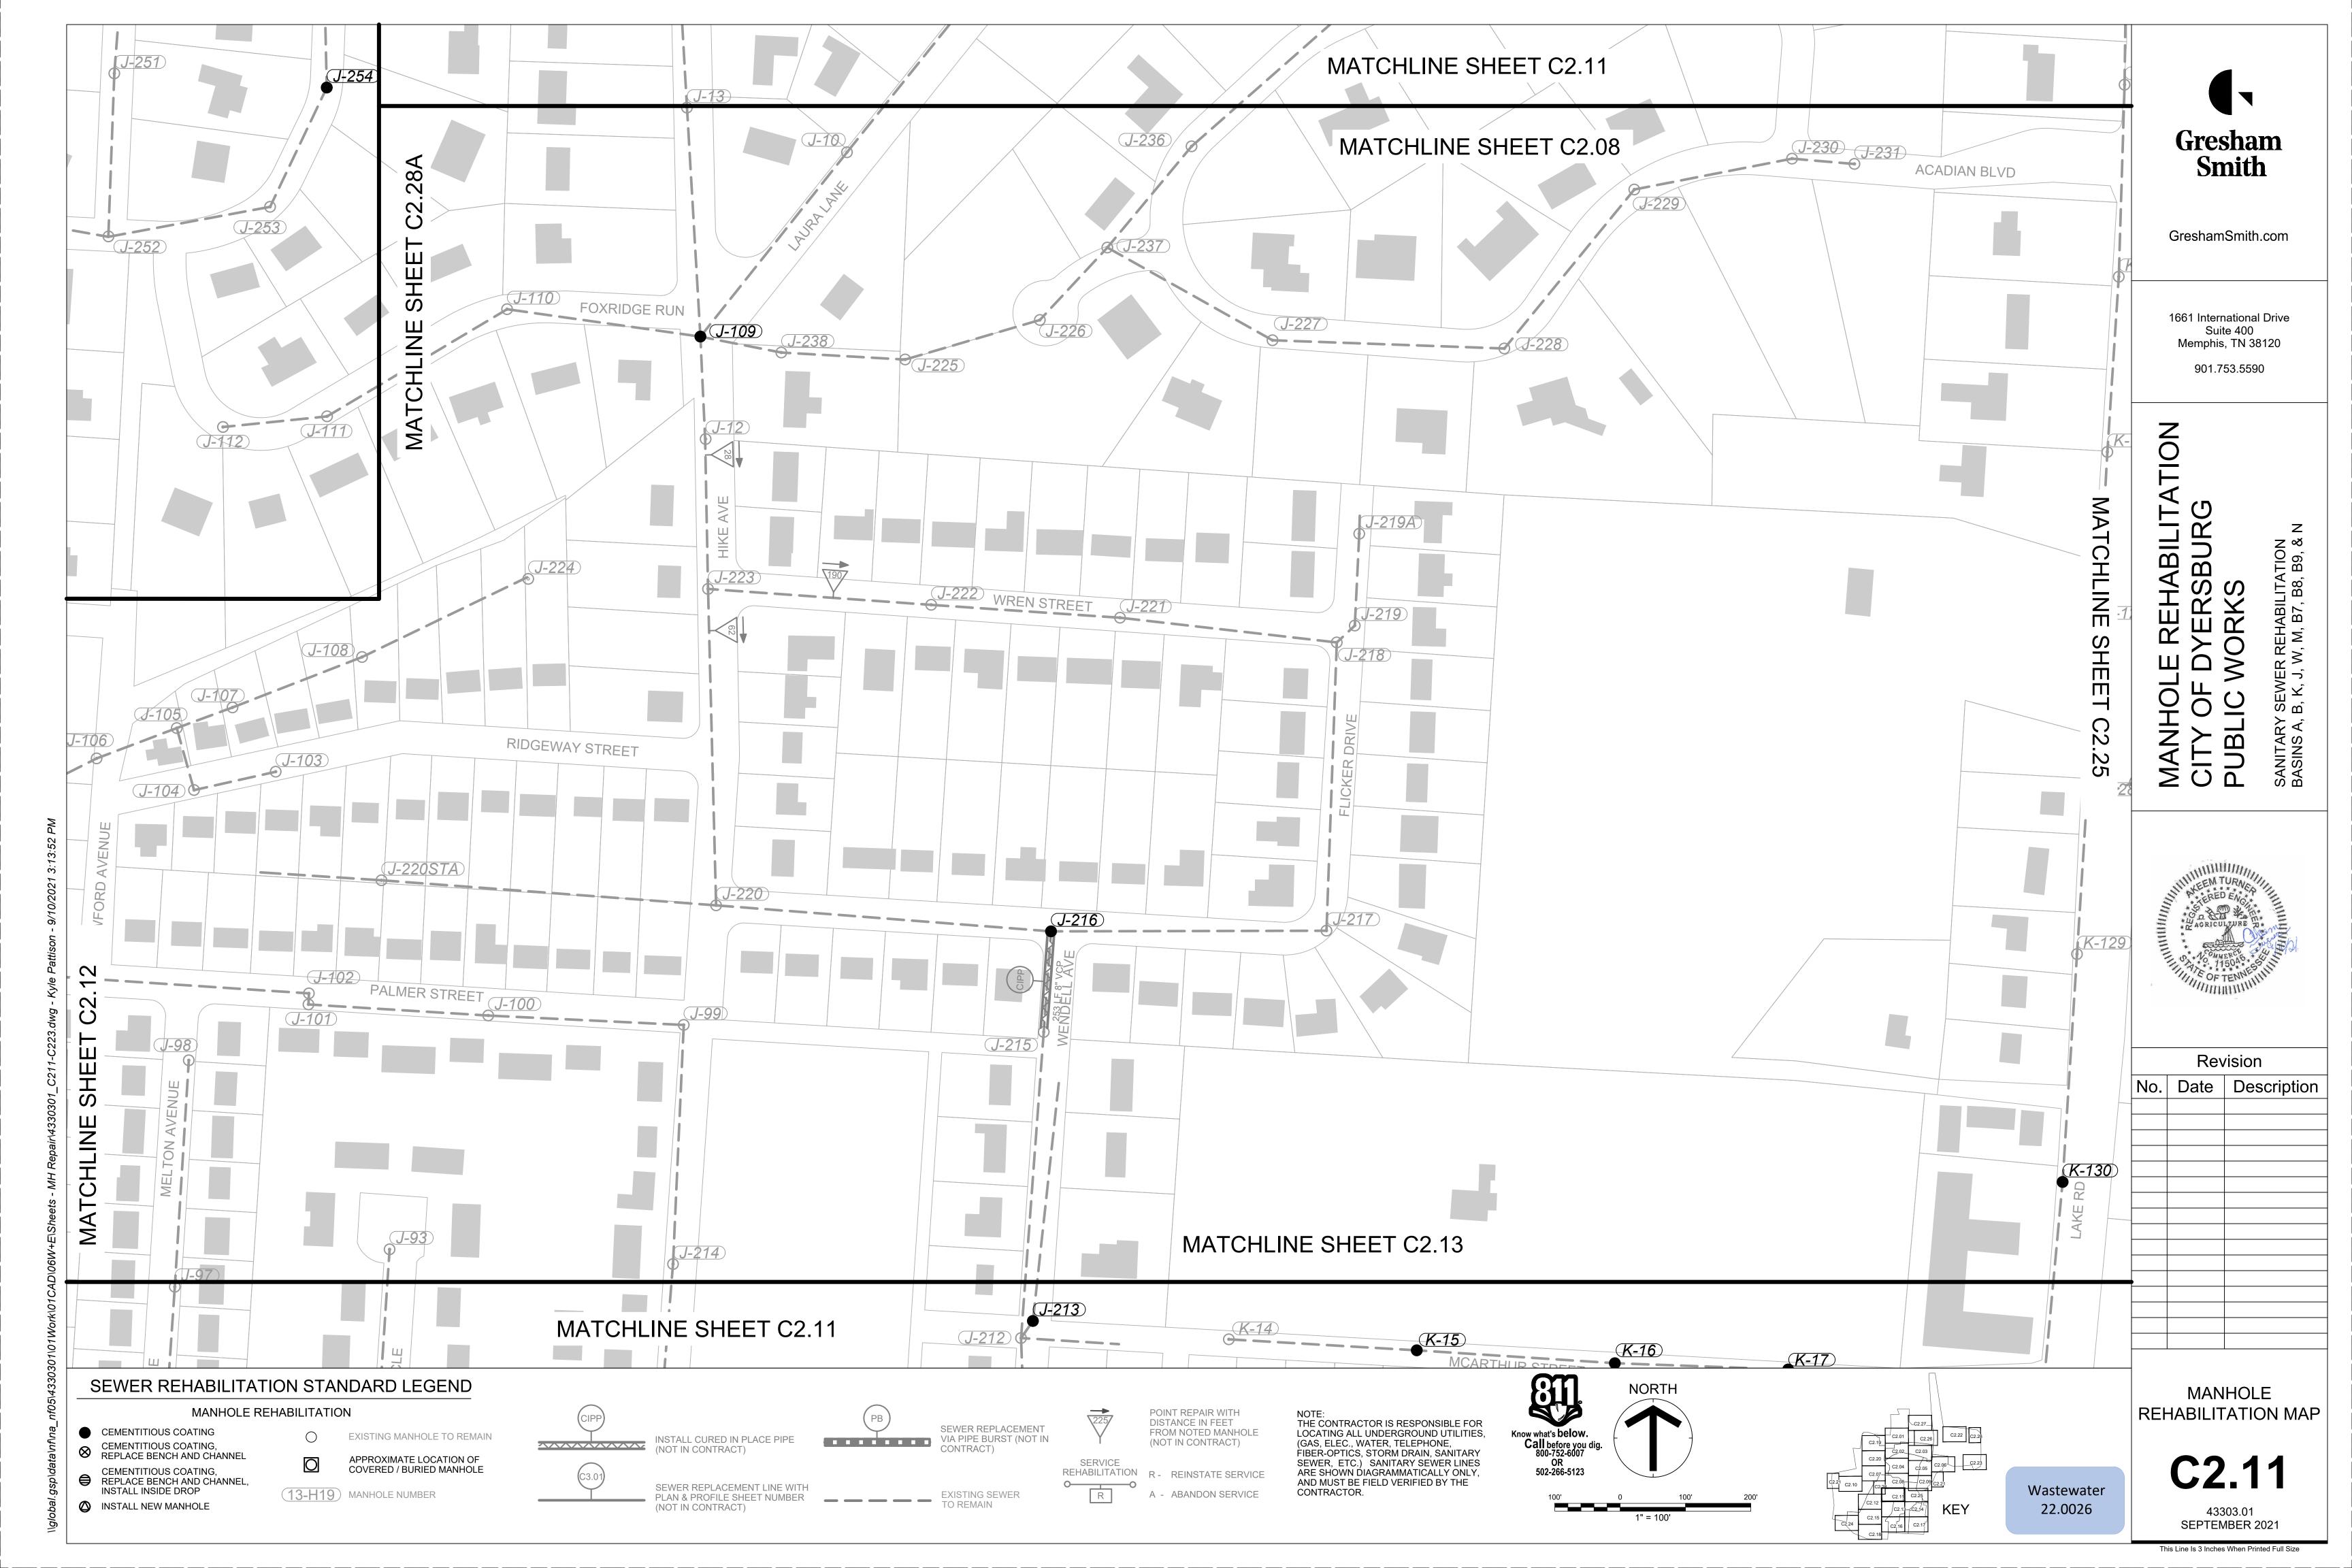

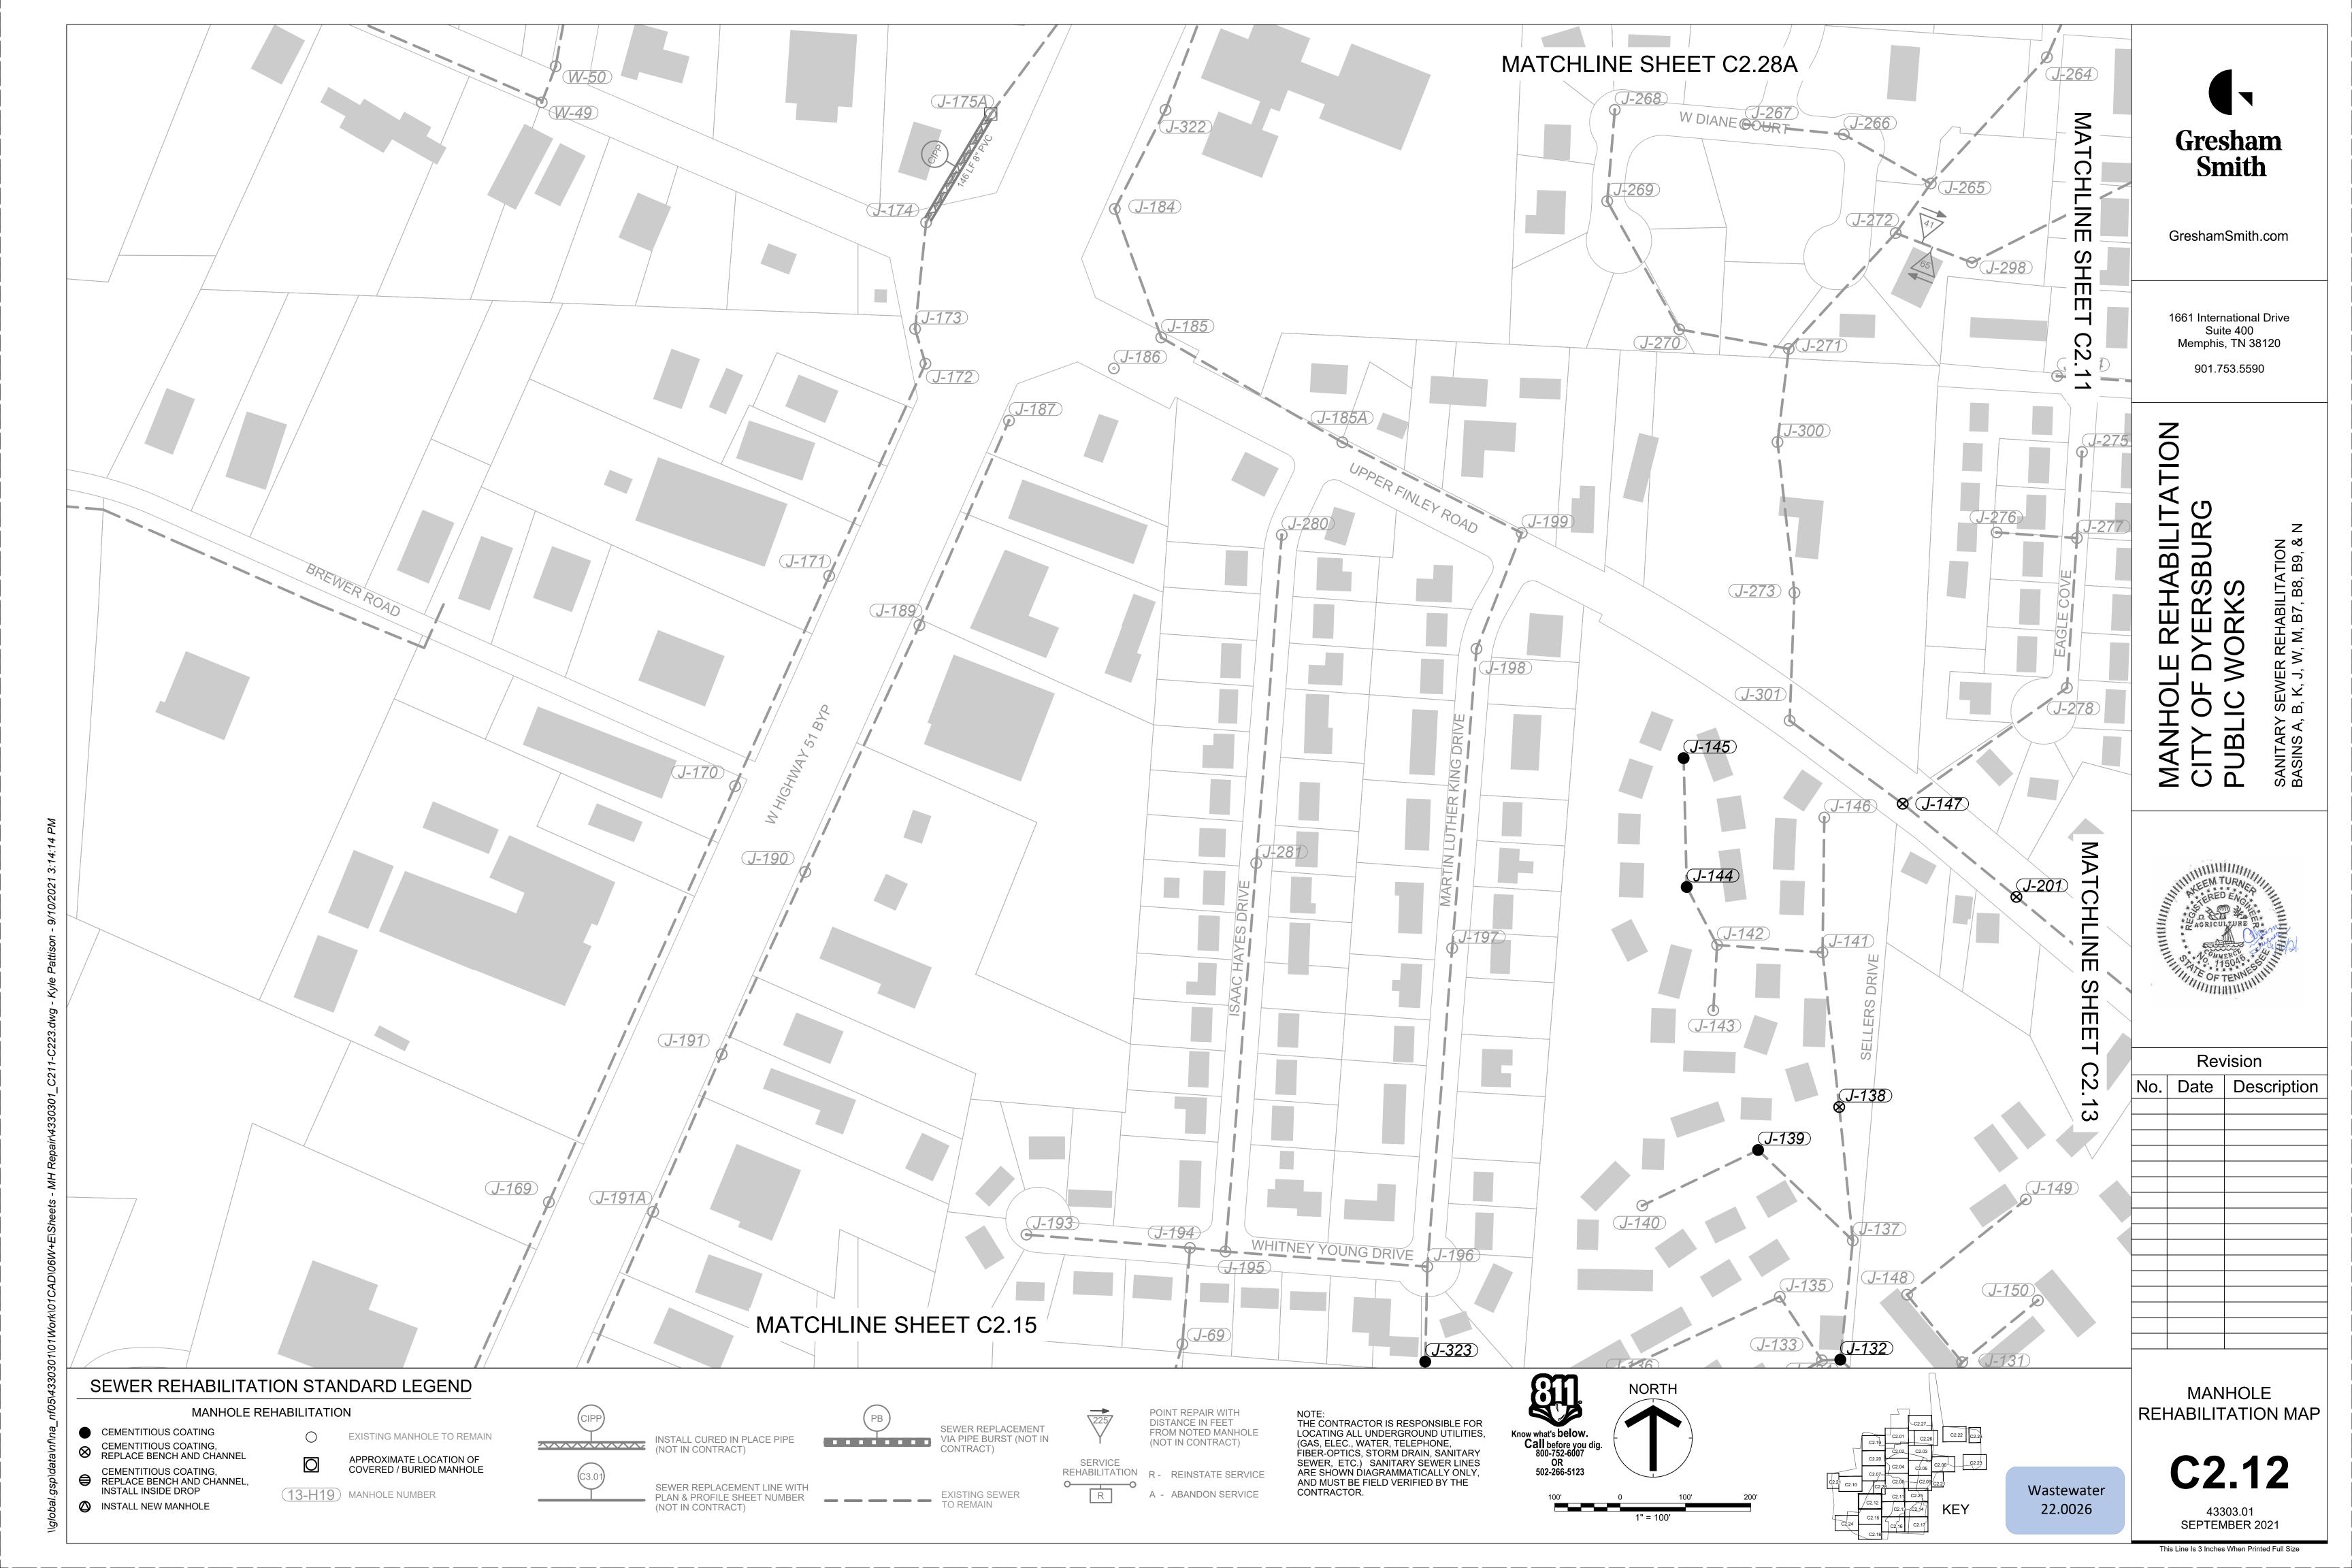

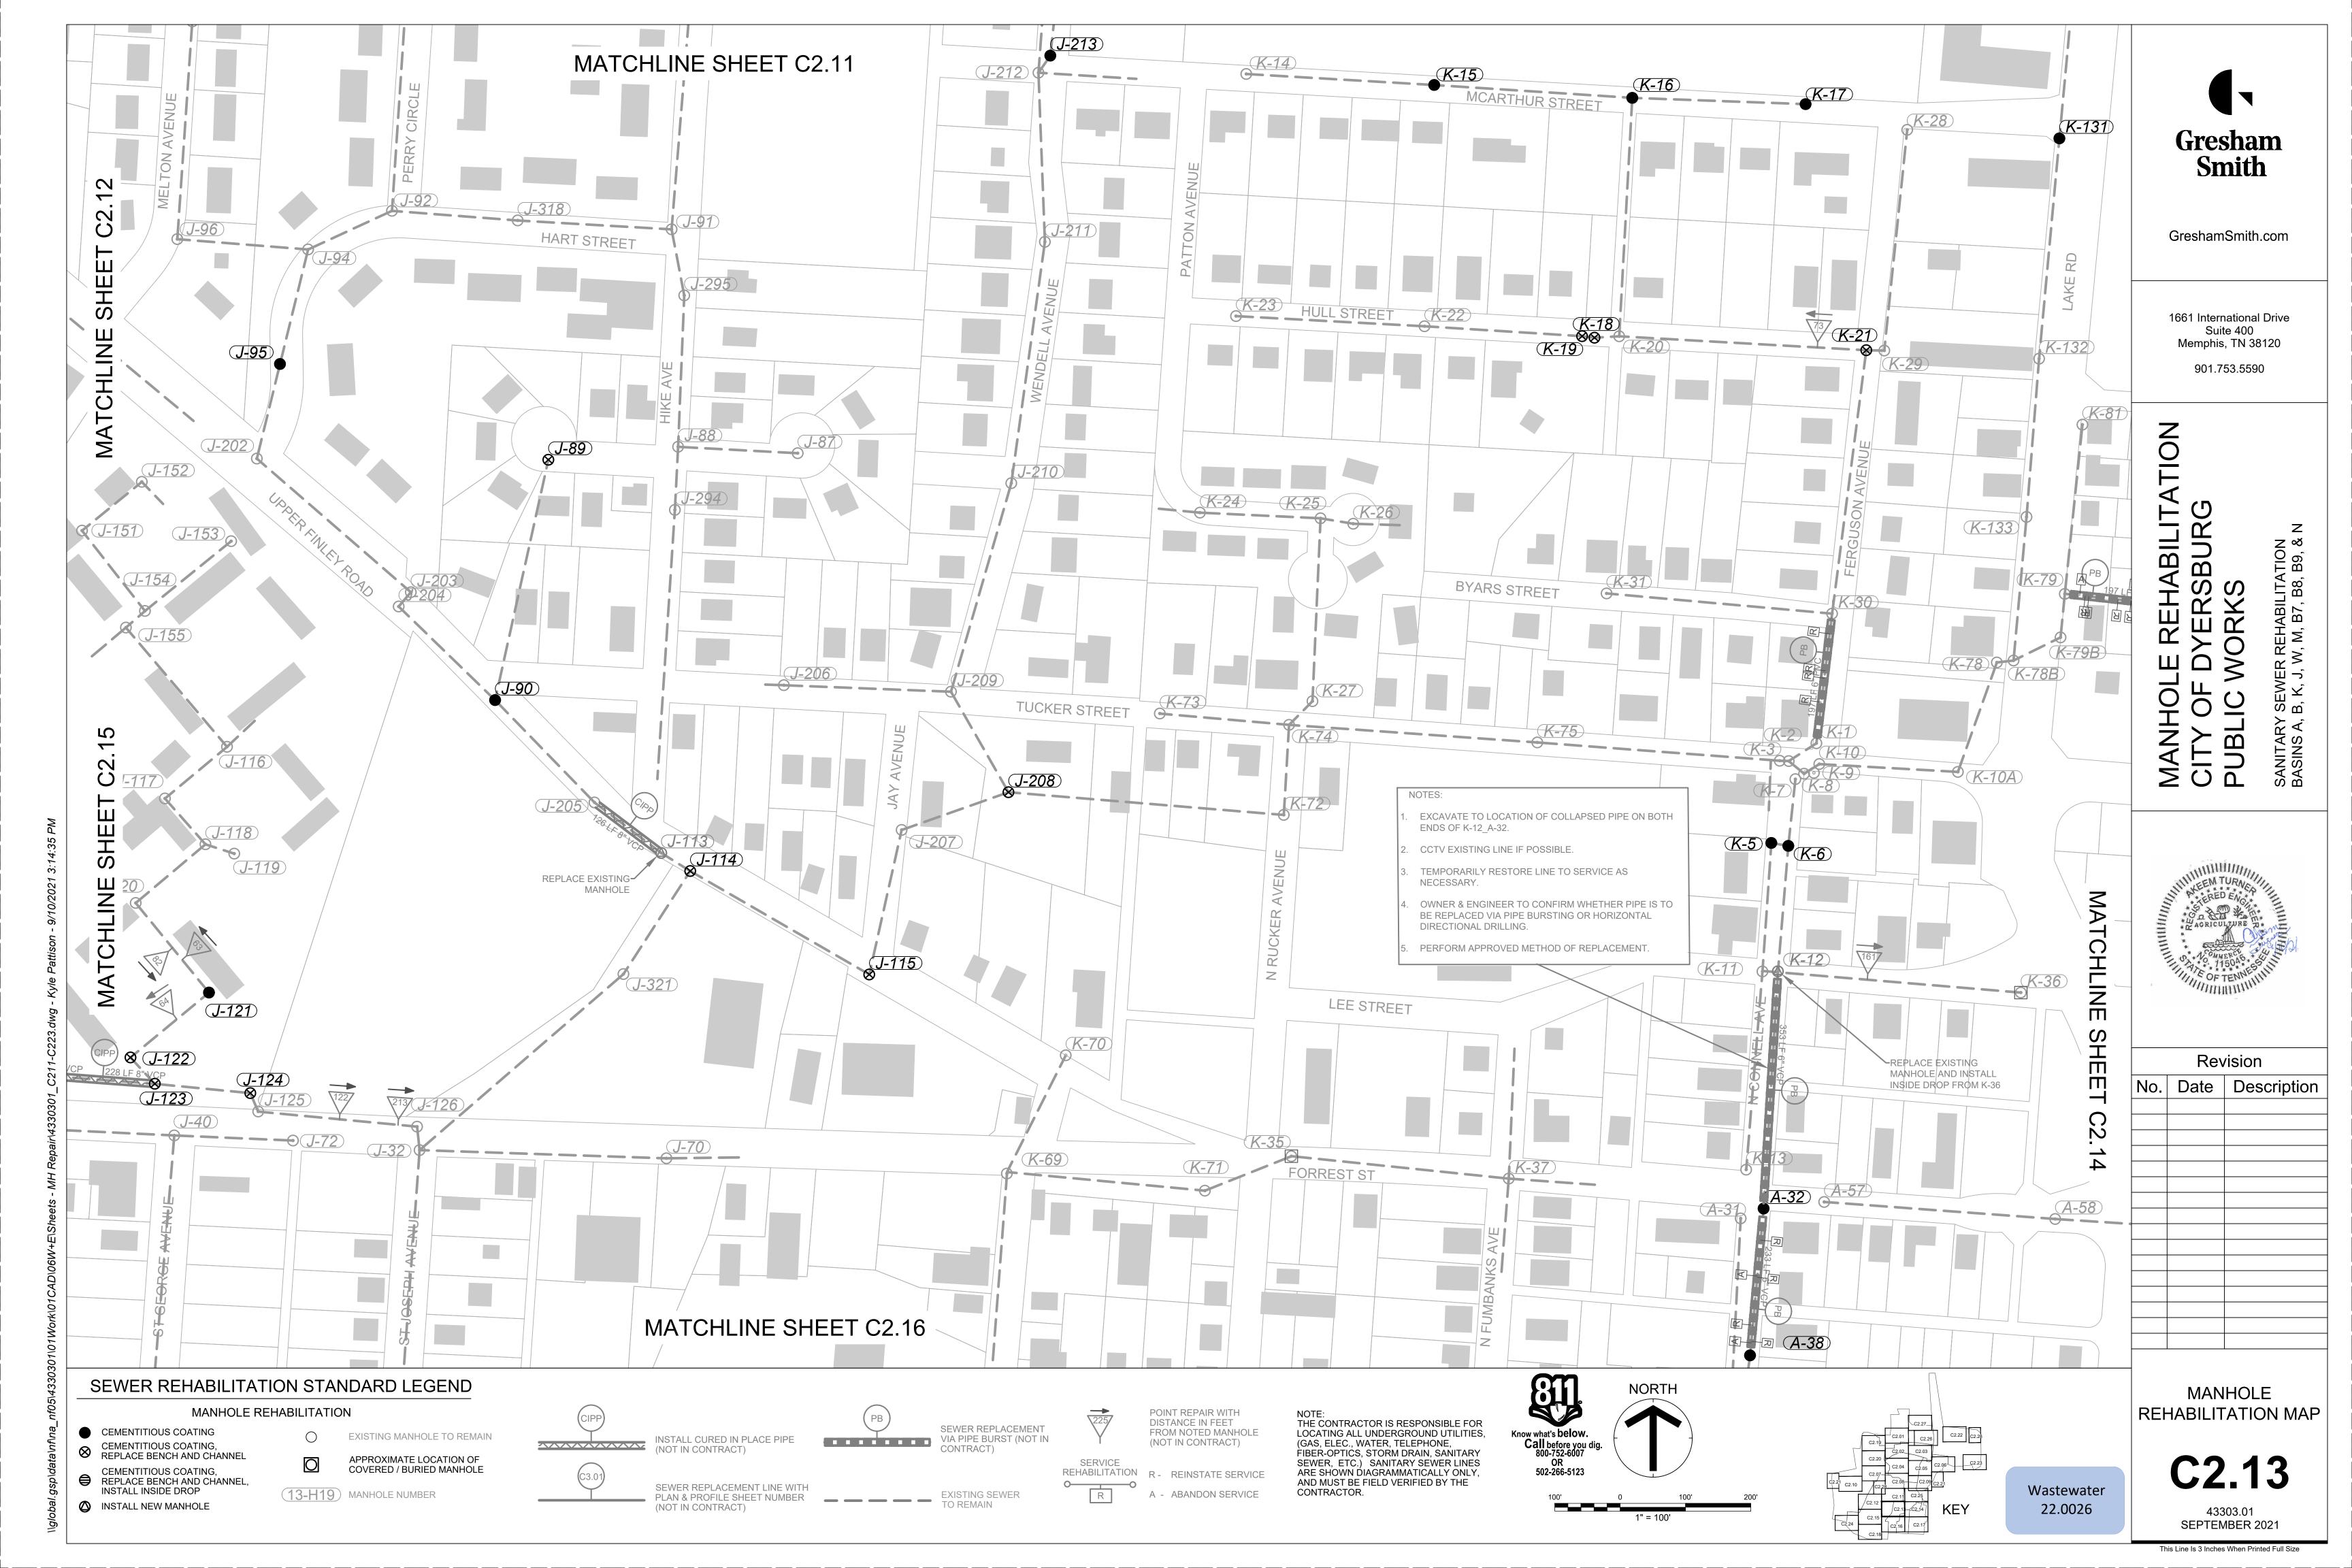

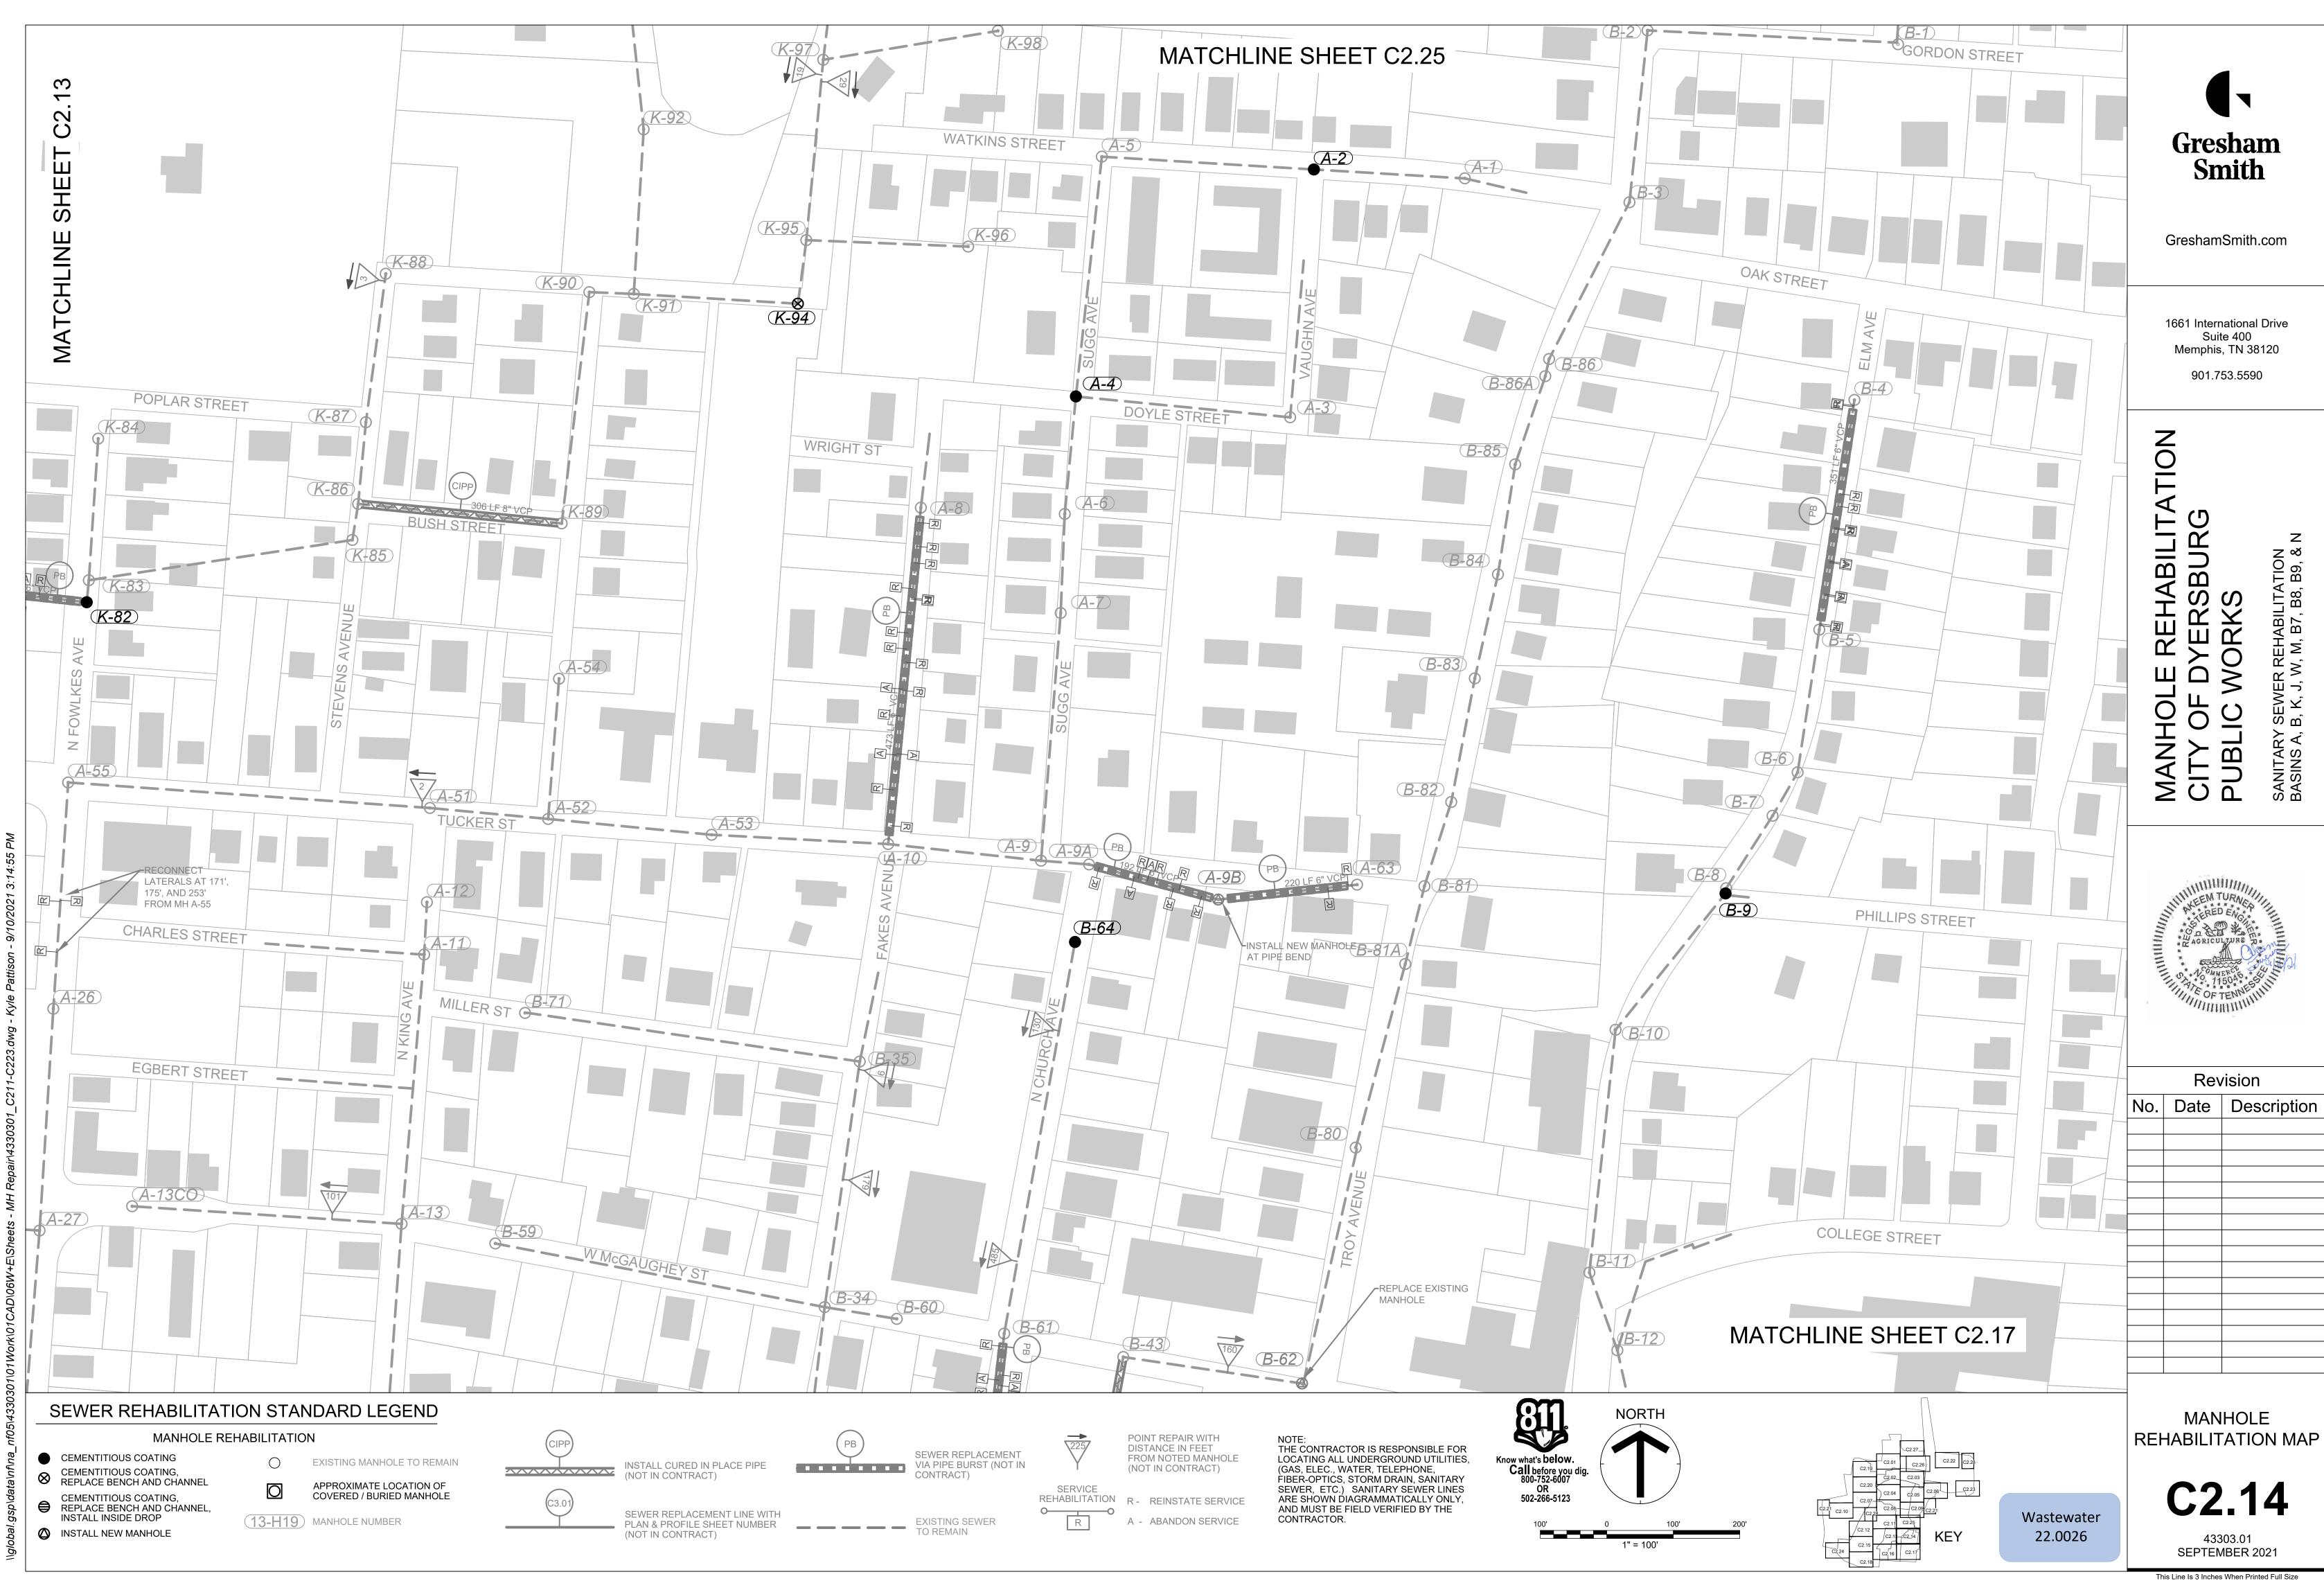

GreshamSmith.com

1661 International Drive Suite 400 Memphis, TN 38120

901.753.5590

PUBI





Revision No. Date Description

MANHOLE


C2.14



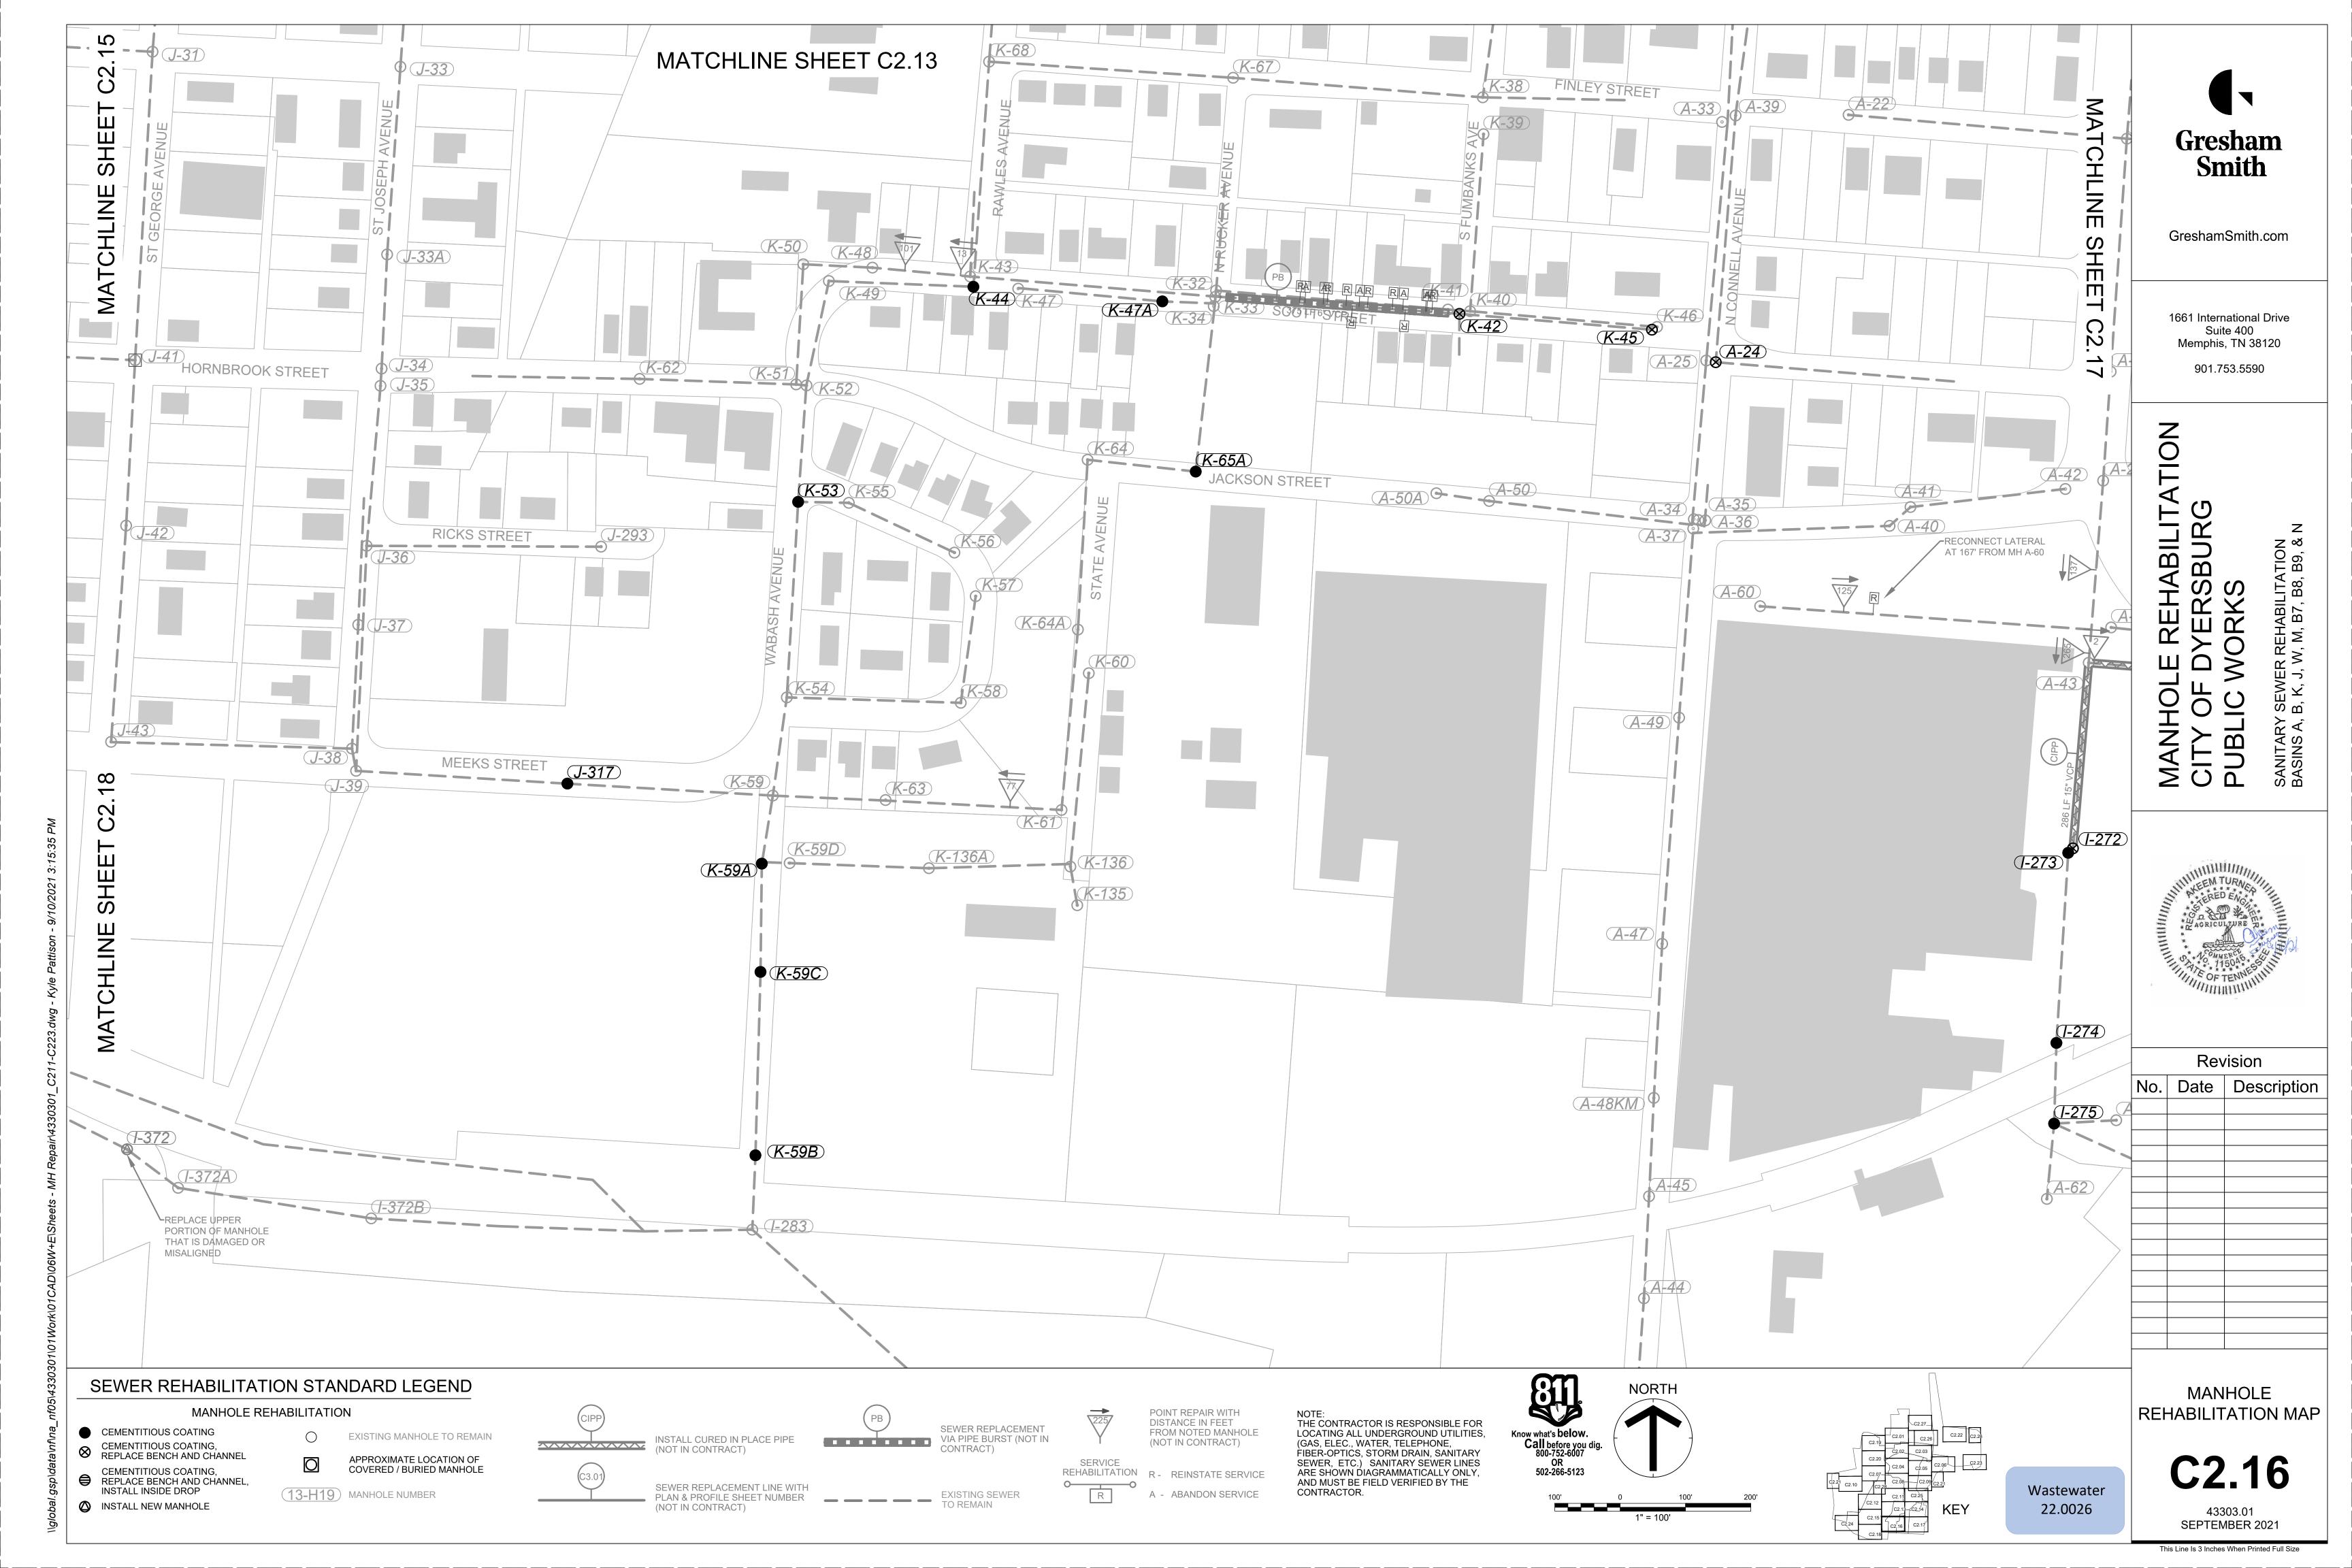

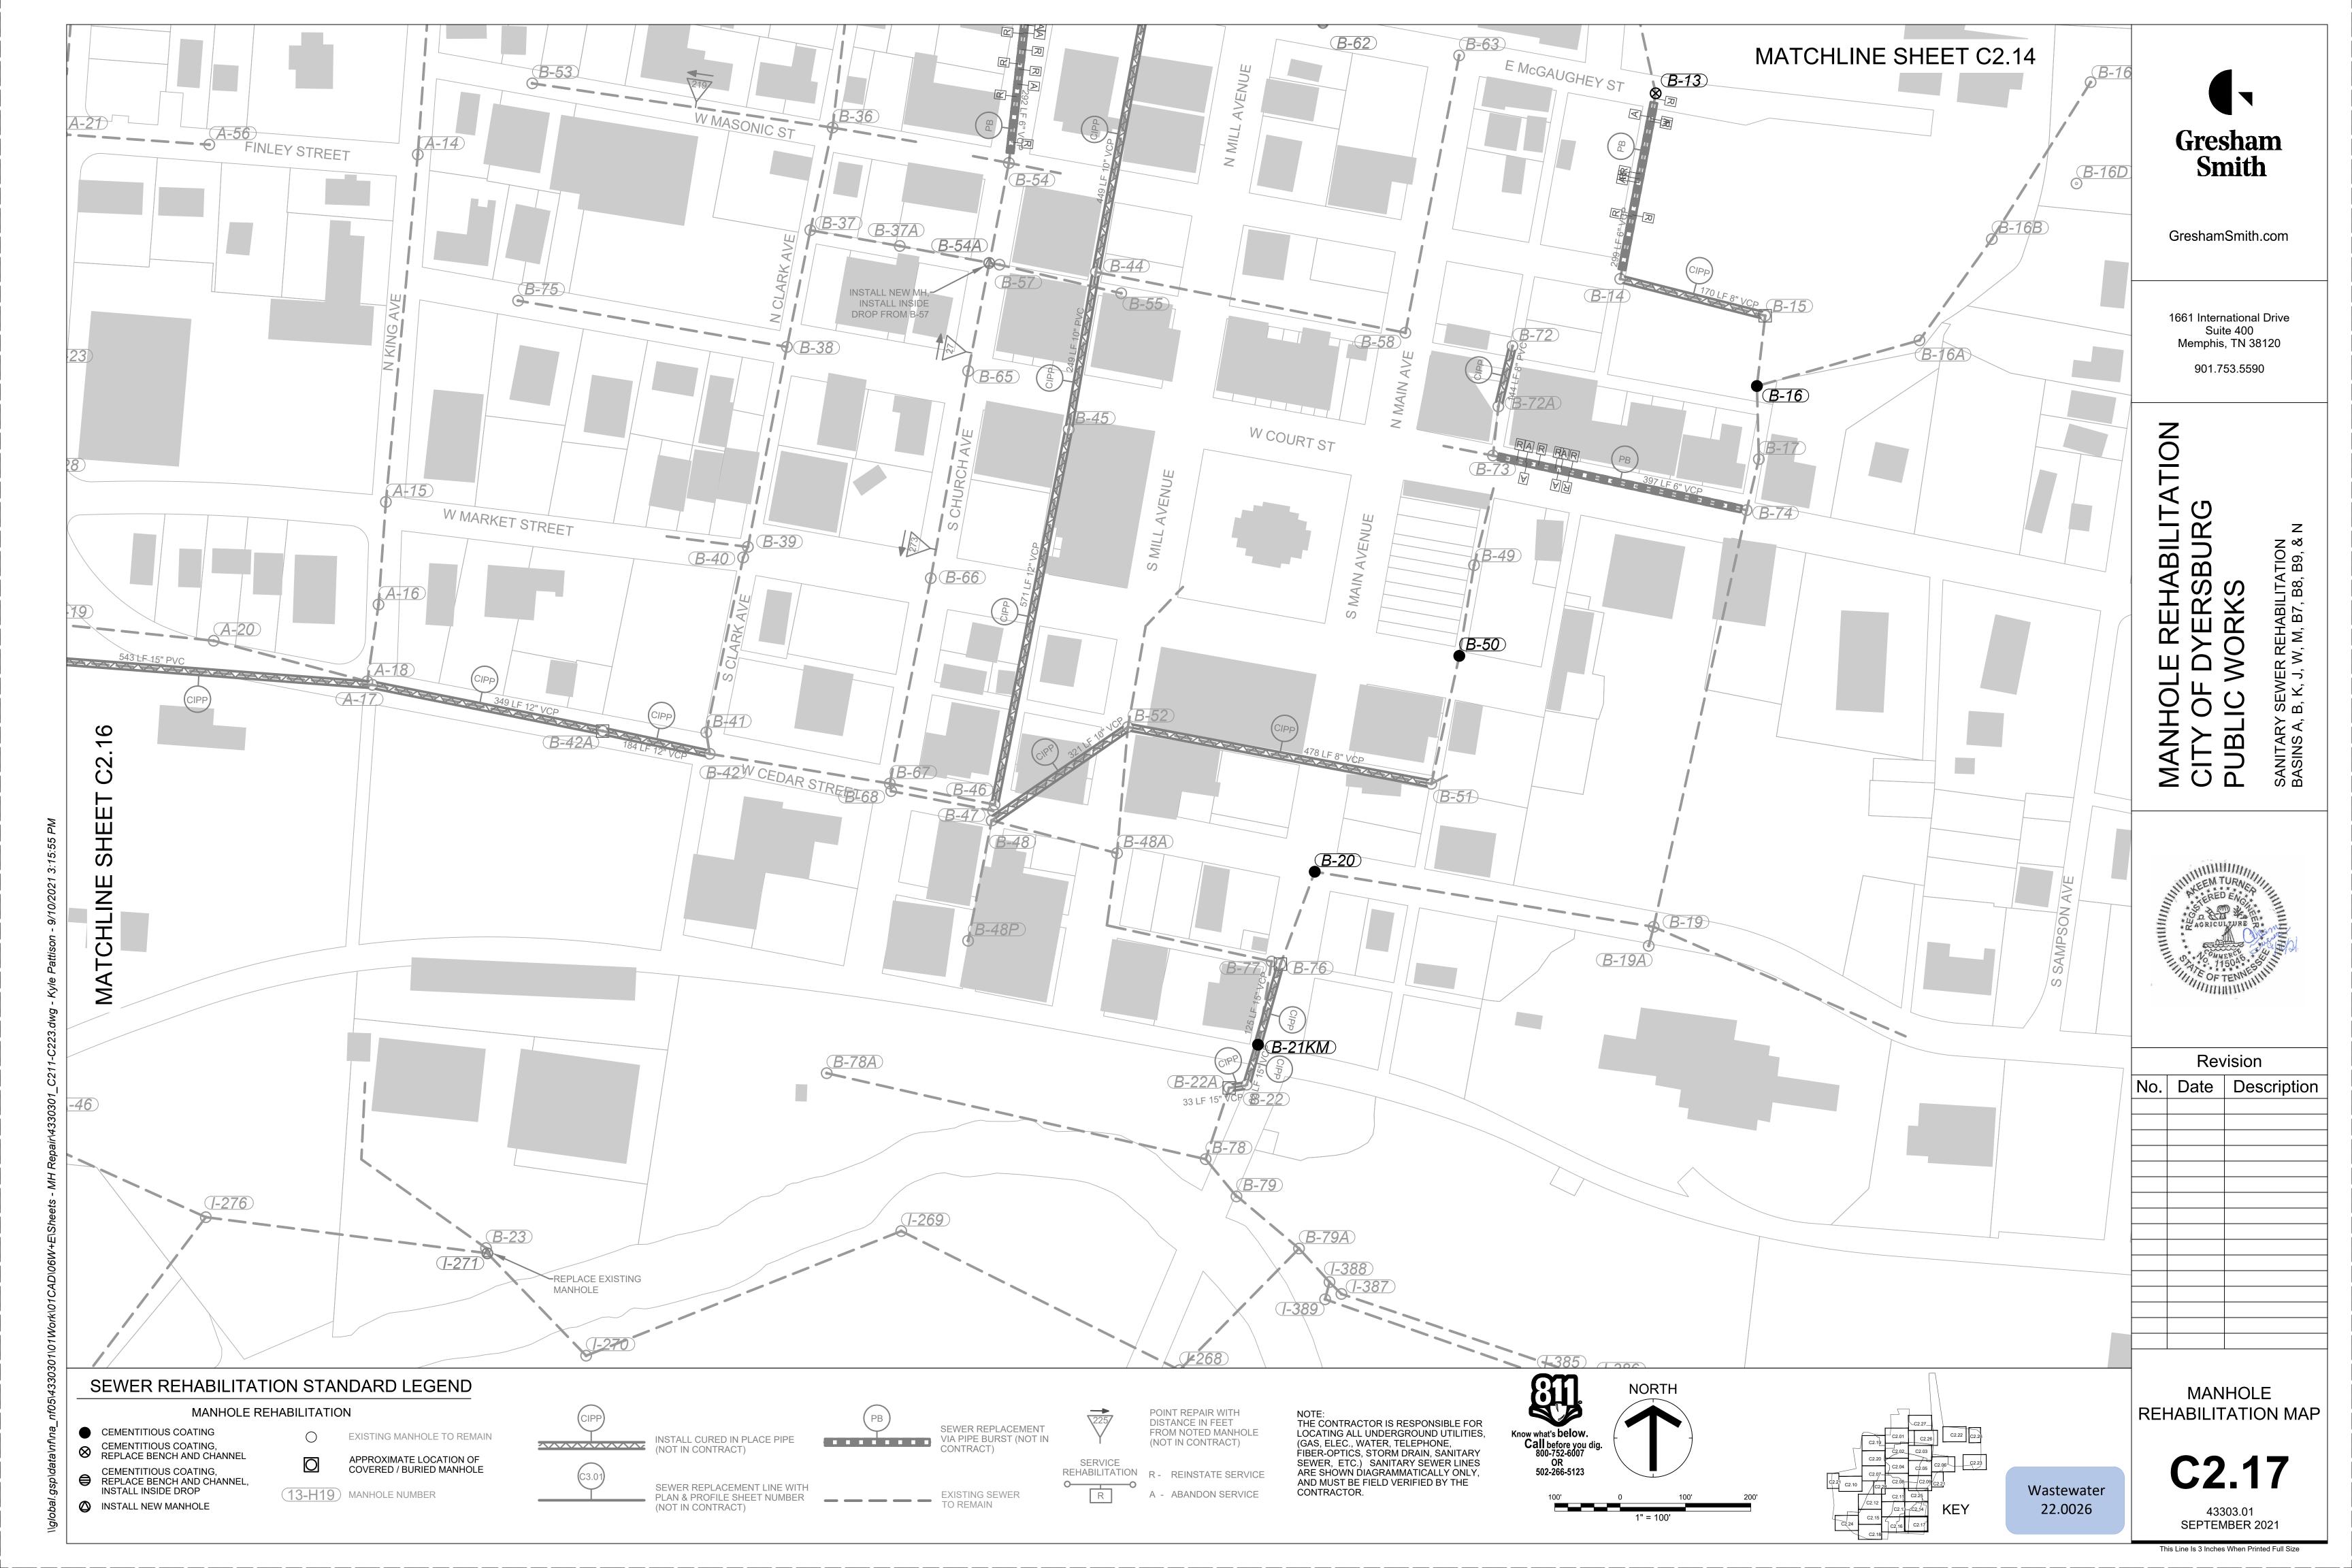



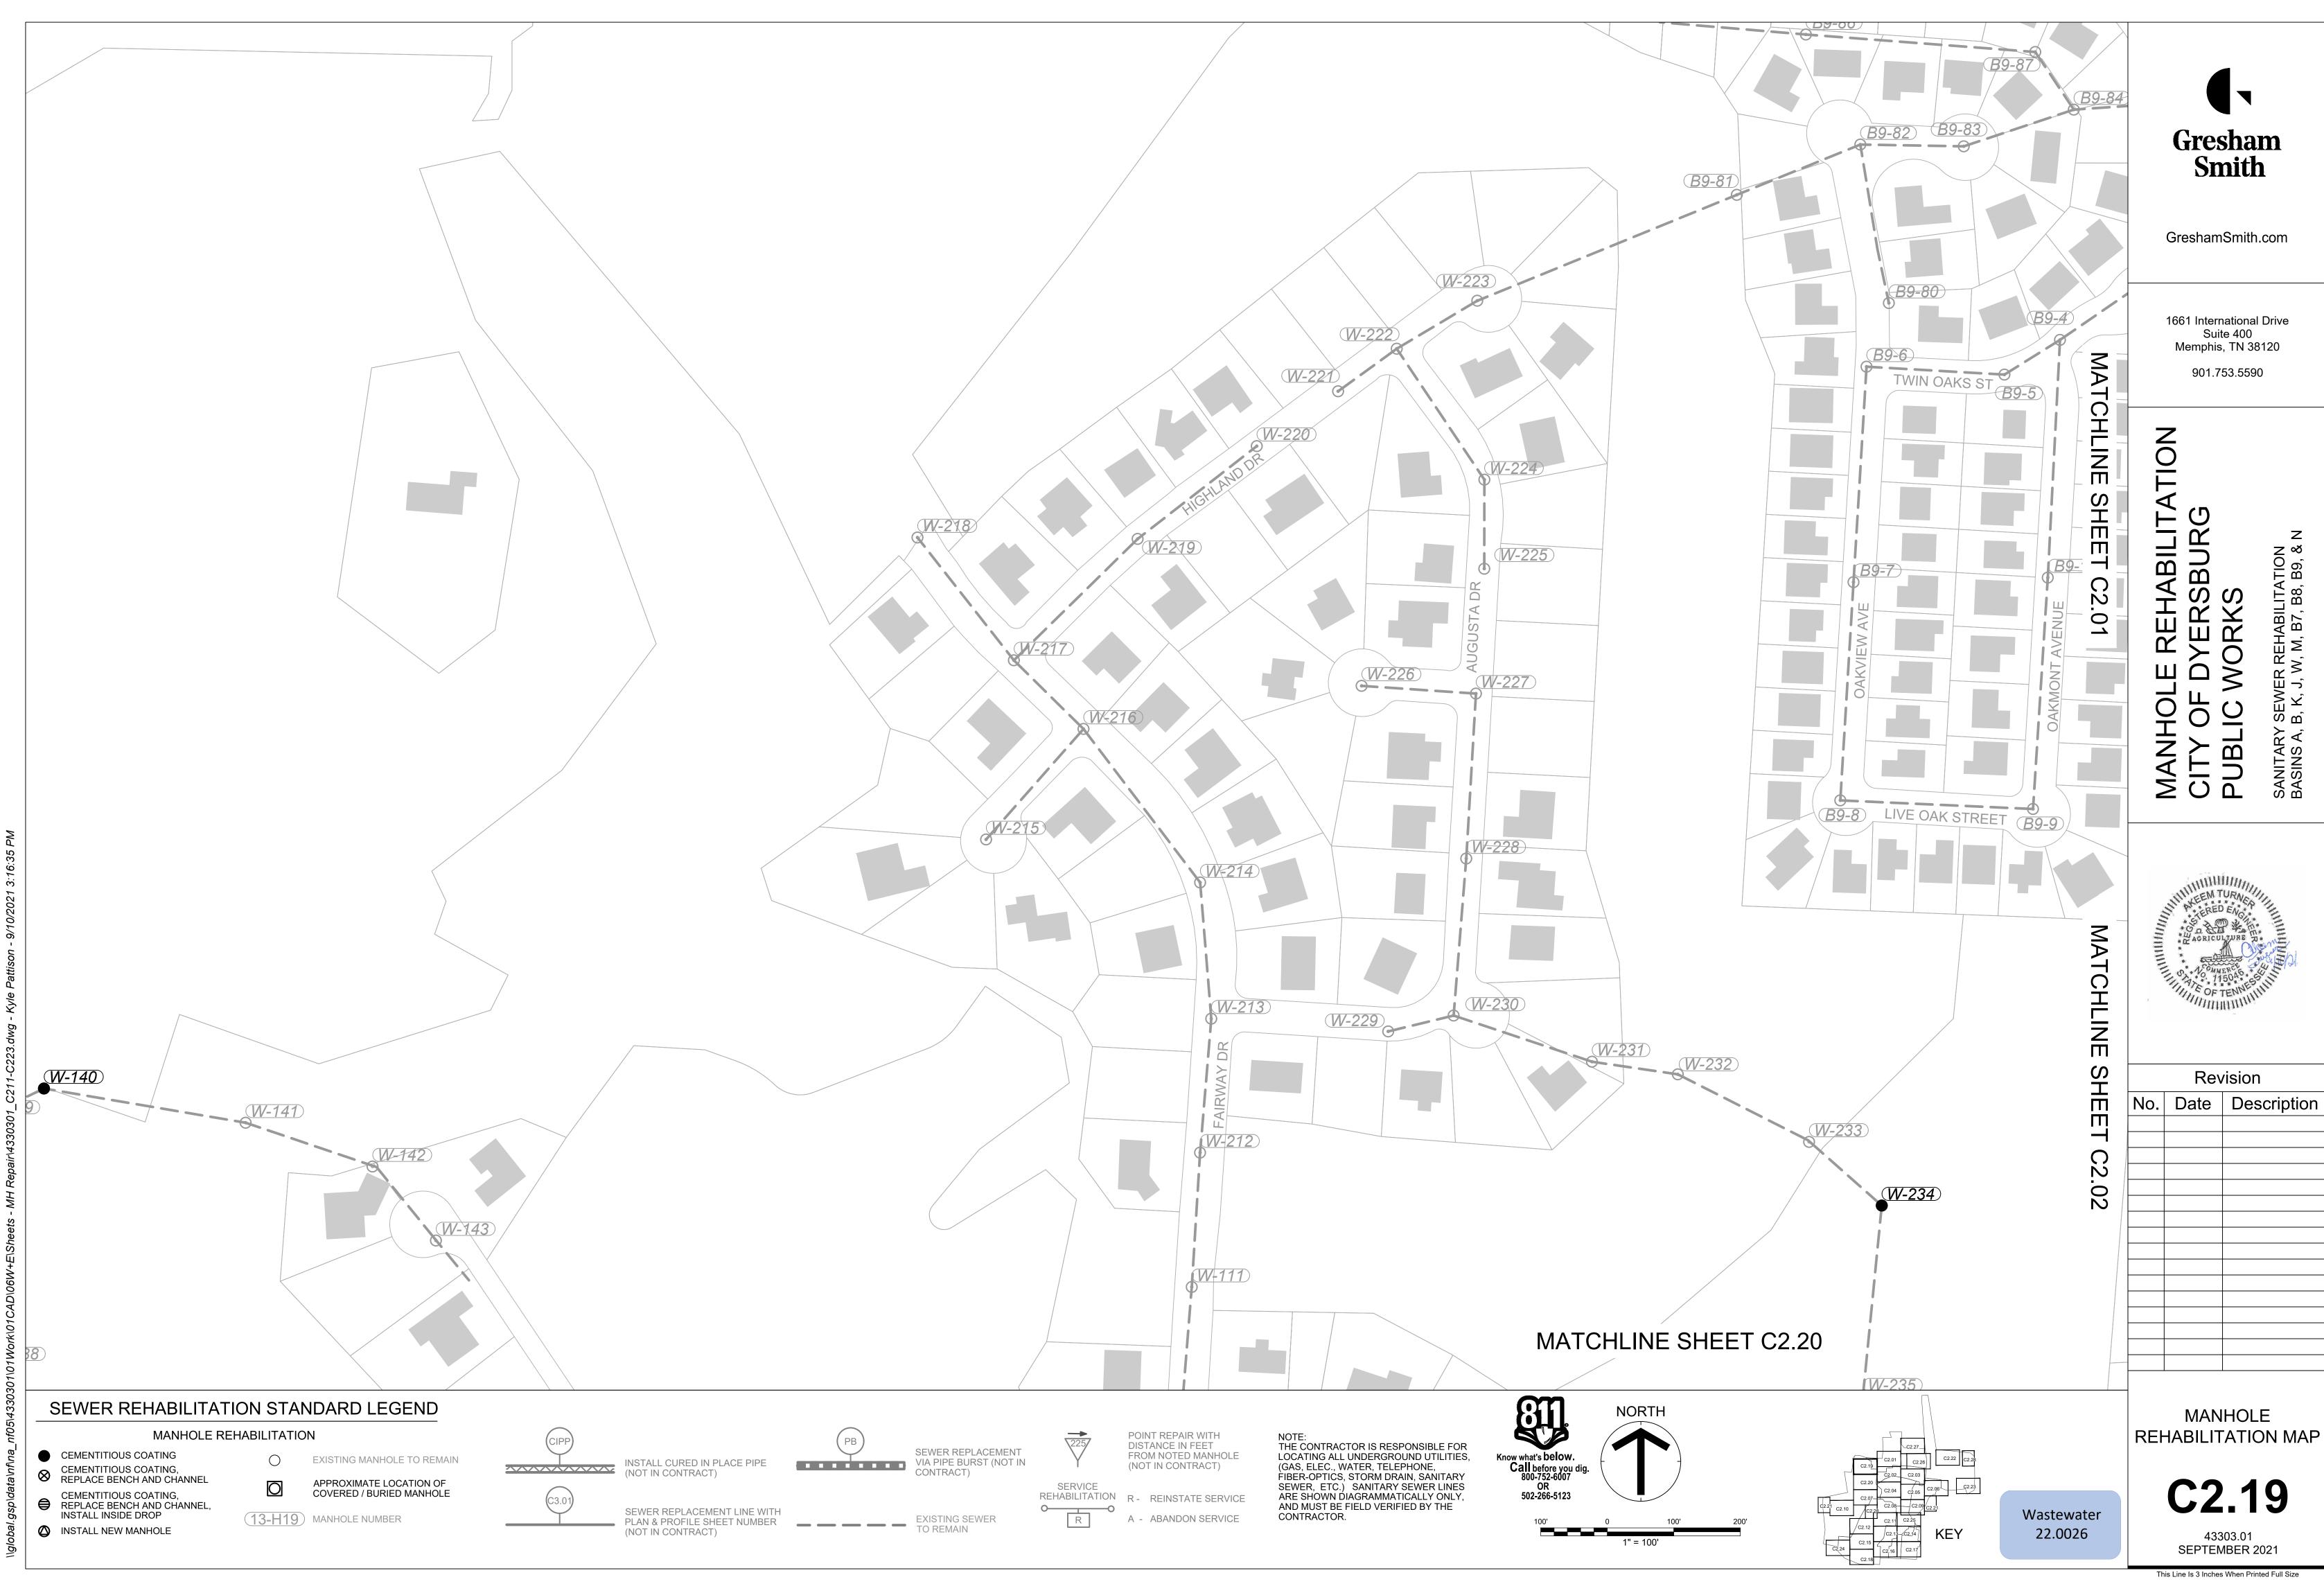

GreshamSmith.com


1661 International Drive Suite 400 Memphis, TN 38120


901.753.5590


'ER REHABILITATION J, W, M, B7, B8, B9, & N **PUBLIC**

C2.19

43303.01 SEPTEMBER 2021

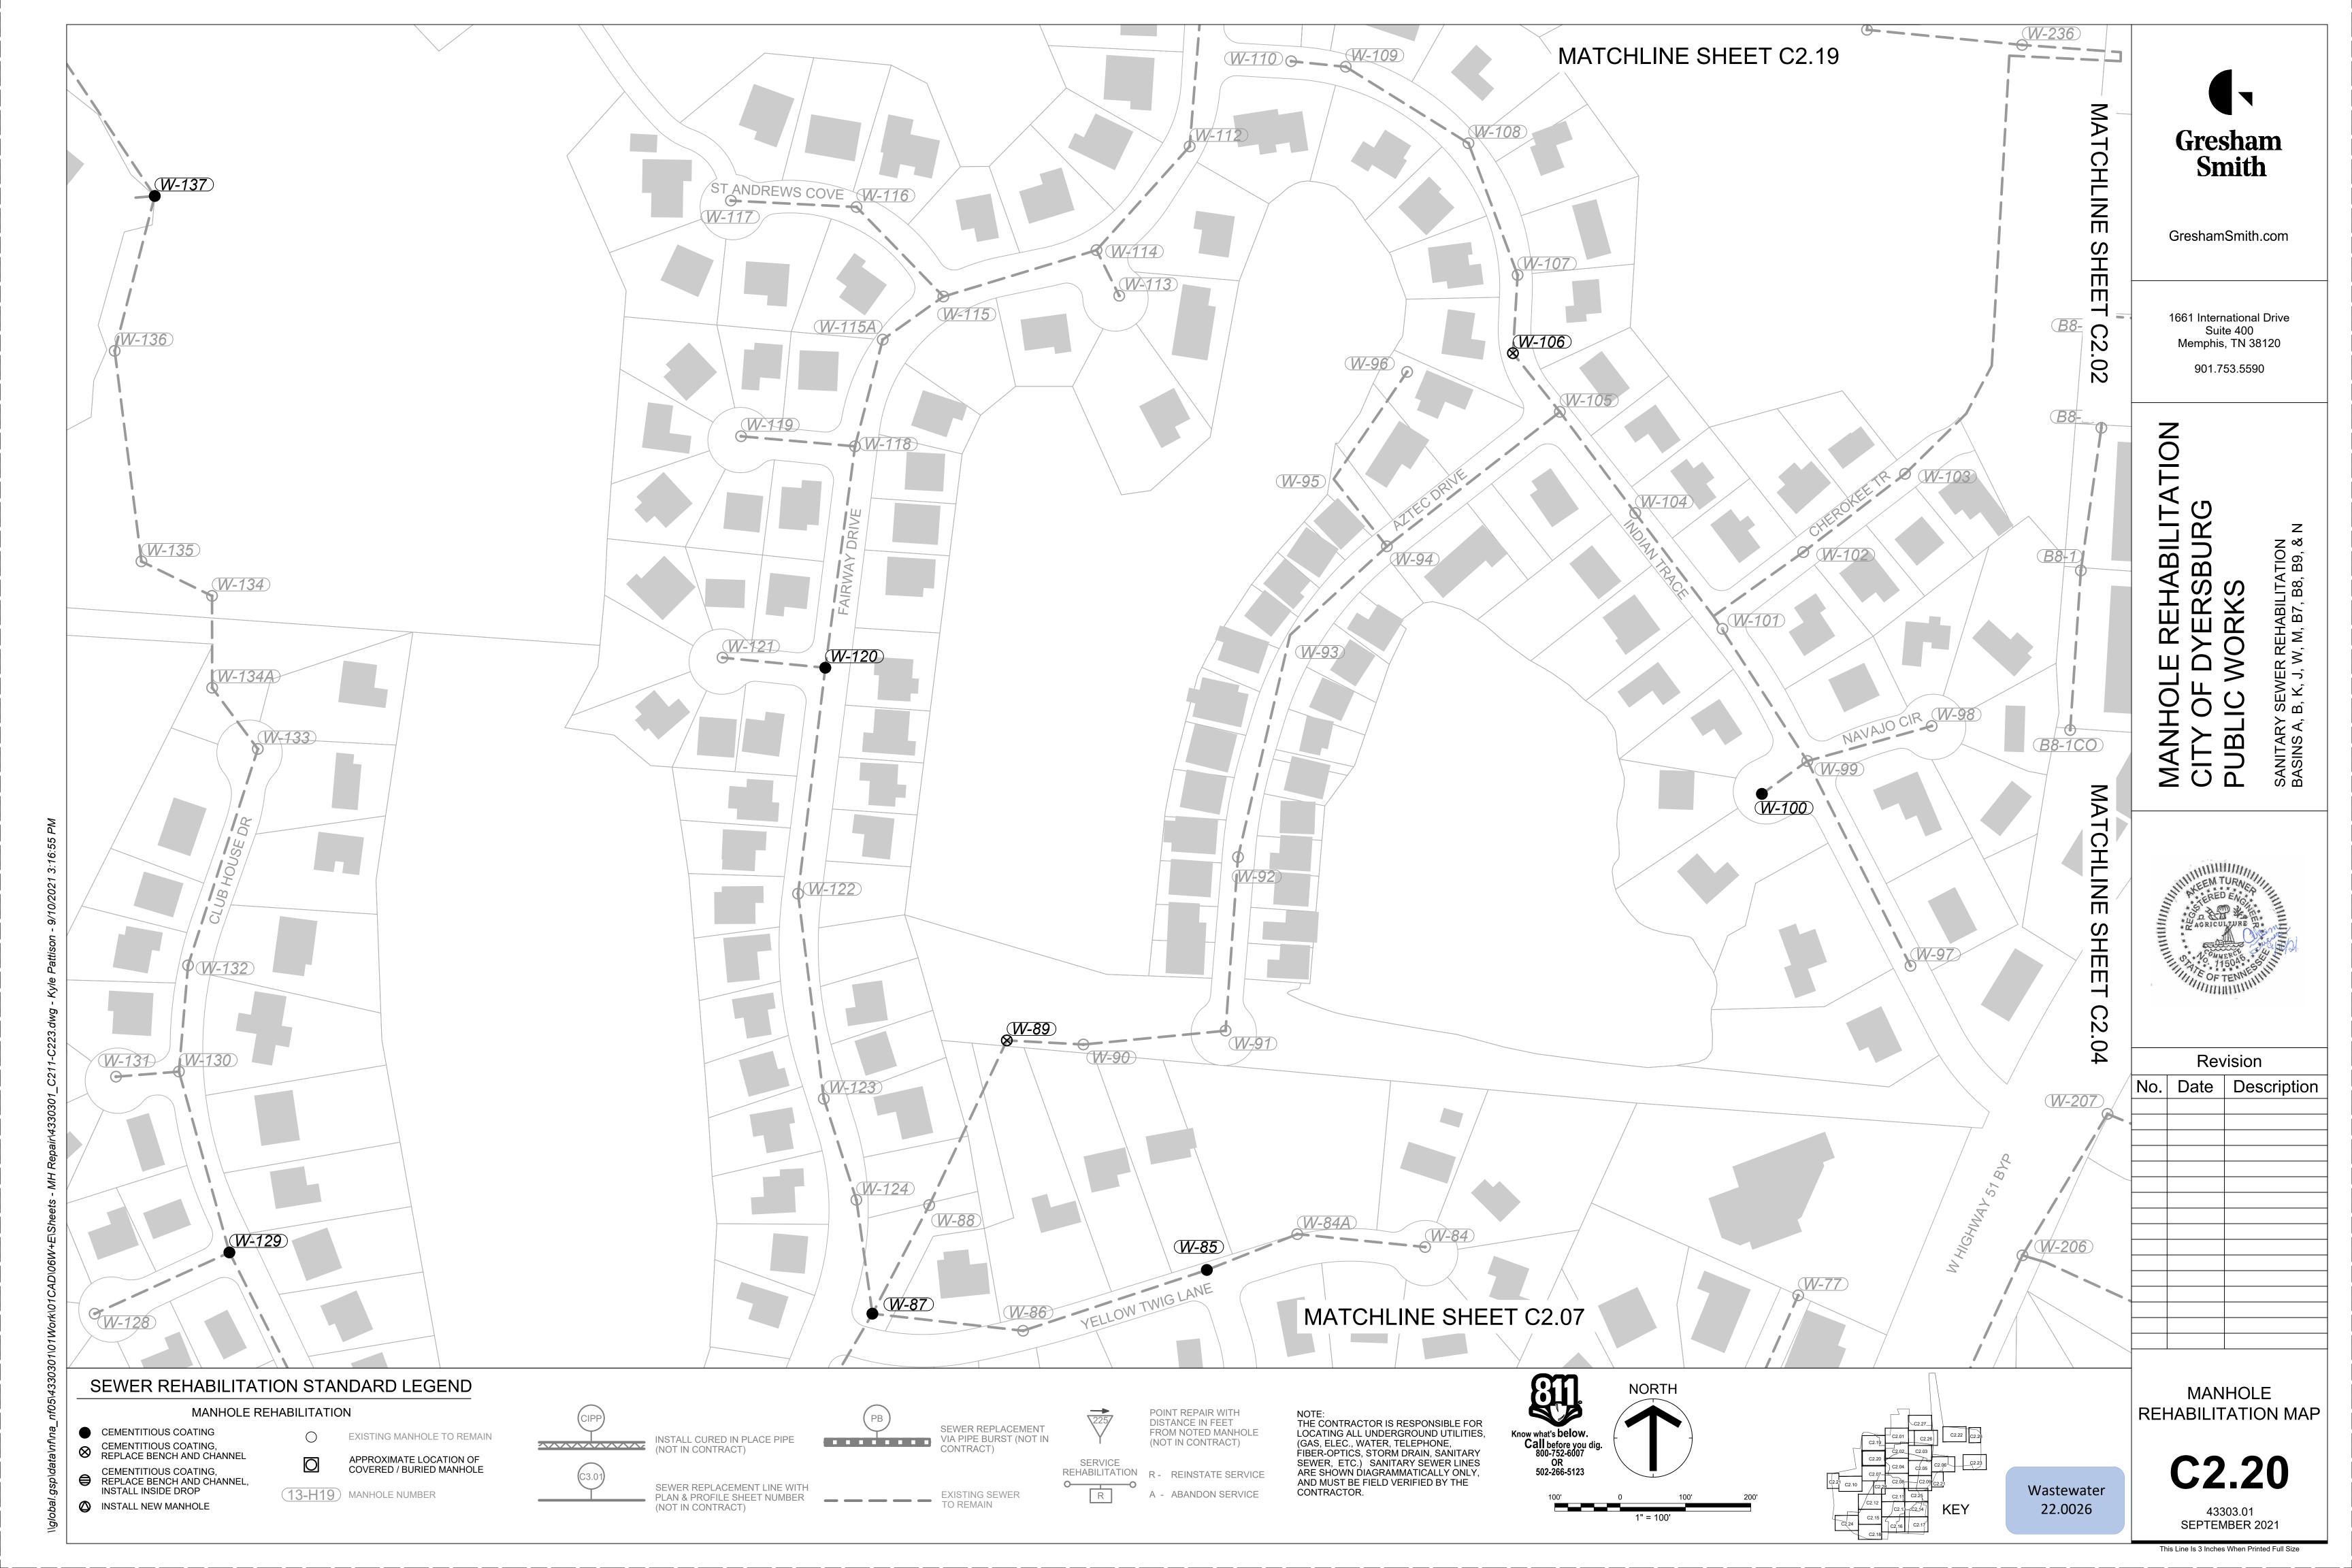


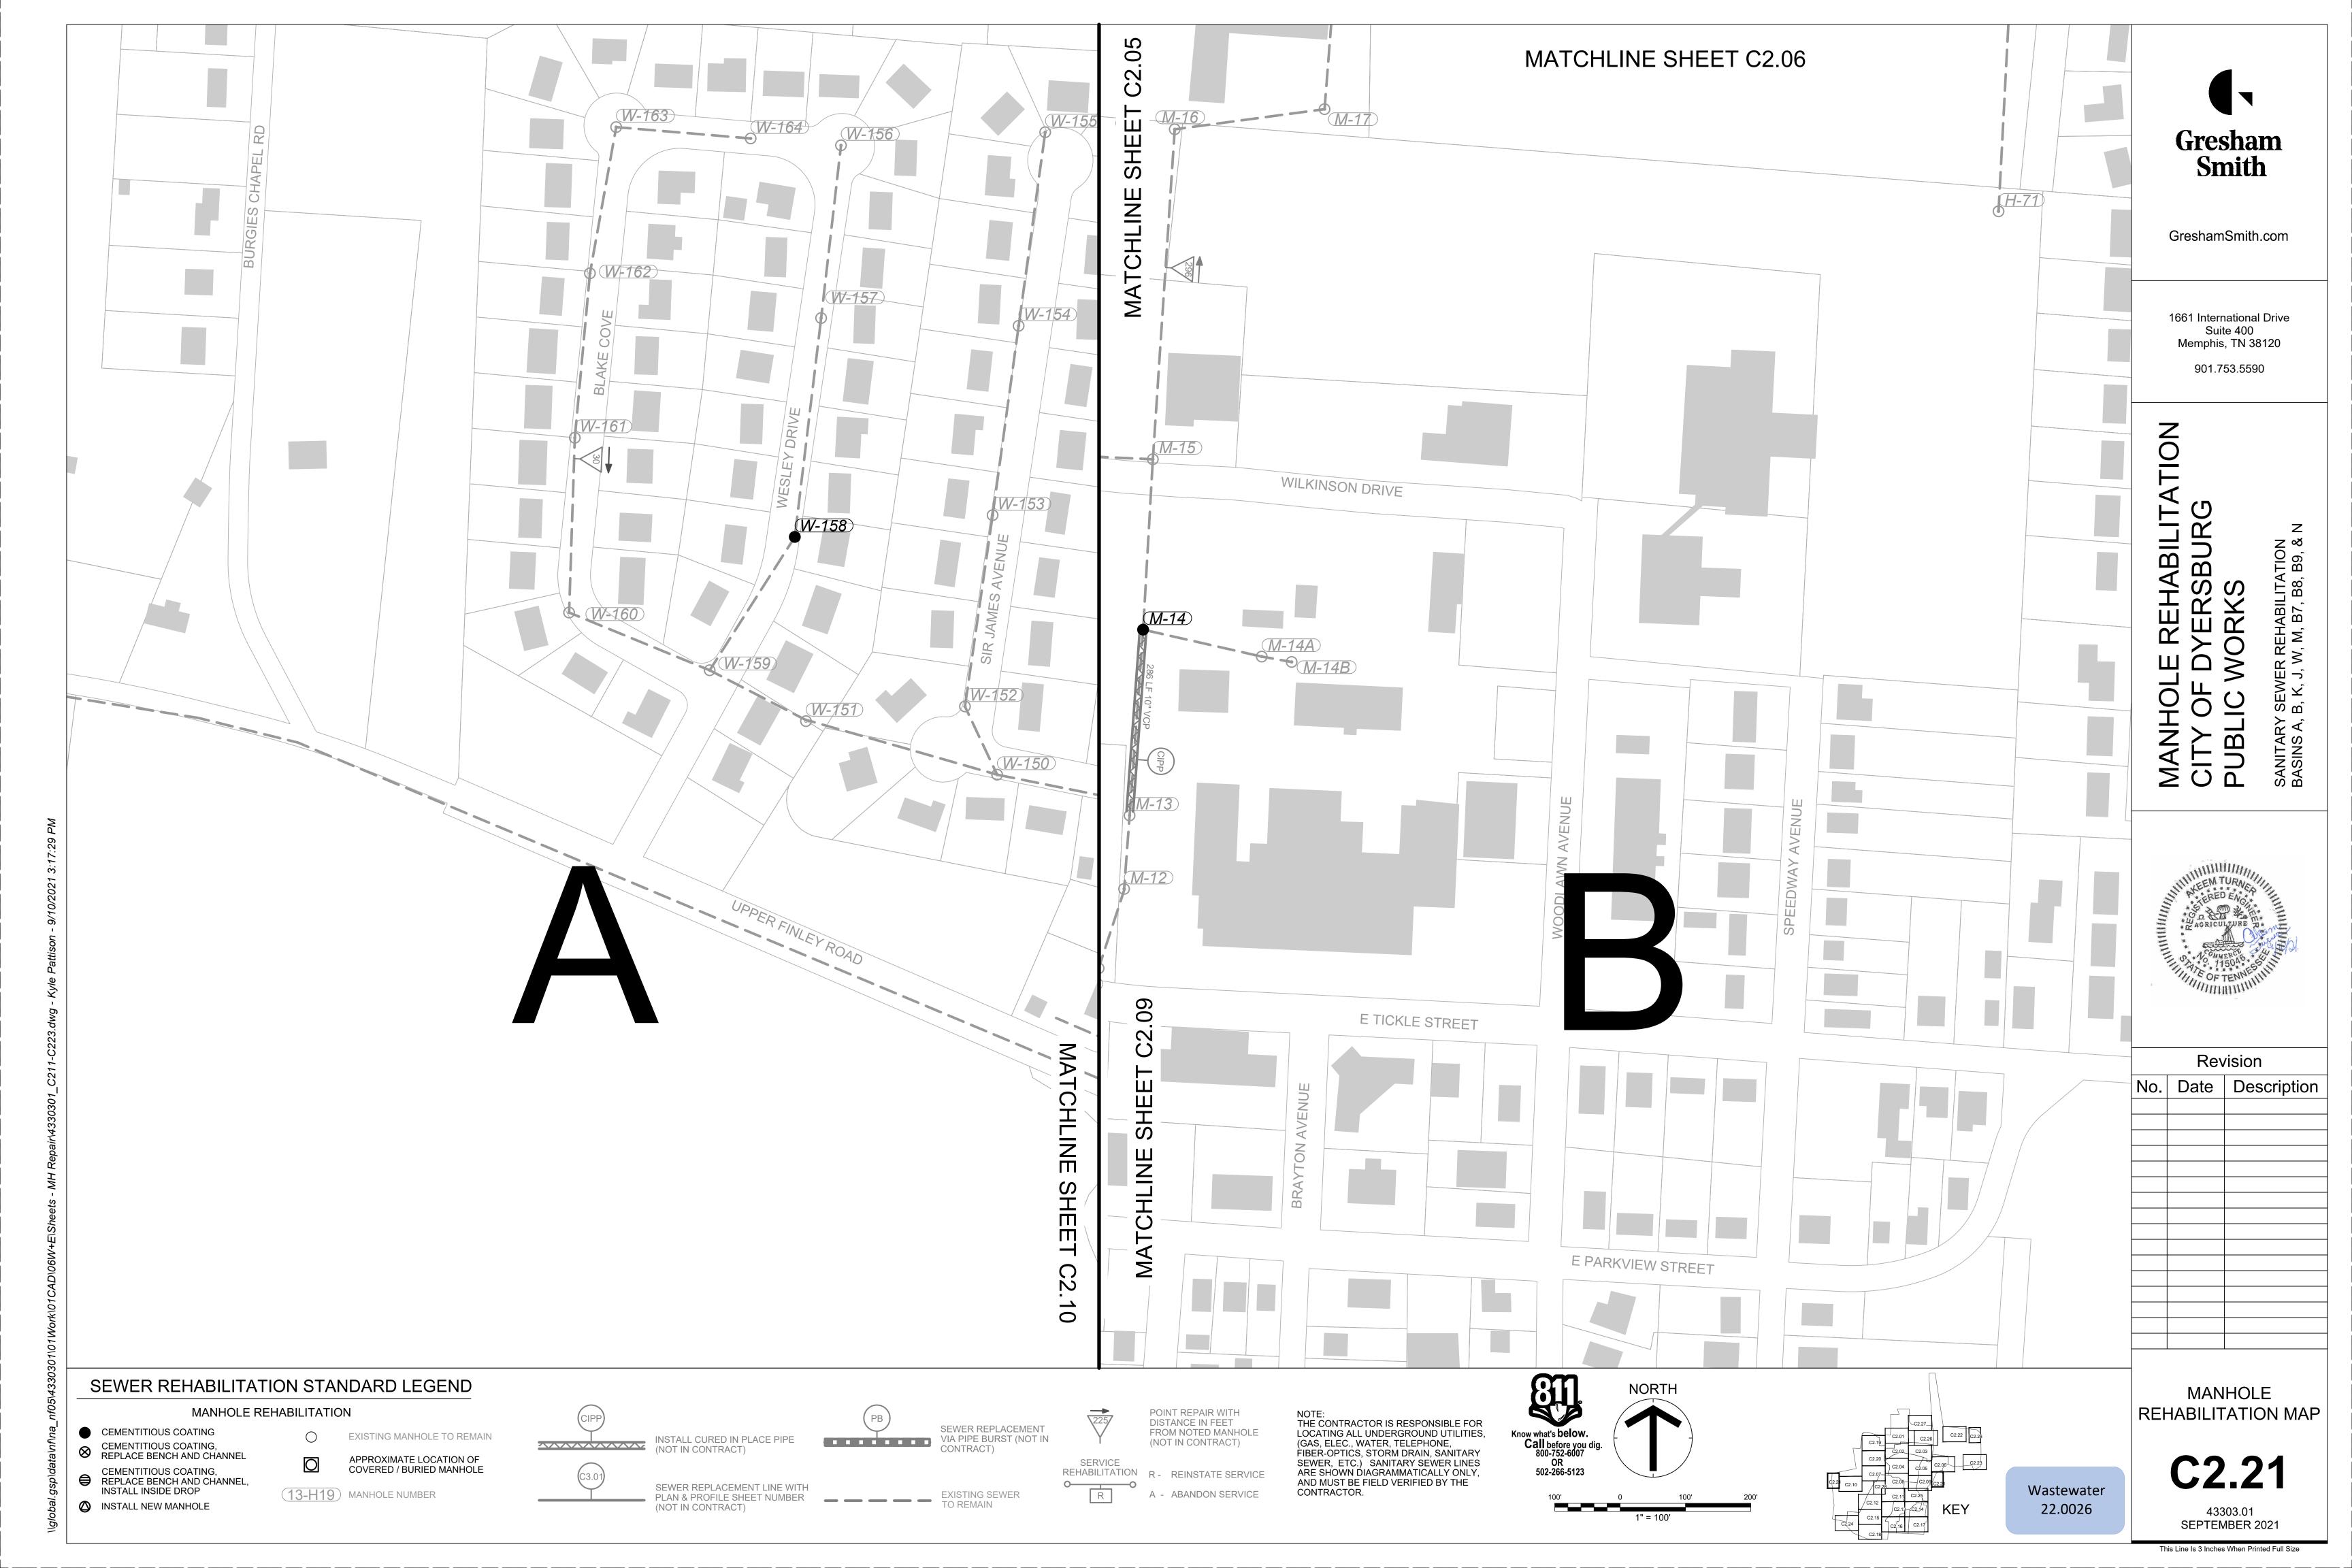

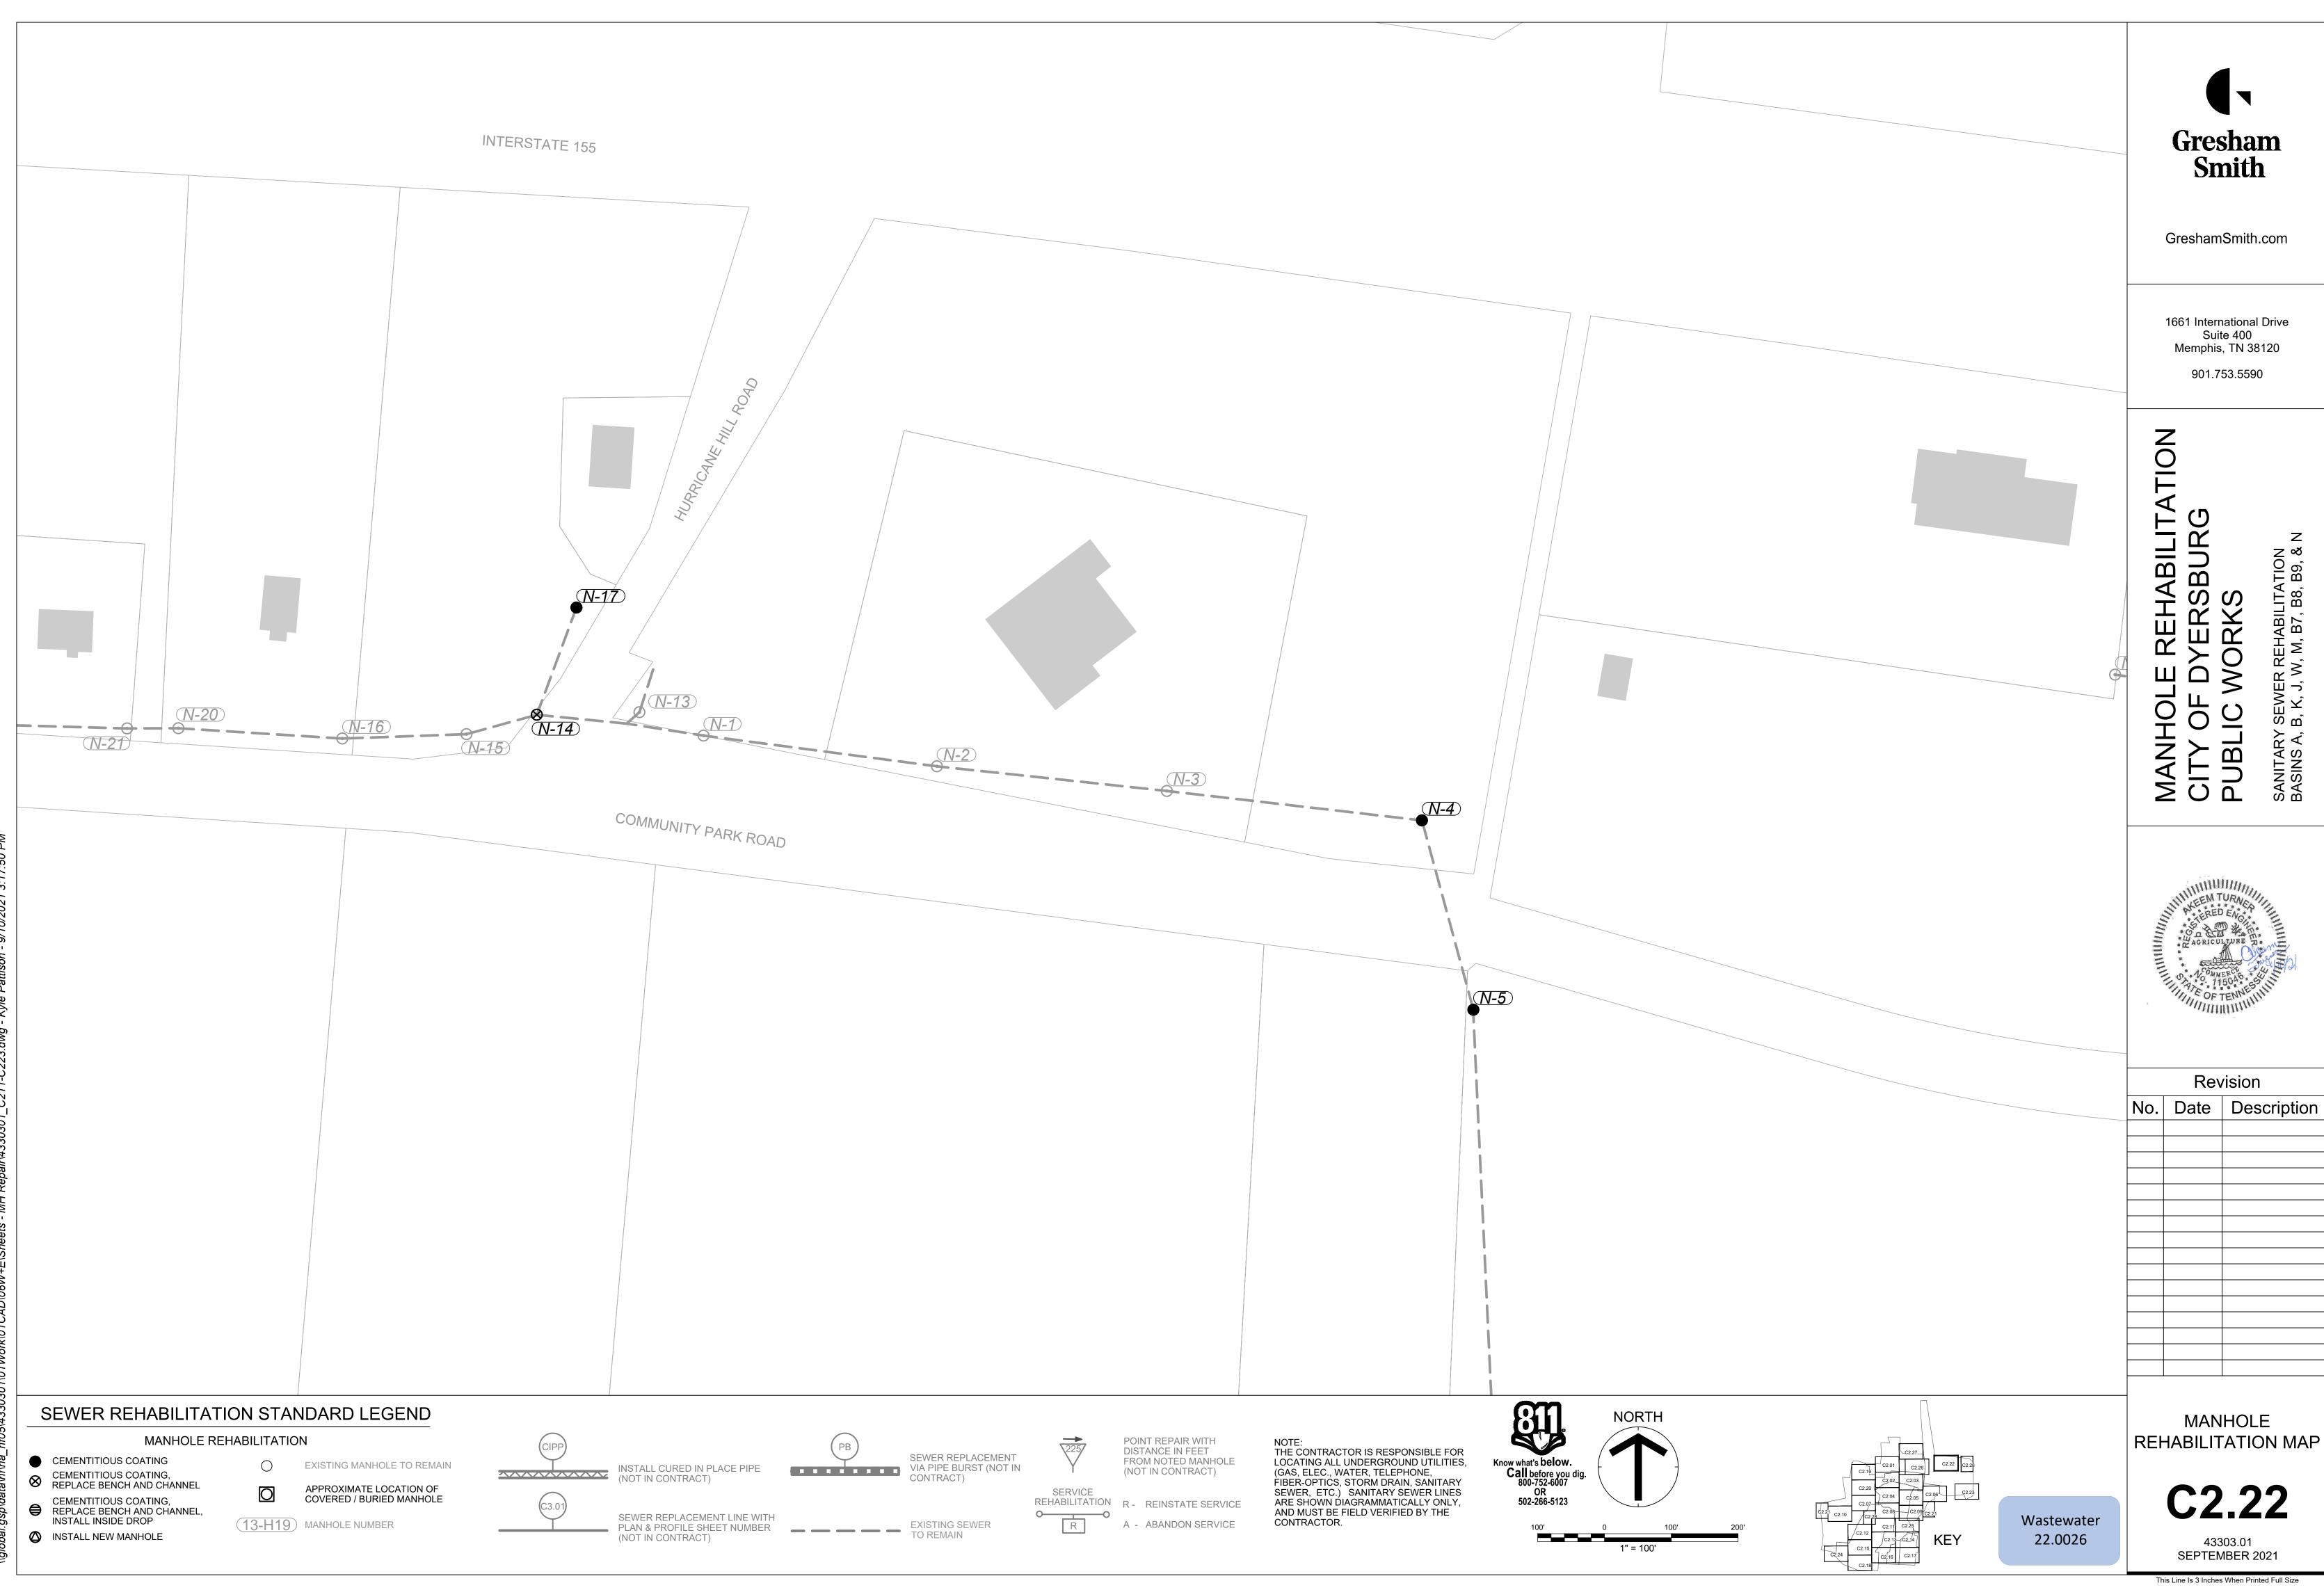

1661 International Drive Suite 400 Memphis, TN 38120


SANITARY SEWER REHABILITATION BASINS A, B, K, J, W, M, B7, B8, B9, & N

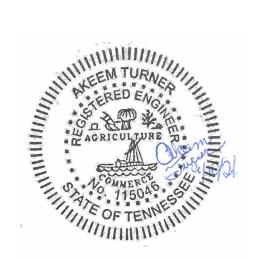

No. Date Description

MANHOLE

C2.22

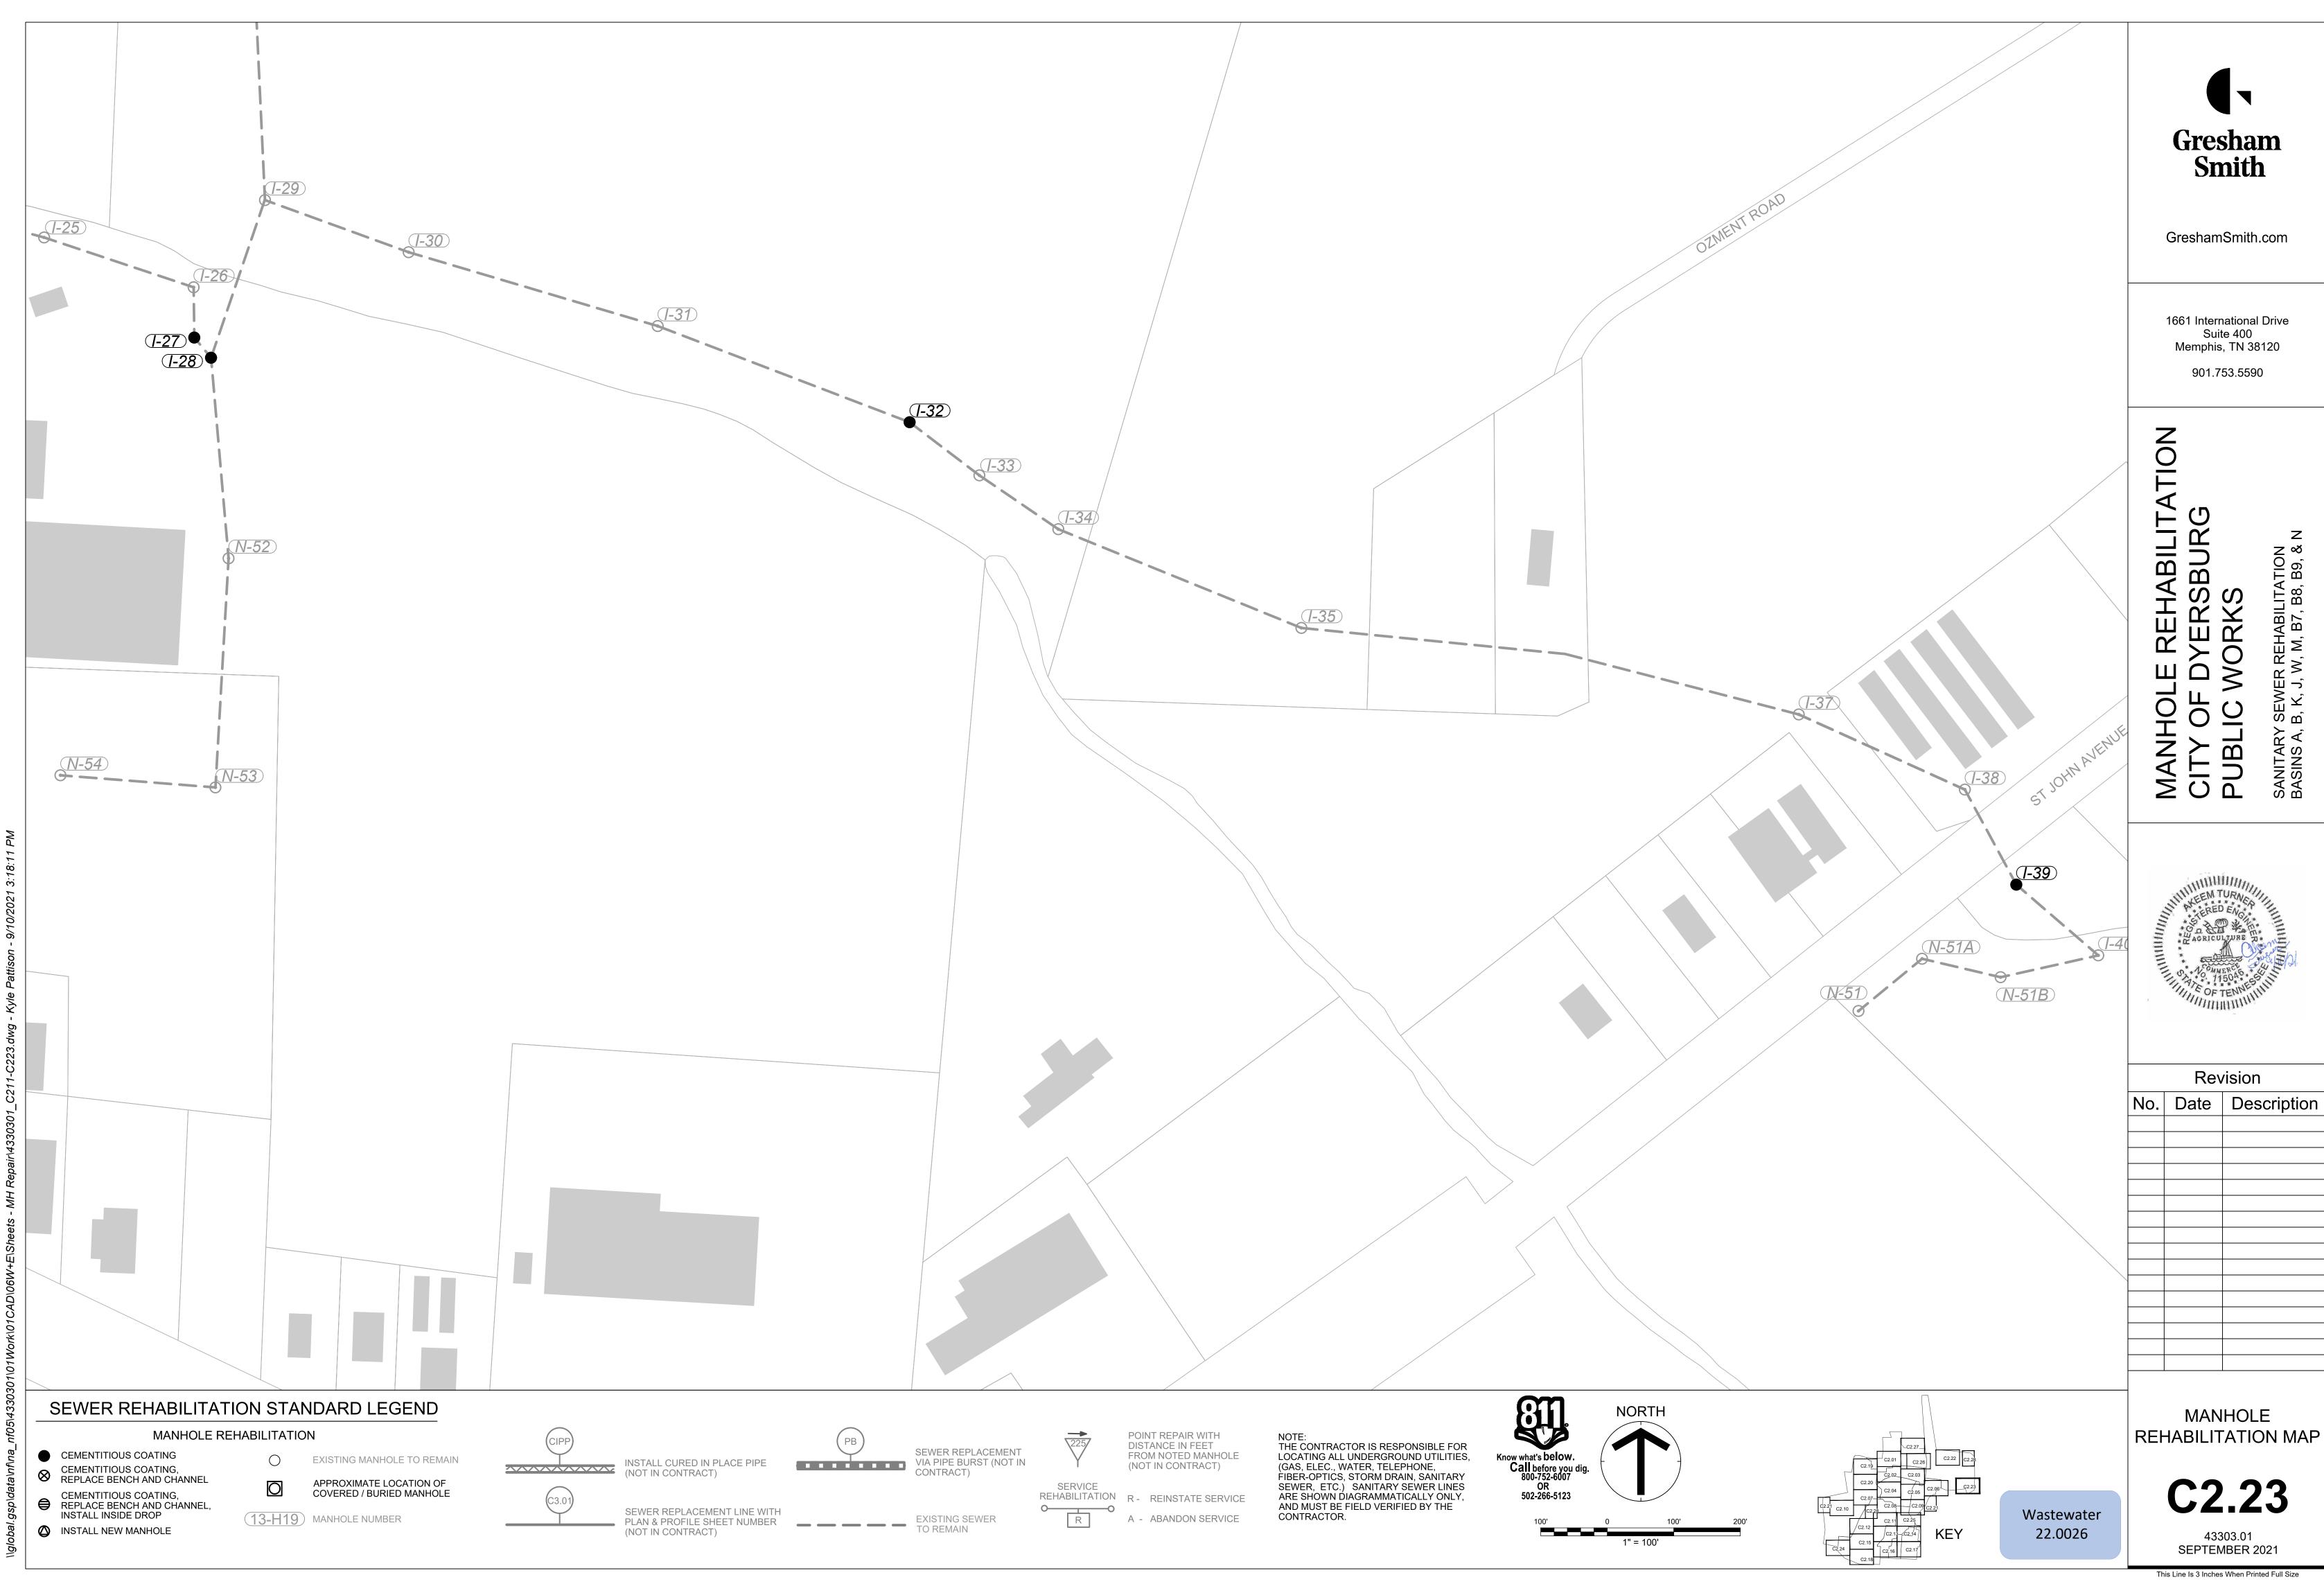


901.753.5590


No. Date Description


MANHOLE


C2.23

SEPTEMBER 2021

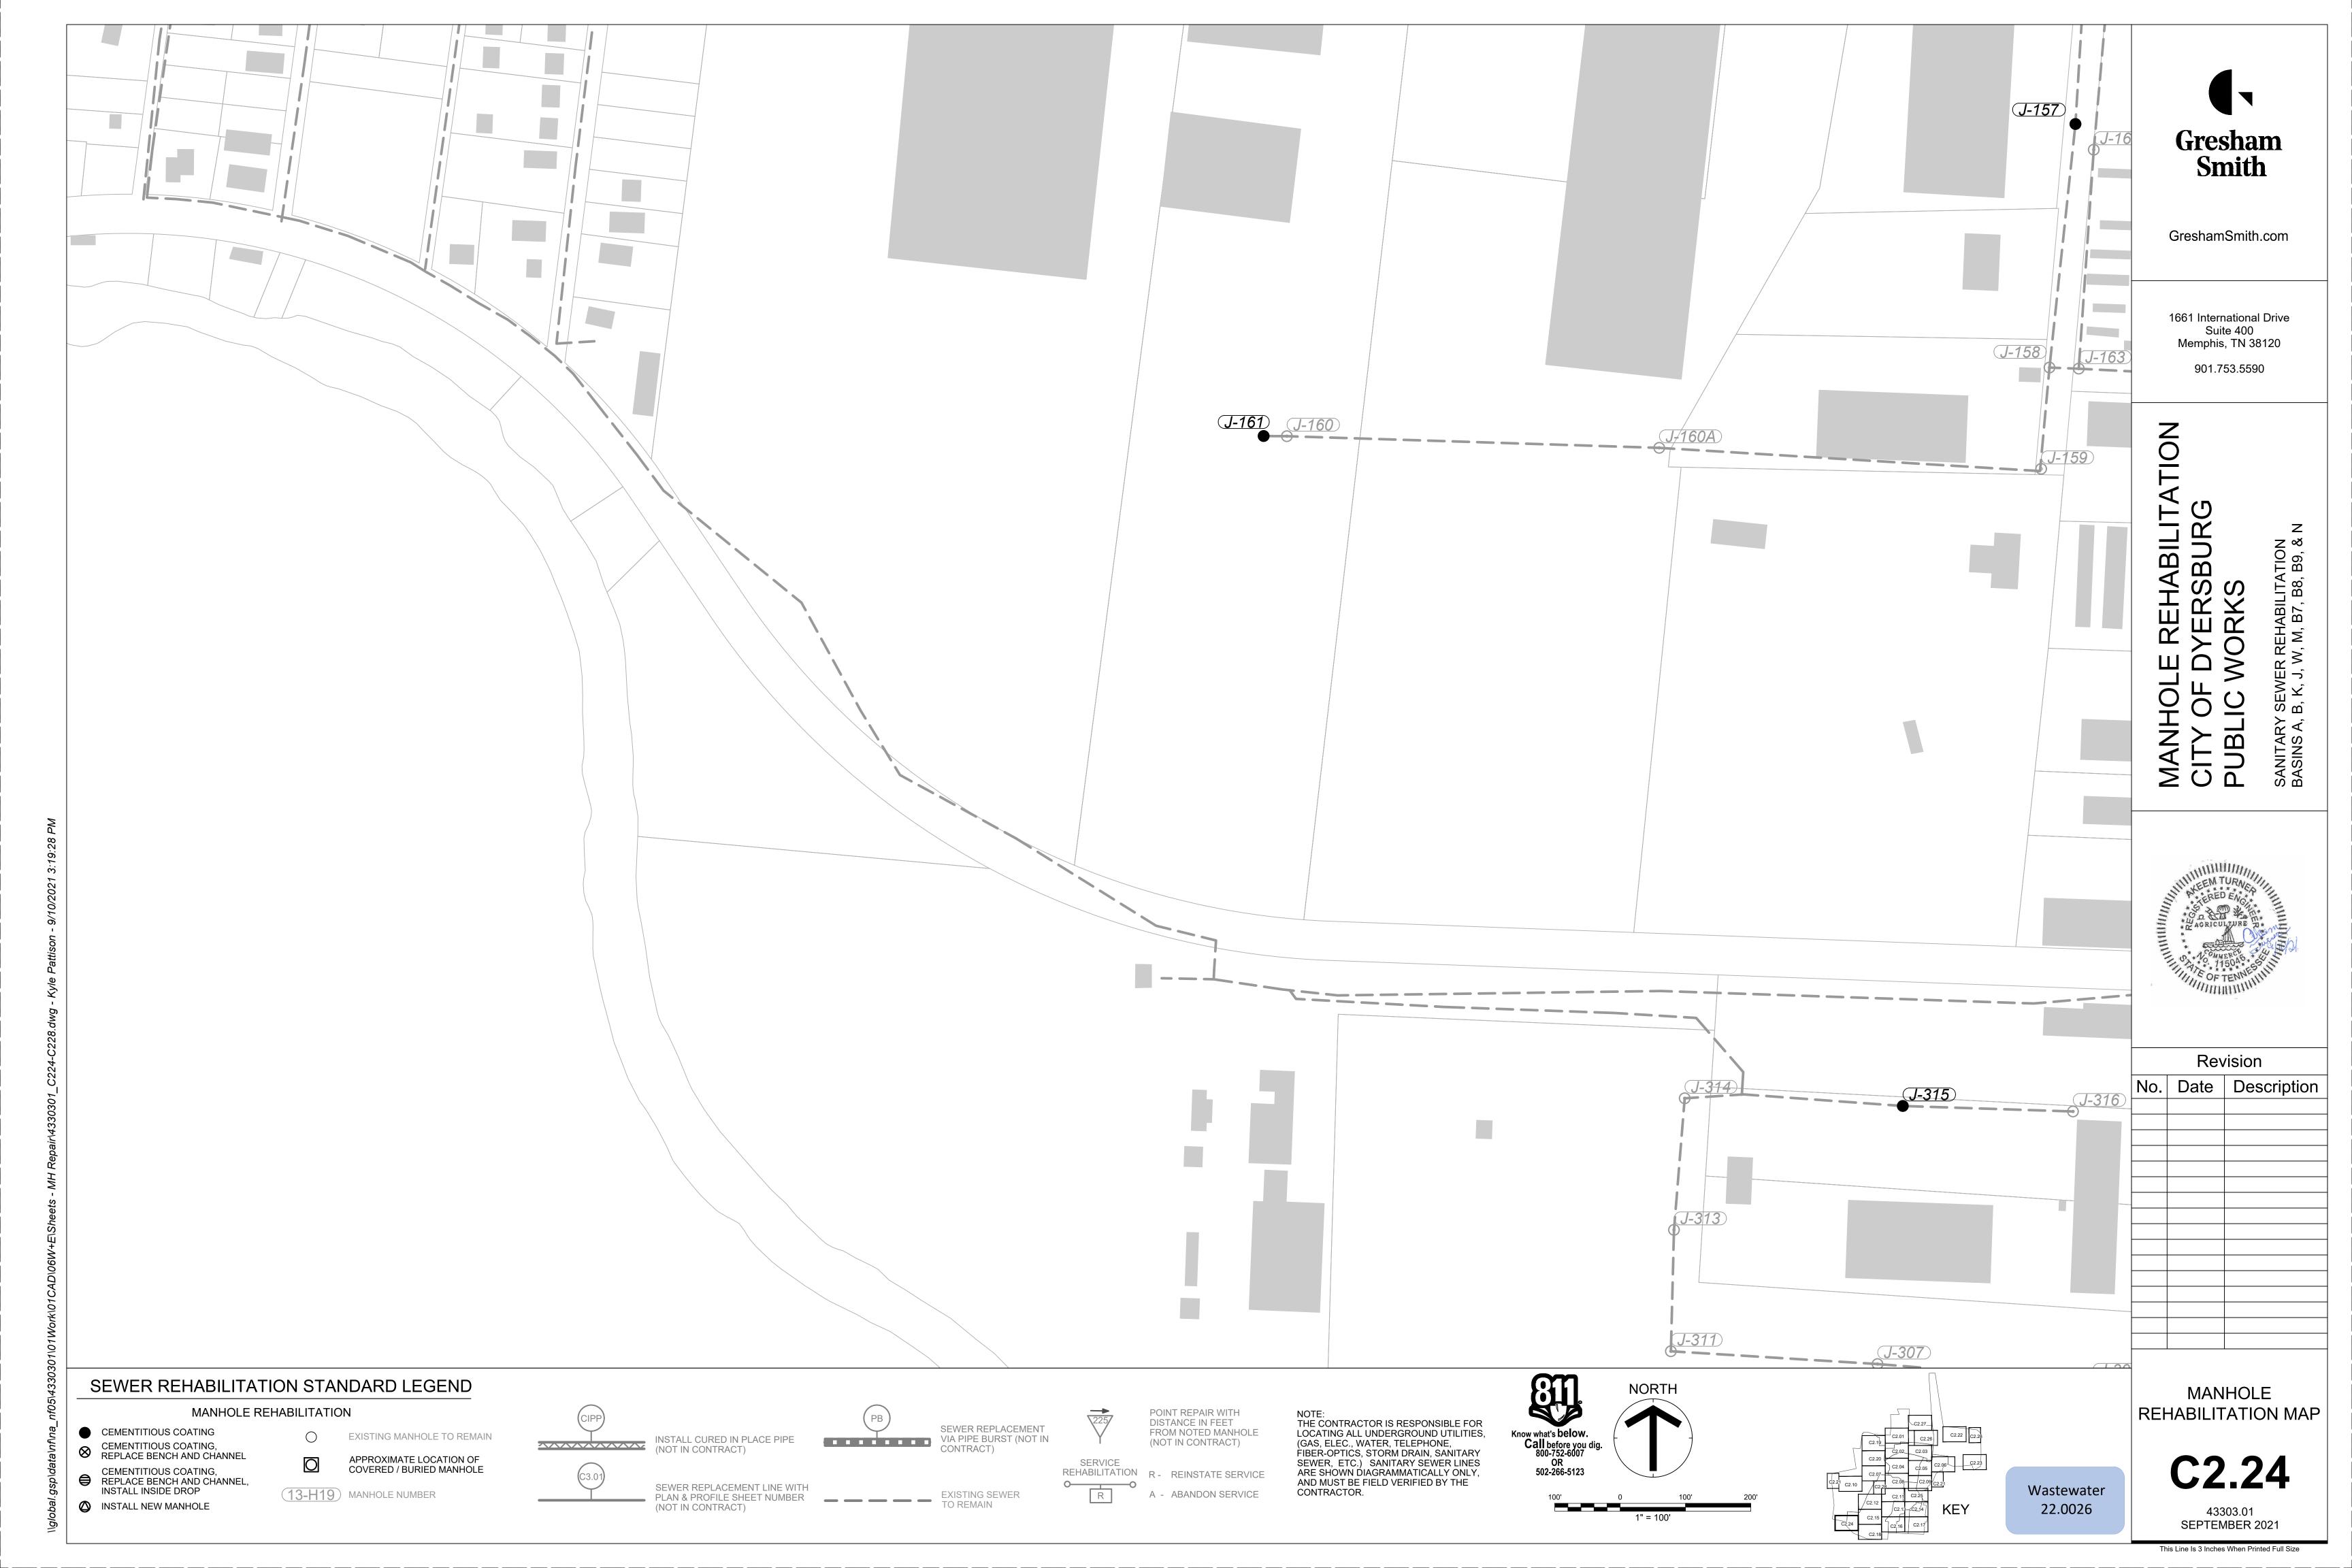

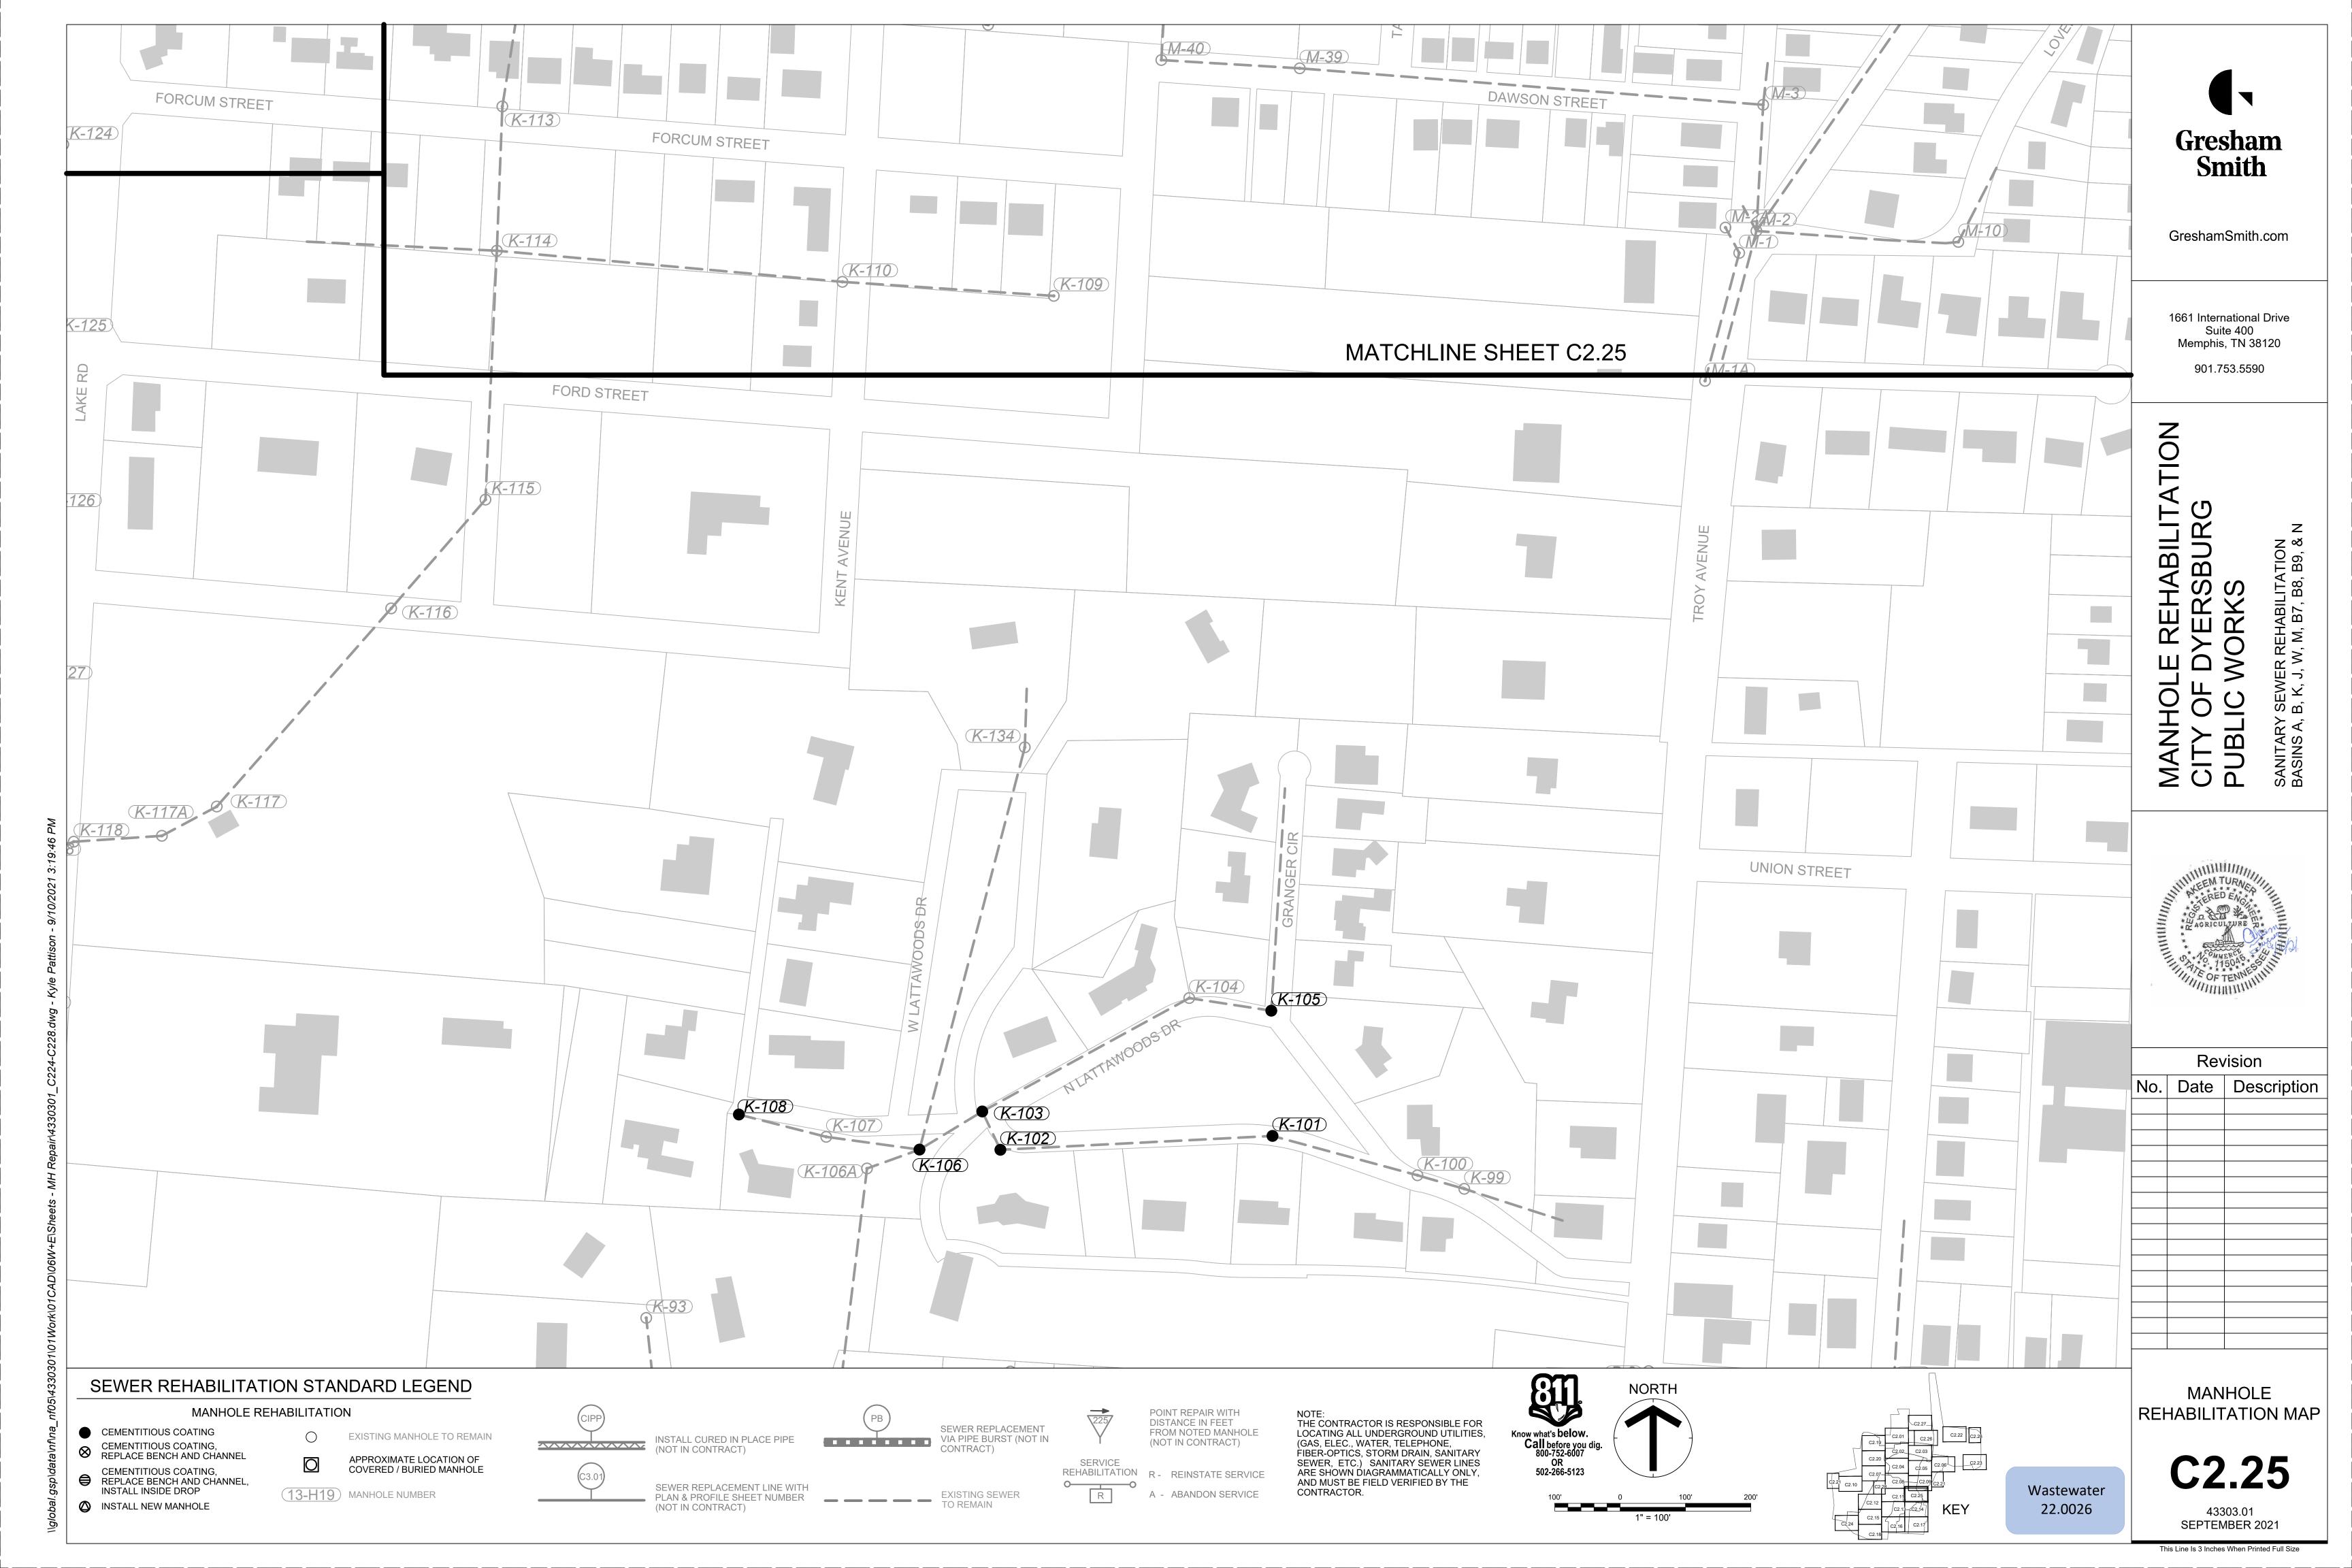

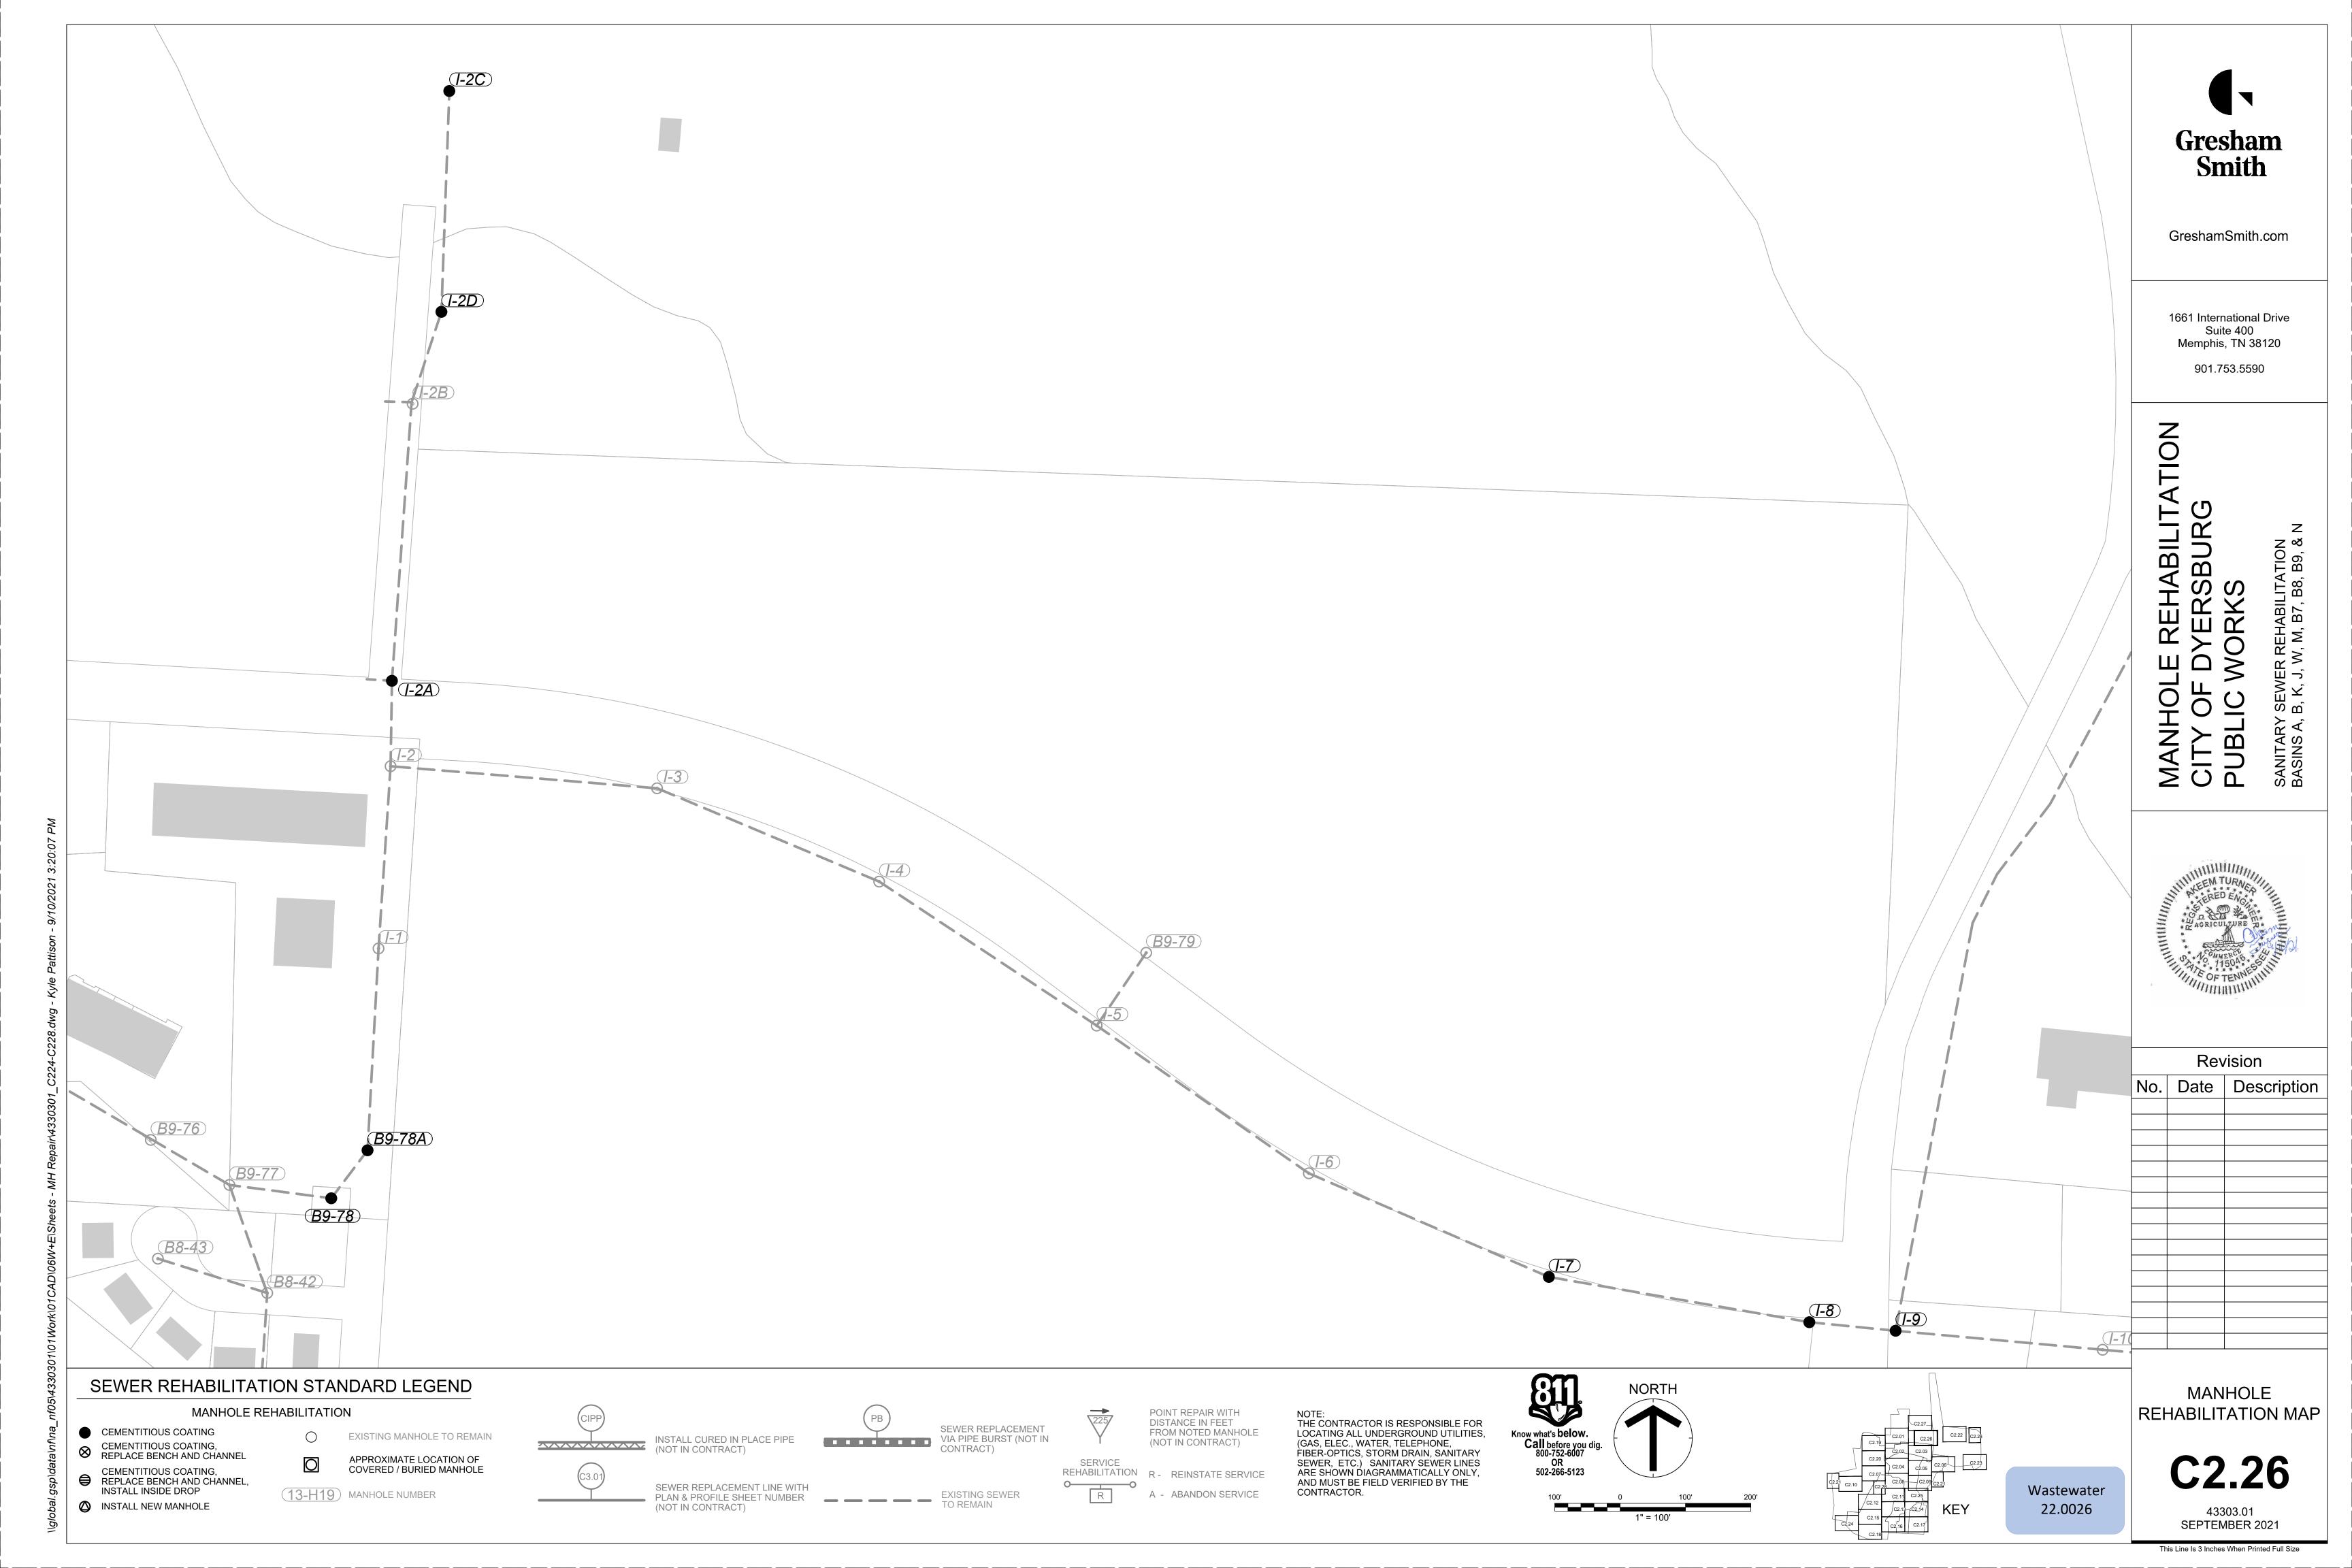

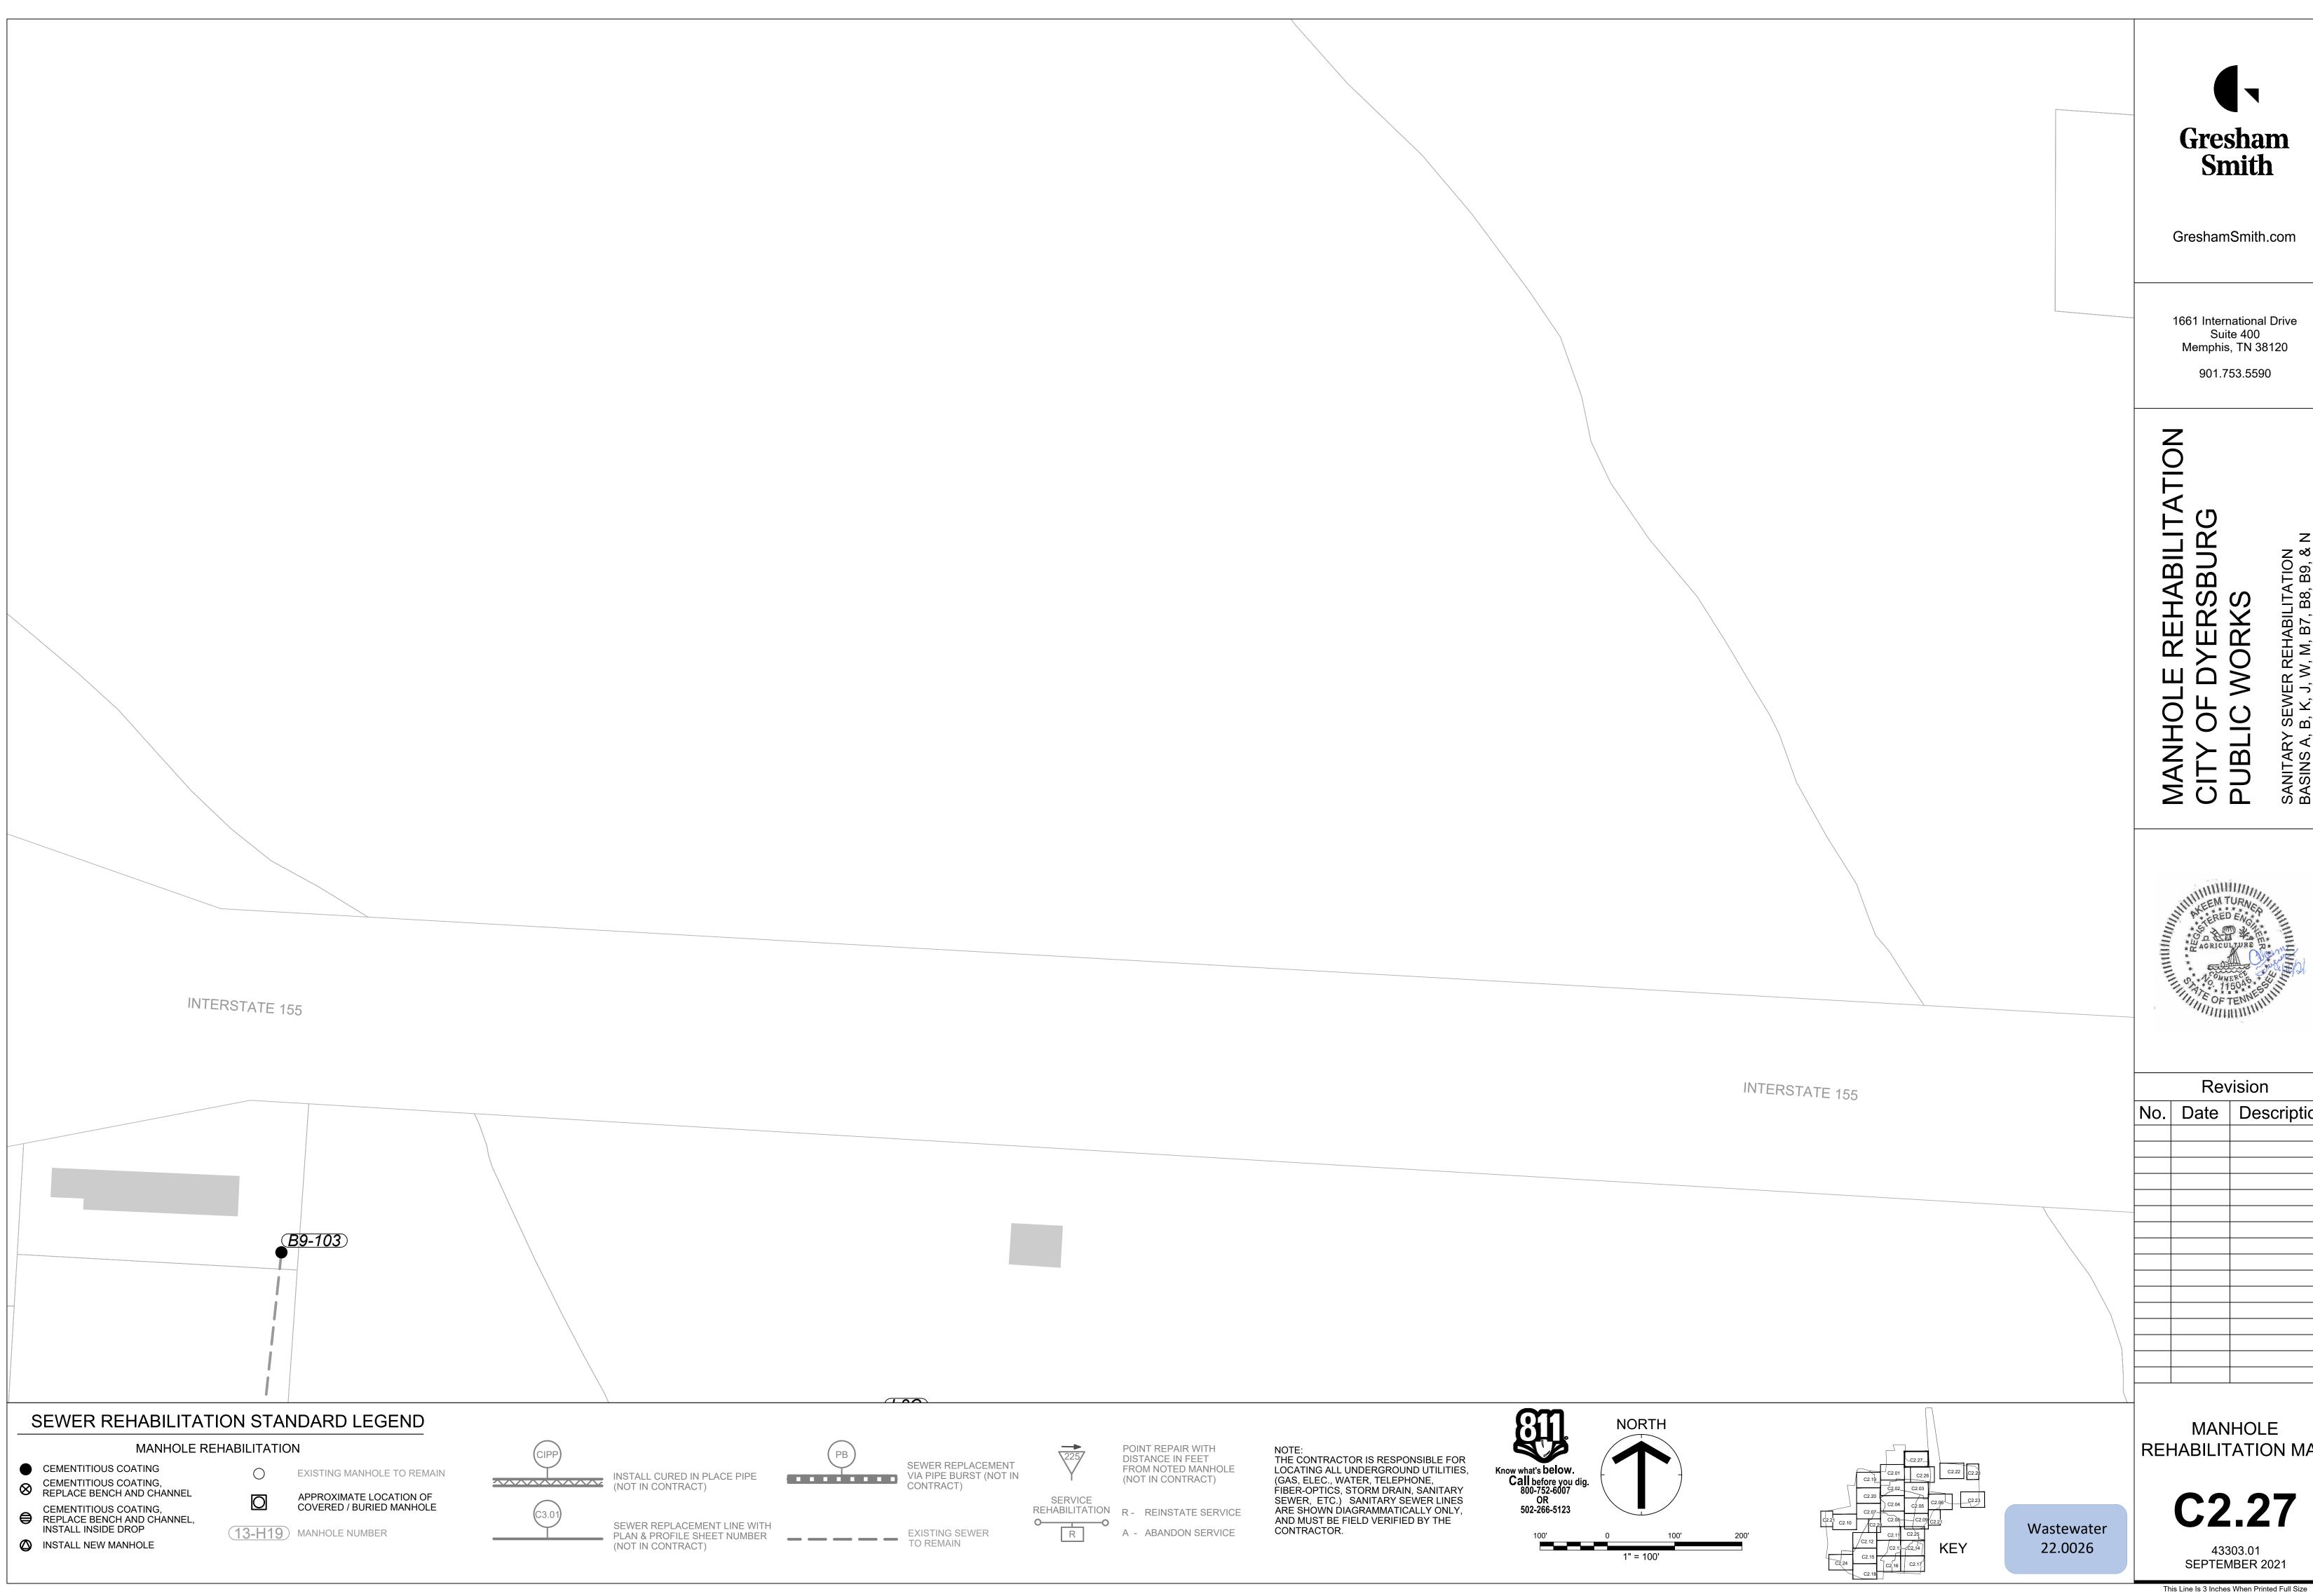


GreshamSmith.com

1661 International Drive Suite 400 Memphis, TN 38120

901.753.5590

PUBLIC


SANITARY SEWER REHABILITATION BASINS A, B, K, J, W, M, B7, B8, B9, & N

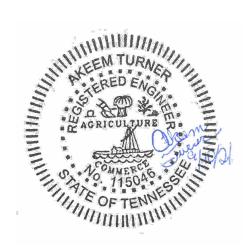



Revision No. Date Description

MANHOLE REHABILITATION MAP

C2.27

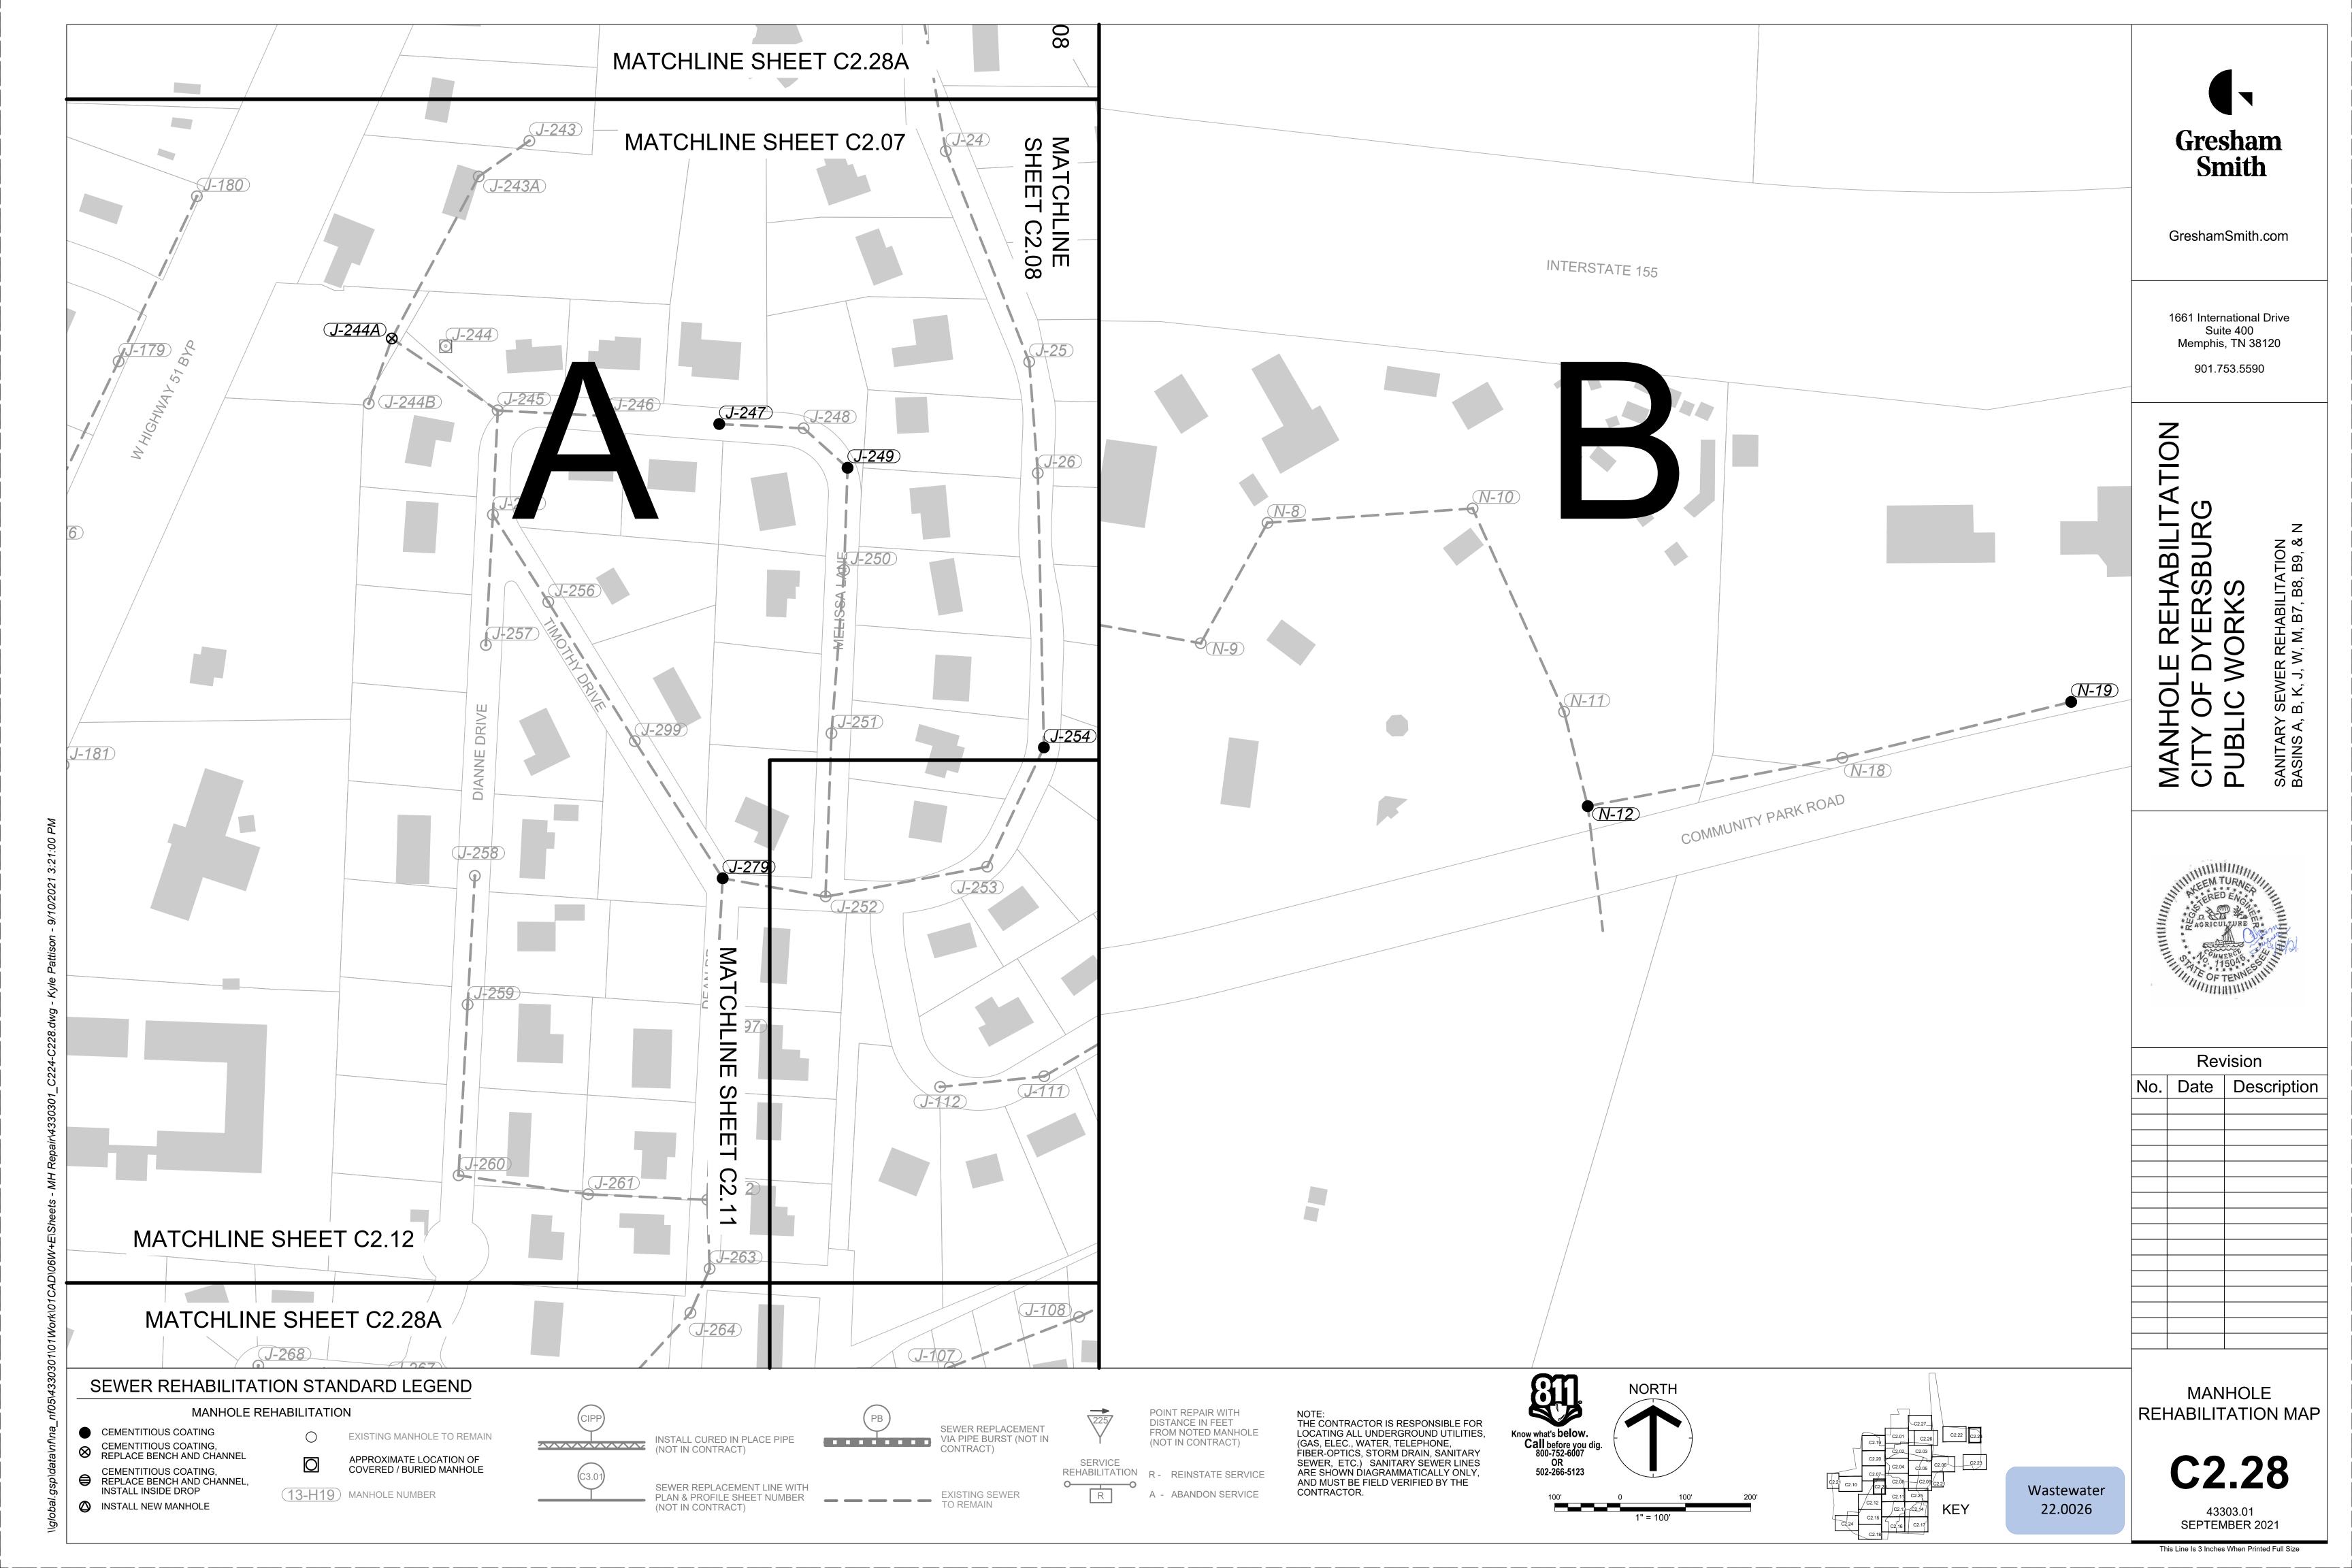

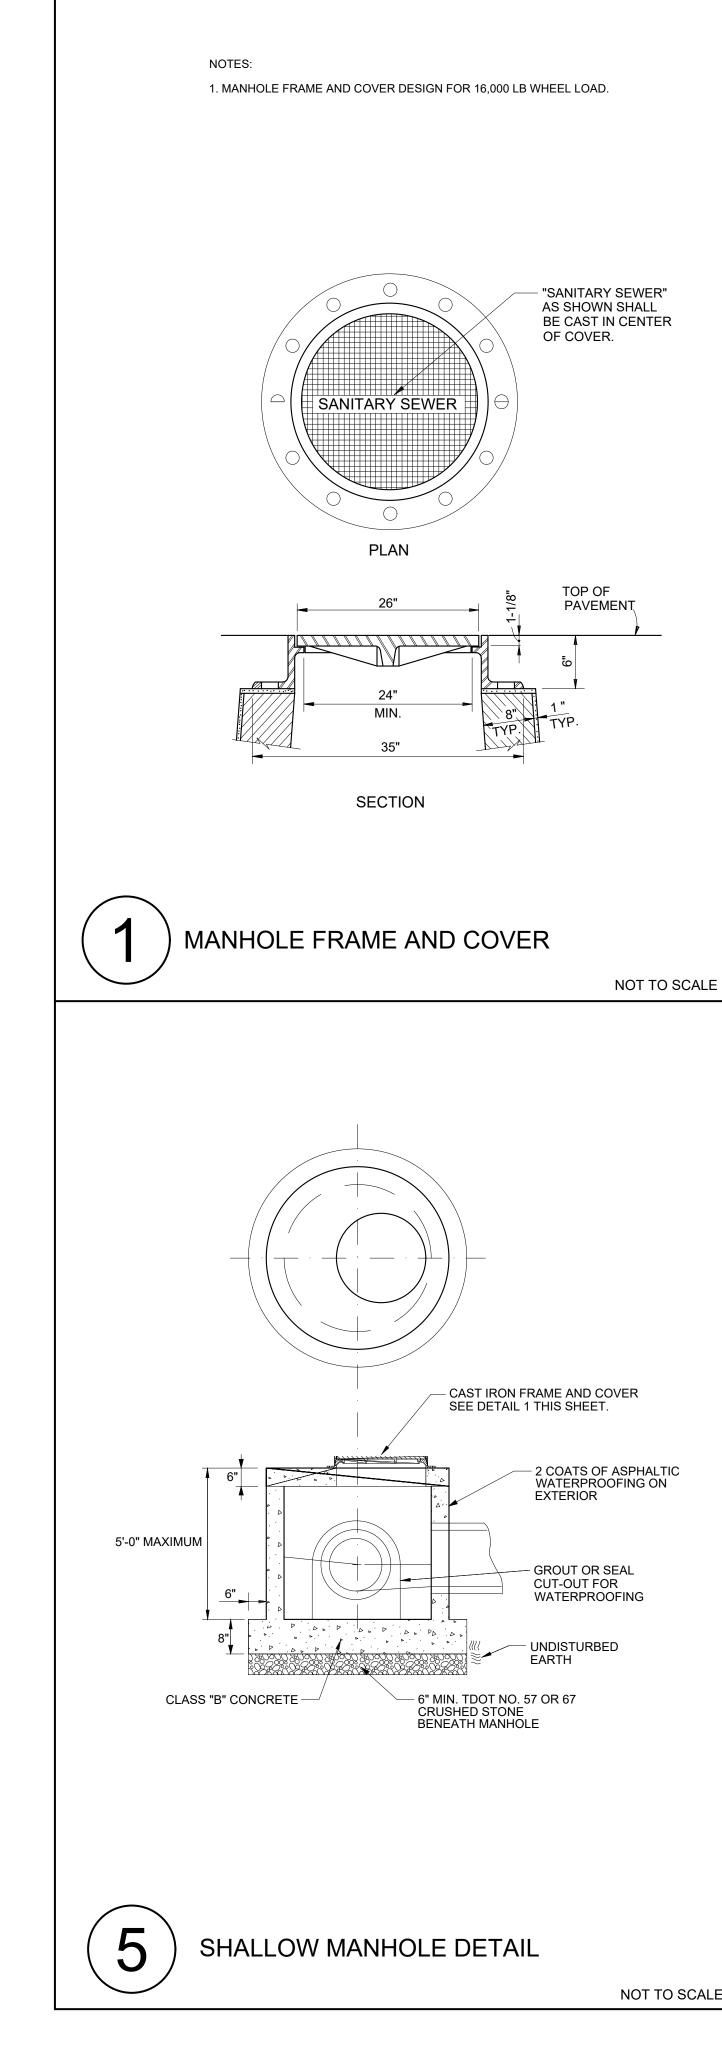

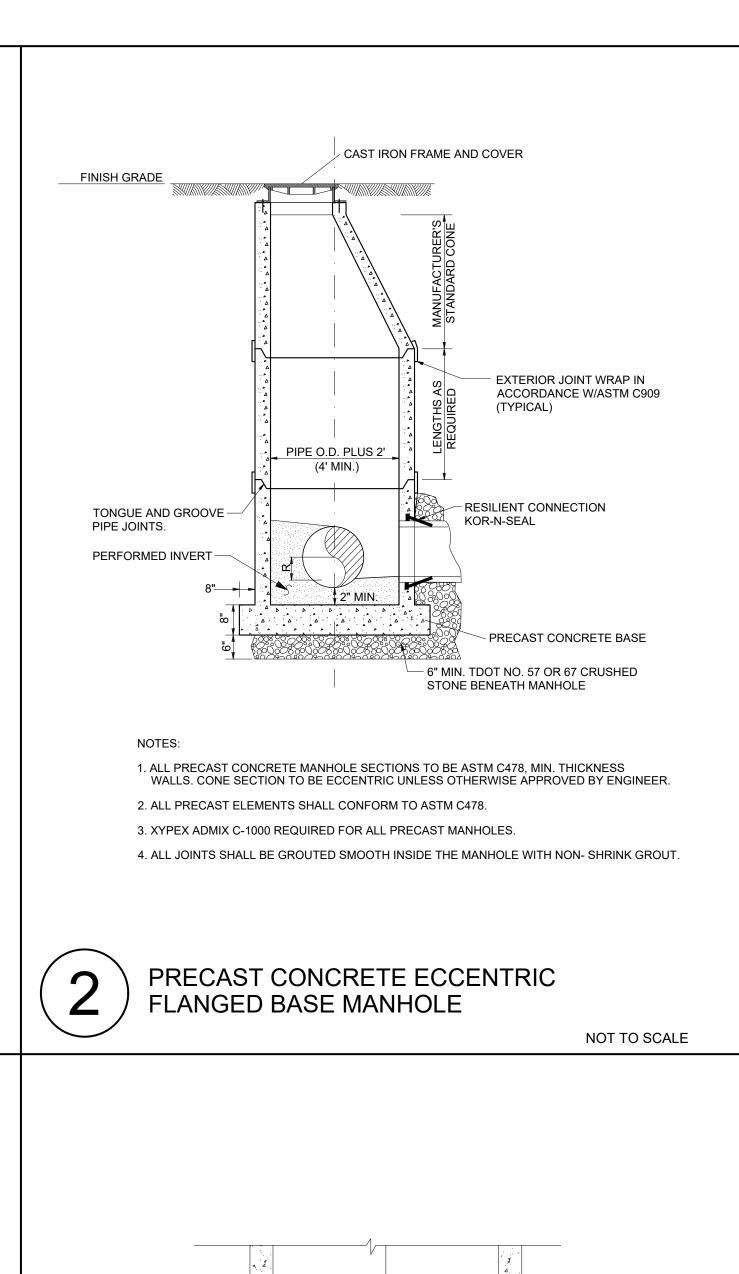

DROP BOWL-RELINER/ DURAN, INC.

PVC DROP -


316 STAINLESS


STEEL BRACKETS

INSIDE MANHOLE DROP ASSEMBLY

NOT TO SCALE

NOT TO SCALE

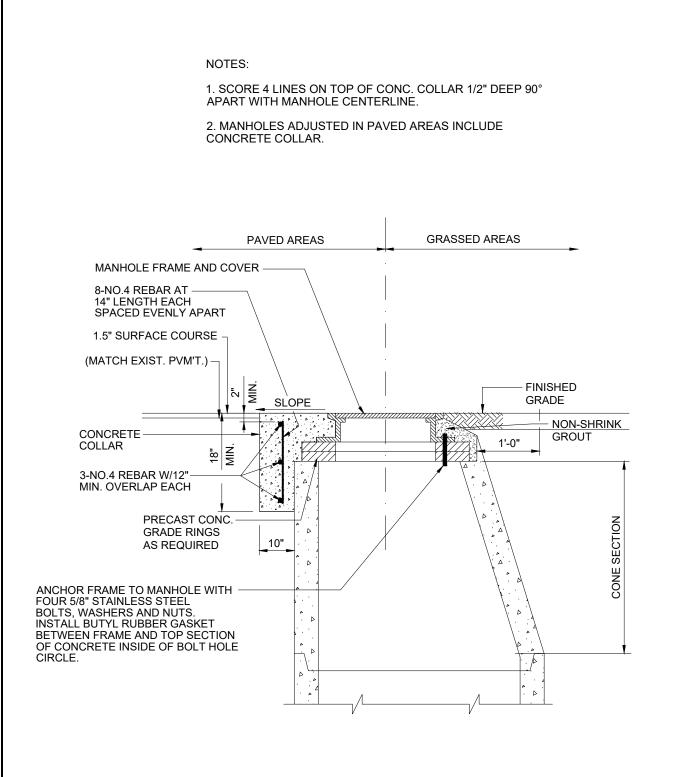

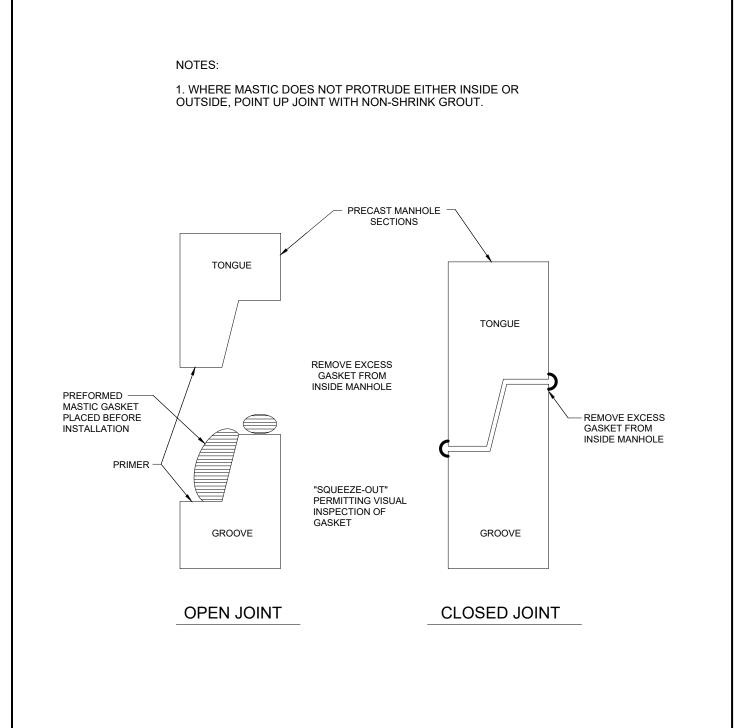

GASKET FOR PRECAST MANHOLE SECTIONS

NOT TO SCALE

CASTING INSTALLATION DETAIL

MANHOLE SIDEWALL

FLOW

SS BAND

RESILIENT ? CONNECTOR

RESILIENT CONNECTION

TO MANHOLE

SEWER

NOT TO SCALE

, FLEXIBLE GASKET

MATERIAL PLACED AROUND PIPE

NOT TO SCALE

RESILIENT CONNECTION (AS SPECIFIED) FORCE MAIN OR GRAVITY SEWER

1. EXISTING MANHOLES SHALL BE CORE DRILLED FOR CONNECTION. INVERT SHALL BE PREFORMED TO CHANNEL FLOW. EXISTING GRAVITY SEWER -SMOOTH CONTINUOUS RADII (TYP.) **NEW CHANNEL NEW FORCE MAIN** FORM NEW CHANNEL

CONNECTION TO EXISTING MANHOLE

W/ CLASS C CONCRETE BASE CHANNELIZATION

Wastewater 22.0026

NOT TO SCALE


Gresham **Smith**

GreshamSmith.com

1661 International Drive Suite 400 Memphis, TN 38120

901.753.5590

'ATION **ABILIT** ERSBURG R REHABILITATION W, M, B7, B8, B9, & UB

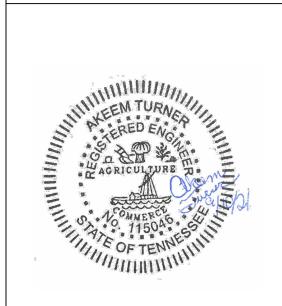

Revision						
No.	Date	Description				

MANHOLE DETAILS

C9.01

SEPTEMBER 2021 This Line Is 3 Inches When Printed Full Size

NOT TO SCALE

NOT TO SCALE

NOT TO SCALE

Gresham Smith


GreshamSmith.com

1661 International Drive Suite 400 Memphis, TN 38120

901.753.5590

DLE REHABILITATION F DYERSBURG WORKS

PUBL

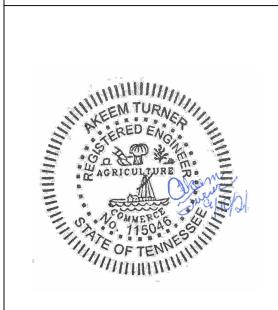

	Rev	vision
No.	Date	Description
MA	ANHOL	E DETAILS

C9.02

43303.01 SEPTEMBER 2021

This Line Is 3 Inches When Printed Full Size

22.0026

NOT TO SCALE

Wastewater